

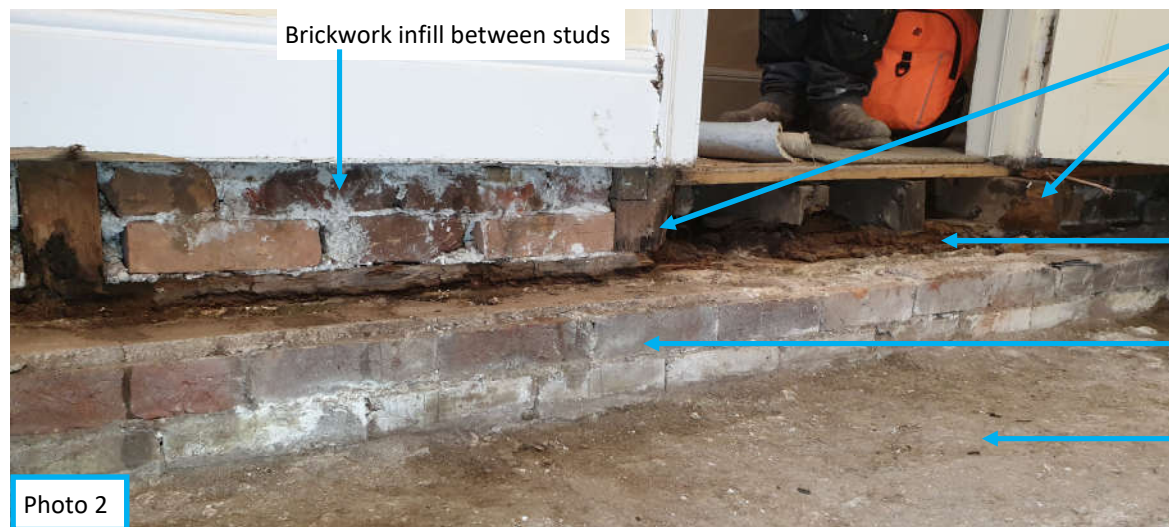


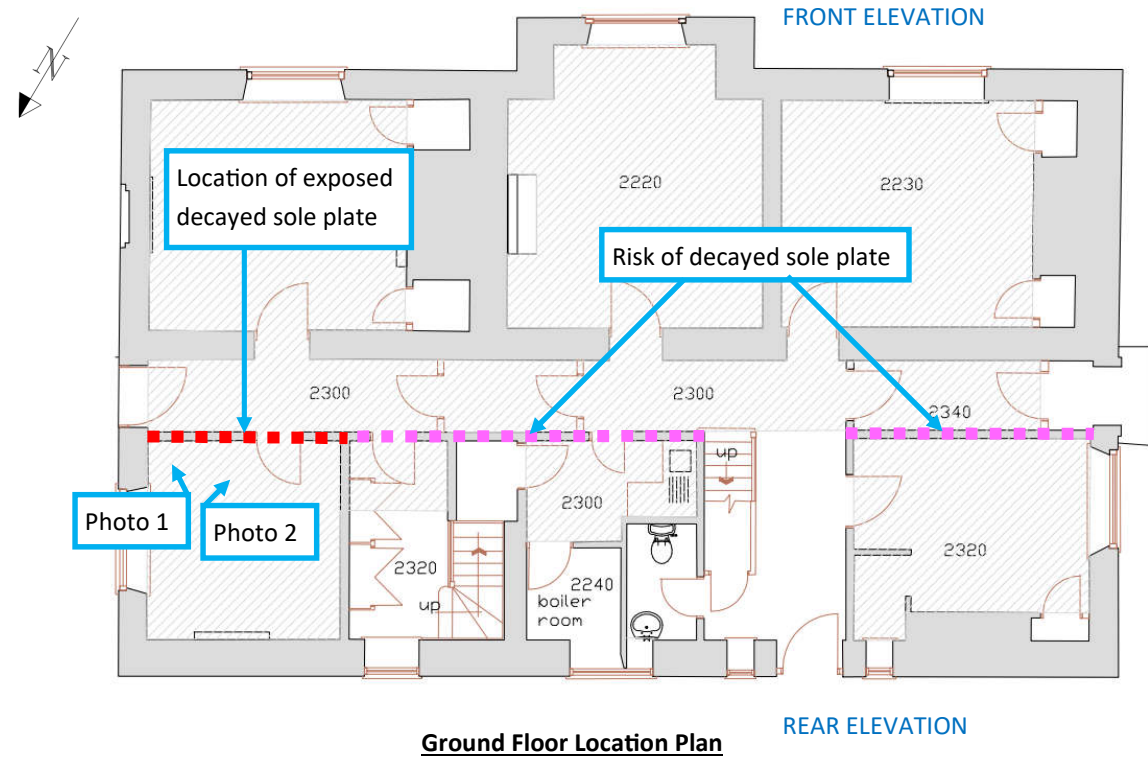

Brickwork infill removed to allow works to progress safely, then reinstated following completion of the works if required.

Alternative options:

- Infill wall with modern timber stud-work with noggins at 600 vt centre.
- Retain brickwork supporting from needles or Strongboys during the works.

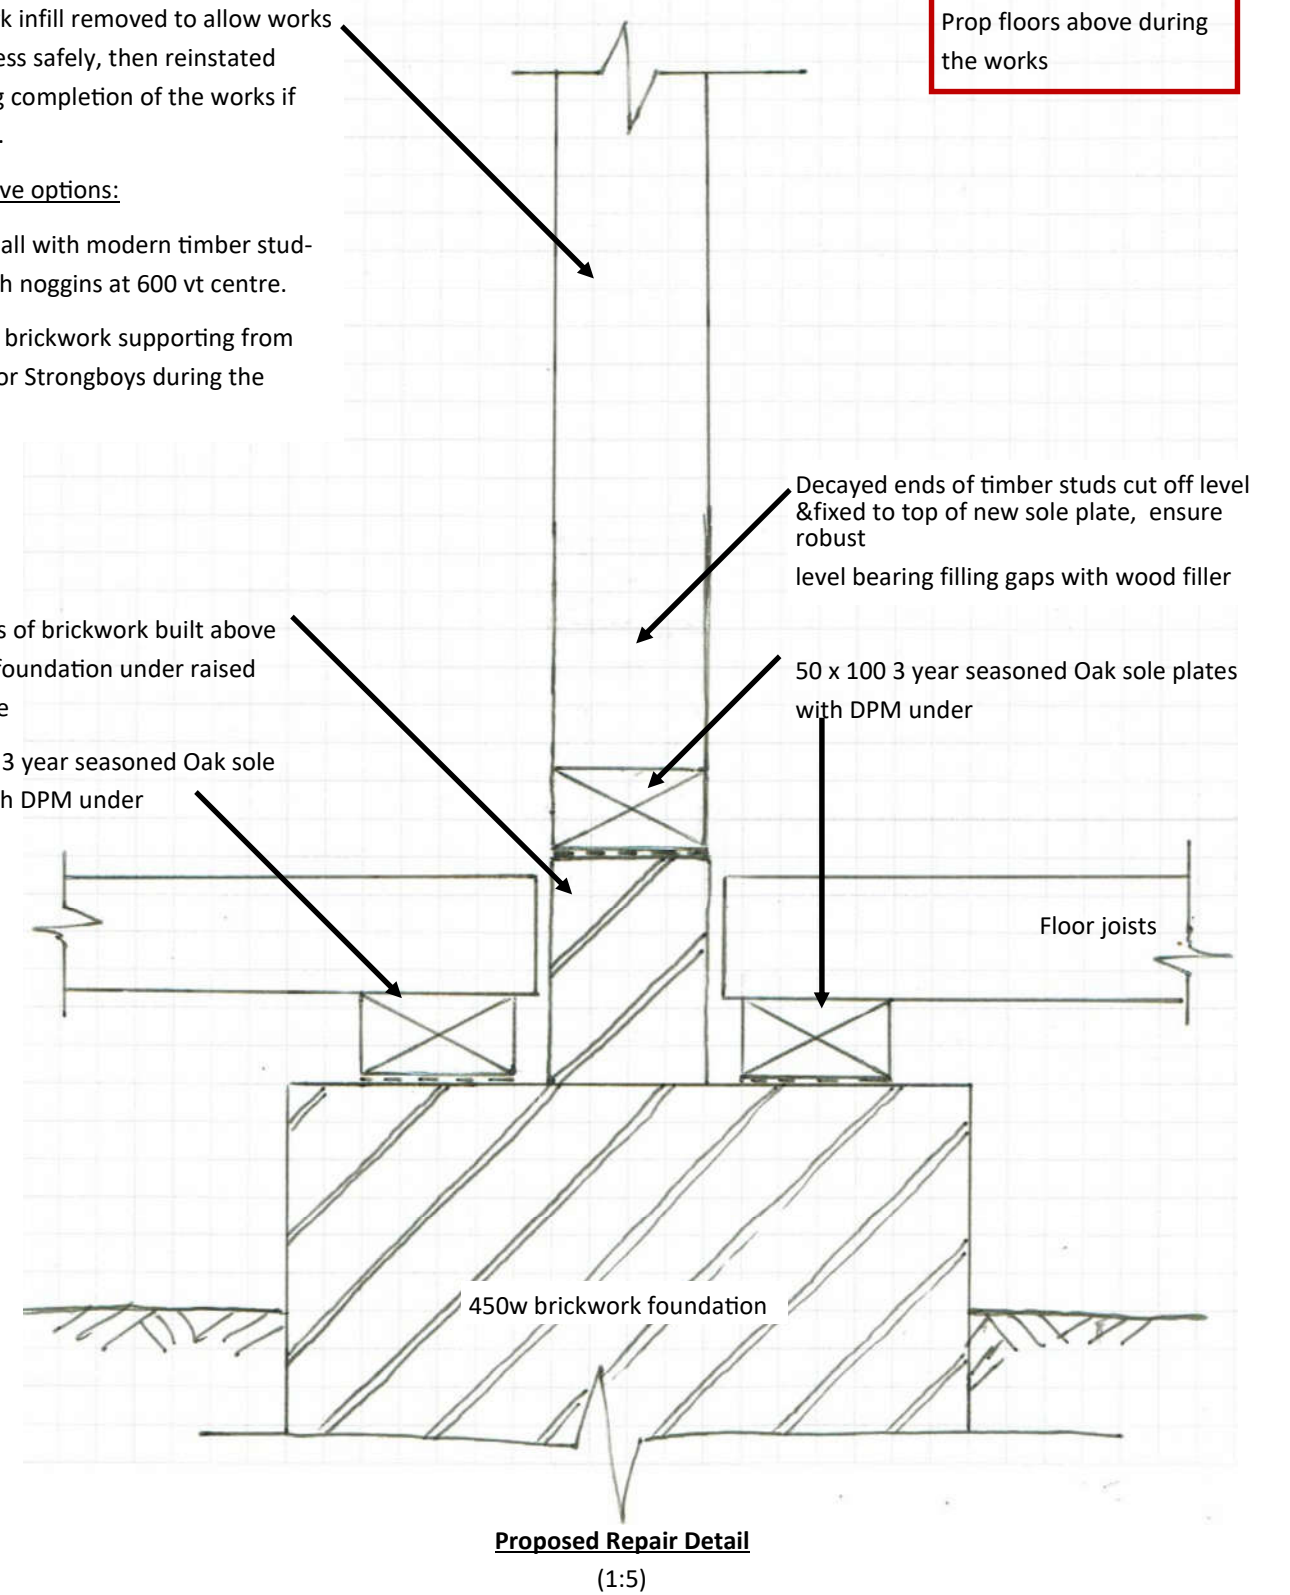

Alternative repair detail

Locally cut out sections of decayed sole plate and infill with tiles bedded on mortar incorporating a DPM. This would still need temporary works to support the wall and is considered a less robust detail.