



Property Risk Inspection
LIMITED

PRELIMINARY ARBORICULTURAL REPORT



Risk Address:

Coombe Farm, Coombe Lane, Bratton, Westbury BA13 4SY

For:

Client: Sedgwick International UK
Insurer: NFU Mutual Insurance

Client Ref: 10974511
Insurer Ref: 2025C1395153~2772578

 Council Name: Wiltshire

 PRI Ref: 346384

 Arborist: Ryan Ollman

 Survey Date: 14-01-2026

 Statutory Controls: Yes

 Case pathway: B2/C1

 QC: Henry Collings

 QC Date: 14-01-2026



CONTENTS

1.0	INTRODUCTION AND BRIEF	3
2.0	LIMITATIONS	3
3.0	DISCUSSION AND ANALYSIS	4
4.0	CONCLUSIONS AND RECOMMENDATIONS	5
5.0	STATUTORY CONTROLS	7
6.0	APPENDIX 1: TREE TABLES	8
7.0	APPENDIX 2: SITE PLAN	14
8.0	APPENDIX 3: SITE PHOTOGRAPHS	16
9.0	APPENDIX 4: ENVIRONMENTAL STATEMENT & CO2e POLICY	30





1.0 INTRODUCTION AND BRIEF

- 1.1** Property Risk Inspection has been instructed on behalf of the building insurers of the insured property. We have been advised that the insured property has suffered differential movement and damage that is considered to have been caused by trees growing adjacent to the property influencing soils beneath its foundations.
- 1.2** We have been instructed to undertake a survey of the vegetation growing adjacent to the insured property in order to provide our opinion as to whether, based on the available information, any of this vegetation is likely to be influencing soil moisture levels beneath the foundations of the property, and if so, to provide recommendations as to what tree management could be implemented to effectively prevent damage continuing.
- 1.3** The vegetation growing adjacent to the risk address has been surveyed from the ground. All distances are measured to the nearest point of the risk address unless otherwise stated.

2.0 LIMITATIONS

- 2.1** Recommendations with respect to tree management are associated with the risk address as stated on the front cover of this report and following consultation with investigating engineers. The survey of trees and any other vegetation is associated with impacts on the risk address subject of this report. Matters of tree health, structural condition, and/or the safety of vegetation under third party control are specifically excluded. Third party land owners are strongly advised to seek their own professional advice as it relates to the health and stability of trees under their control.
- 2.2** Recommendations do not take account of any necessary permission (statutory or otherwise) that must be obtained before proceeding with any tree works.
- 2.3** Recommendations do not take account of any requirements for survey or mitigation relating to European or other protected species, e.g. bird nesting or bats. Land owners must obtain their own professional advice in respect of any protected species.



3.0 DISCUSSION AND ANALYSIS

3.1 Soils, soil water and vegetation

All vegetation requires water to live, and this water is substantially accessed from the soil within which the plants' roots grow.

If the soil is classified as a clay soil, then it will hold very much more water than sands, gravels and loam soils. As plants abstract water from the clay soil, the soil volume will “shrink” and “swell” during the summer as water is first removed and then added by summer rainfall. In years in which rainfall during the summer is less than the total amount of water taken from the soil by plants, shrinkage will occur. This shrinkage may remove support from building foundations, leading to cracking in the fabric of the building.

3.2 Vegetation management

The control of trees, shrubs, and climbers, by removal or pruning as appropriate, are proven techniques that can control total soil water loss thereby minimising soil shrinkage and allowing repairs to proceed.

If vegetation management works are carried out promptly, then repairs can usually proceed very quickly and the duration and distress associated with the disruption that tree related subsidence brings can be minimised.

3.3 Third party liaison and statutory controls

Tree roots do not respect physical or property boundaries and can travel for many metres beyond the above ground “dripline” of the canopy of the vegetation.

The purpose of this report is to ascertain which vegetation is the most likely substantial and/or effective contributory cause of the damage witnessed to allow for liaison with third parties or with local administrative Councils as necessary.

3.4 Evidential framework

The engineer has determined on a preliminary basis the damage to the property, its location and the likely mechanism of movement, and has concluded that the building failure is related to differential subsidence damage caused as a result of the action of vegetation. Where a factual geotechnical report has been completed, this will describe the below ground foundation design, soil and geotechnical conditions, as well as any root identification where available.



4.0 CONCLUSIONS AND RECOMMENDATIONS

4.1 Recommendations

On the basis of our findings, we have considered a practical vegetation management specification.

This specification will assist in reducing the impact of the adjacent vegetation on soil moisture levels, thereby potentially stabilising foundations of the affected area of the building.

Where felling has been proposed, this will be on the basis that the vegetation in question would not respond well to a severe reduction in leaf area that would inevitably lead to decay, the development of potential hazards, and an annual or other on-going management commitment and cost.

If pruning is recommended, the specification will be designed to allow continual ease of re-pruning with a reasonable prospect of a reduction in soil water use.

4.2 Recommended vegetation management to address the current subsidence:

Tree No:	Species	Works Required	CA	TPO	Ownership
H1	Beech (Common)	Fell and treat stump with eco plugs (broadleaved).	Yes	No	PH
HG3	Mixed species group	Fell and treat stump with eco plugs (broadleaved). Removal of closest 3.5m section. No other works to remaining group	No	No	PH
S1	Rose	Fell and treat stump with eco plugs (broadleaved).	No	No	PH
S2	Rose	Fell and treat stump with eco plugs (broadleaved).	No	No	PH
S4	Rose	Fell and treat stump with eco plugs (broadleaved).	No	No	PH
S6	Pyracantha	Fell and treat stump with eco plugs (broadleaved).	No	No	PH
T4	Lime (Common)	Fell and treat stump with eco plugs (broadleaved).	Yes	No	PH
T5	Lime (Common)	Fell and treat stump with eco plugs (broadleaved).	Yes	No	PH
T6	Lime (Common)	Fell and treat stump with eco plugs (broadleaved).	Yes	No	PH
T7	Apple	Fell and treat stump with eco plugs (broadleaved).	Yes	No	PH



T9	Sycamore	Fell and treat stump with eco plugs (broadleaved).	Yes	No	PH
T11	Lilac	Fell and treat stump with eco plugs (broadleaved).	Yes	No	PH

4.3 Recommended vegetation management to address health and safety risk:

Tree No:	Species	Works Required	CA	TPO	Ownership
T2	Lime (Common)	Fell and grind stump	Yes	No	PH
T3	Lime (Common)	Fell and grind stump	Yes	No	PH

The above works concentrate on seeking to prevent ongoing subsidence at the address.

As part of our survey, we will also seek to advise on any vegetation which is likely to outgrow its location in the short term and may also be an ongoing risk to the property later.

Examples might be young trees that have self-sown next to the address, conifers planted far too close or hedges that need to come under management.

See the main tree tables for these additional works and if appropriate they may be scheduled as part of the tree works above.



5.0 STATUTORY CONTROLS

A review of the Wiltshire Council website has confirmed that none of the implicated vegetation is subject to a Tree Preservation Order. There are Conservation Area controls.





6.0 APPENDIX 1: TREE TABLES

Tree No:	Common Name	Age Class	Condition	Height (m)	Crown Spread (m)	Stem diam. (mm)	No. of Stems	Dist to bldg. (m)	Roots Implicated	Pruning History	Recommendation	Tree Work Constraints	Notes	Owner address	Owner
C1	Honey-suckle	Mature	Fair	2.00	1.50	25	10	1.30	No	Managed by regular pruning.	No work required.	There are no restrictions to the site or to the tree - scheduled rates may apply.	Distance is to closest point to property. Approximate DBH range of 5mm - 15mm.	Coombe Farm, Coombe Lane, Bratton BA13 4SY	PH
H1	Beech (Common)	Mature	Fair	2.50	1.25	275	1	5.30	No	Managed by regular pruning.	Fell and treat stump with eco plugs (broadleaved).	There are no restrictions to the site or to the tree - scheduled rates may apply.	Distance is to closest point to property.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH
HG1	Beech (Common)	Mature	Fair	2.00	1.50	50	20	9.00	No	Managed by regular pruning.	No work required.	There are no restrictions to the site or to the tree - scheduled rates may apply.	All measurements estimated due to lack of access. Located on raised ground 1.1m high.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH
HG2	Beech (Common)	Mature	Fair	2.00	1.50	50	20	5.00	No	Managed by regular pruning.	No work required.	There are no restrictions to the site or to the tree - scheduled rates may apply.	All measurements estimated due to lack of access. Located on raised ground 1.1m high.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH
HG3	Mixed species group	Mature	Fair	2.00	1.75	50	20	3.50	No	Managed by regular pruning.	Fell and treat stump with eco plugs (broadleaved). Removal of closest 3.5m section. No other works to remaining group.	There are no restrictions to the site or to the tree - scheduled rates may apply.	Distance is to closest point to property. Group consists of Mahonia, Beech, Forsythia, and Lilac with an approximate DBH range of 30mm - 75mm.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH



Tree No:	Common Name	Age Class	Condition	Height (m)	Crown Spread (m)	Stem diam. (mm)	No. of Stems	Dist to bldg. (m)	Roots Implicated	Pruning History	Recommendation	Tree Work Constraints	Notes	Owner address	Owner
S1	Rose	Mature	Fair	1.50	1.00	25	10	0.00	No	Managed by regular pruning.	Fell and treat stump with eco plugs (broadleaved).	There are no restrictions to the site or to the tree - scheduled rates may apply.	Distance is to closest point to property. Approximate DBH range of 5mm - 20mm.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH
S2	Rose	Mature	Fair	2.00	2.00	25	10	0.00	No	Managed by regular pruning.	Fell and treat stump with eco plugs (broadleaved).	There are no restrictions to the site or to the tree - scheduled rates may apply.	Distance is to closest point to property. Approximate DBH range of 10mm - 25mm. Crown lopsided to the west.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH
S3	Rose	Mature	Fair	1.50	1.50	25	10	2.80	No	Managed by regular pruning.	No work required.	There are no restrictions to the site or to the tree - scheduled rates may apply.	Distance is to closest point to property. Located on raised ground 1.1m high. Approximate DBH range of 10mm - 30mm.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH
S4	Rose	Mature	Fair	2.50	1.00	25	4	0.40	No	Managed by regular pruning.	Fell and treat stump with eco plugs (broadleaved).	There are no restrictions to the site or to the tree - scheduled rates may apply.	Distance is to closest point to property. Approximate DBH range of 10mm - 30mm.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH
S5	Cotoneaster	Mature	Fair	3.00	3.00	25	20	4.40	Yes	Managed by regular pruning.	No work required.	There are no restrictions to the site or to the tree - scheduled rates may apply.	Distance is to closest point to property. Approximate DBH range of 10mm - 30mm. Roots implicated although unlikely from this shrub.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH
S6	Pyracantha	Mature	Fair	4.50	2.50	25	8	0.00	Yes	Managed by regular pruning.	Fell and treat stump with eco plugs (broadleaved).	There are no restrictions to the site or to the tree - scheduled rates may apply.	Distance is to closest point to property. Approximate DBH range of 10mm - 40mm.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH



Tree No:	Common Name	Age Class	Condition	Height (m)	Crown Spread (m)	Stem diam. (mm)	No. of Stems	Dist to bldg. (m)	Roots Implicated	Pruning History	Recommendation	Tree Work Constraints	Notes	Owner address	Owner
SG1	Mixed species group	Mature	Fair	1.00	1.25	25	20	4.00	No	Managed by regular pruning.	No work required.	There are no restrictions to the site or to the tree - scheduled rates may apply.	Distance is to closest point to property. Group consists of Cypress and Cotton Lavender with an approximate DBH range of 5mm - 35mm..	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH
SG2	Mixed species group	Mature	Fair	4.50	4.00	50	20	4.00	No	No significant past works.	No work required.	There are no restrictions to the site or to the tree - scheduled rates may apply.	All measurements estimated due to lack of access. Located on raised ground 1.1m high. Group consists of Holly, Rose, Ash, and Willow with an approximate DBH range of 10mm - 150mm. No works required as part of claim but greater management going forwards is advised.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH
SG3	Mixed species group	Mature	Fair	1.50	2.00	25	20	0.00	No	Managed by regular pruning.	No work required.	There are no restrictions to the site or to the tree - scheduled rates may apply.	Distance is to closest point to property. Group consists of Honeysuckle and Euonymus with an approximate DBH range of 5mm - 35mm.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH
T1	Lime (Common)	Mature	Fair	13.00	10.00	650	1	14.00	No	Subject to historic crown reduction management.	No work required.	There are restrictions to the site or to the tree - contractor should quote. Adjacent to power lines.	Distance is to closest point to property. Large amounts of epicormic growth throughout and up the tree. Crown lopsided to the east and west. No works required as part of claim but greater management going forwards is advised.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH



Tree No:	Common Name	Age Class	Condition	Height (m)	Crown Spread (m)	Stem diam. (mm)	No. of Stems	Dist to bldg. (m)	Roots Implicated	Pruning History	Recommendation	Tree Work Constraints	Notes	Owner address	Owner
T2	Lime (Common)	Mature	Poor	13.00	10.00	575	1	12.40	No	Subject to historic crown reduction management.	Fell and grind stump.	There are restrictions to the site or to the tree - contractor should quote. Adjacent to power lines.	Distance is to closest point to property. Large amounts of epicormic growth throughout and up the tree. Crown lopsided to the east and west. Large amounts of dead wood within crown and upper crown has begun to die off and snap out. Grinding advised to minimise cross contamination.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH
T3	Lime (Common)	Mature	Poor	13.00	10.00	550	1	11.60	No	Subject to historic crown reduction management.	Fell and grind stump.	There are restrictions to the site or to the tree - contractor should quote. Power lines running through crown.	Distance is to closest point to property. Large amounts of epicormic growth throughout and up the tree. Crown lopsided to the east and west. Large amounts of dead wood within crown and upper crown has begun to die off and snap out. Grinding advised to minimise cross contamination.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH
T4	Lime (Common)	Mature	Fair	15.00	12.00	650	1	7.80	No	Subject to historic crown reduction management.	Fell and treat stump with eco plugs (broadleaved).	There are restrictions to the site or to the tree - contractor should quote. Power lines running through crown.	Distance is to closest point to property. Large amounts of epicormic growth throughout and up the tree. Crown lopsided to the east and west.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH



Tree No:	Common Name	Age Class	Condition	Height (m)	Crown Spread (m)	Stem diam. (mm)	No. of Stems	Dist to bldg. (m)	Roots Implicated	Pruning History	Recommendation	Tree Work Constraints	Notes	Owner address	Owner
T5	Lime (Common)	Mature	Fair	16.00	12.00	700	1	6.40	No	Subject to historic crown reduction management.	Fell and treat stump with eco plugs (broadleaved).	There are restrictions to the site or to the tree - contractor should quote. Power lines running adjacent to crown.	Distance is to closest point to property. Large amounts of epicormic growth throughout and up the tree. Crown lopsided to the east and west.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH
T6	Lime (Common)	Mature	Fair	16.00	12.00	750	1	6.00	No	Subject to historic crown reduction management.	Fell and treat stump with eco plugs (broadleaved).	There are restrictions to the site or to the tree - contractor should quote. Power lines running adjacent to crown.	Distance is to closest point to property. Large amounts of epicormic growth throughout and up the tree. Crown lopsided to the north.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH
T7	Apple	Mature	Fair	3.50	7.00	225	4	8.60	Yes	Subject to historic crown reduction management.	Fell and treat stump with eco plugs (broadleaved).	There are restrictions to the site or to the tree - contractor should quote. Overhanging oil tank.	Distance is to closest point to property. Crown lopsided to the southeast. Approximate DBH range of 110mm - 240mm.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH
T8	Apple (Crab)	Mature	Fair	6.00	6.00	200	6	10.30	No	No significant past works.	No work required.	There are restrictions to the site or to the tree - contractor should quote. Overhanging oil tank.	Some measurements estimated due to lack of access. Distance is to closest point to property. Tree covered in ivy. Approximate DBH range of 70mm - 250mm. No works required as part of claim but greater management going forwards is advised.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH
T9	Sycamore	Mature	Fair	11.00	10.00	475	1	14.50	No	No significant past works.	Fell and treat stump with eco plugs (broadleaved).	The commercial third party will be responsible for works.	All measurements estimated due to lack of access.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH




Tree No:	Common Name	Age Class	Condition	Height (m)	Crown Spread (m)	Stem diam. (mm)	No. of Stems	Dist to bldg. (m)	Roots Implicated	Pruning History	Recommendation	Tree Work Constraints	Notes	Owner address	Owner
T10	Ash (Common)	Semi-Mature	Fair	3.50	1.00	50	1	4.10	No	No significant past works.	No work required.	There are no restrictions to the site or to the tree - scheduled rates may apply.	Distance is to closest point to property. Located on raised ground 1.1m high. No works required as part of claim, but removal is advised going forwards.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH
T11	Lilac	Mature	Fair	5.00	9.00	150	12	7.50	No	No significant past works.	Fell and treat stump with eco plugs (broadleaved).	There are no restrictions to the site or to the tree - scheduled rates may apply.	All measurements estimated due to lack of access. Distance is to closest point to property. Tree covered in ivy. Crown lopsided to the southwest. Approximate DBH range of 60mm - 280mm.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH
T12	Beech (Common)	Mature	Fair	16.00	10.00	425	1	17.00	No	No significant past works.	No work required.	There are no restrictions to the site or to the tree - scheduled rates may apply.	Some measurements estimated due to limited access. Crown lopsided to the south. No works required as part of claim but greater management going forwards is advised.	Combe Farm, Coombe Lane, Bratton BA13 4SY	PH

* Value is estimated



7.0 APPENDIX 2: SITE PLAN



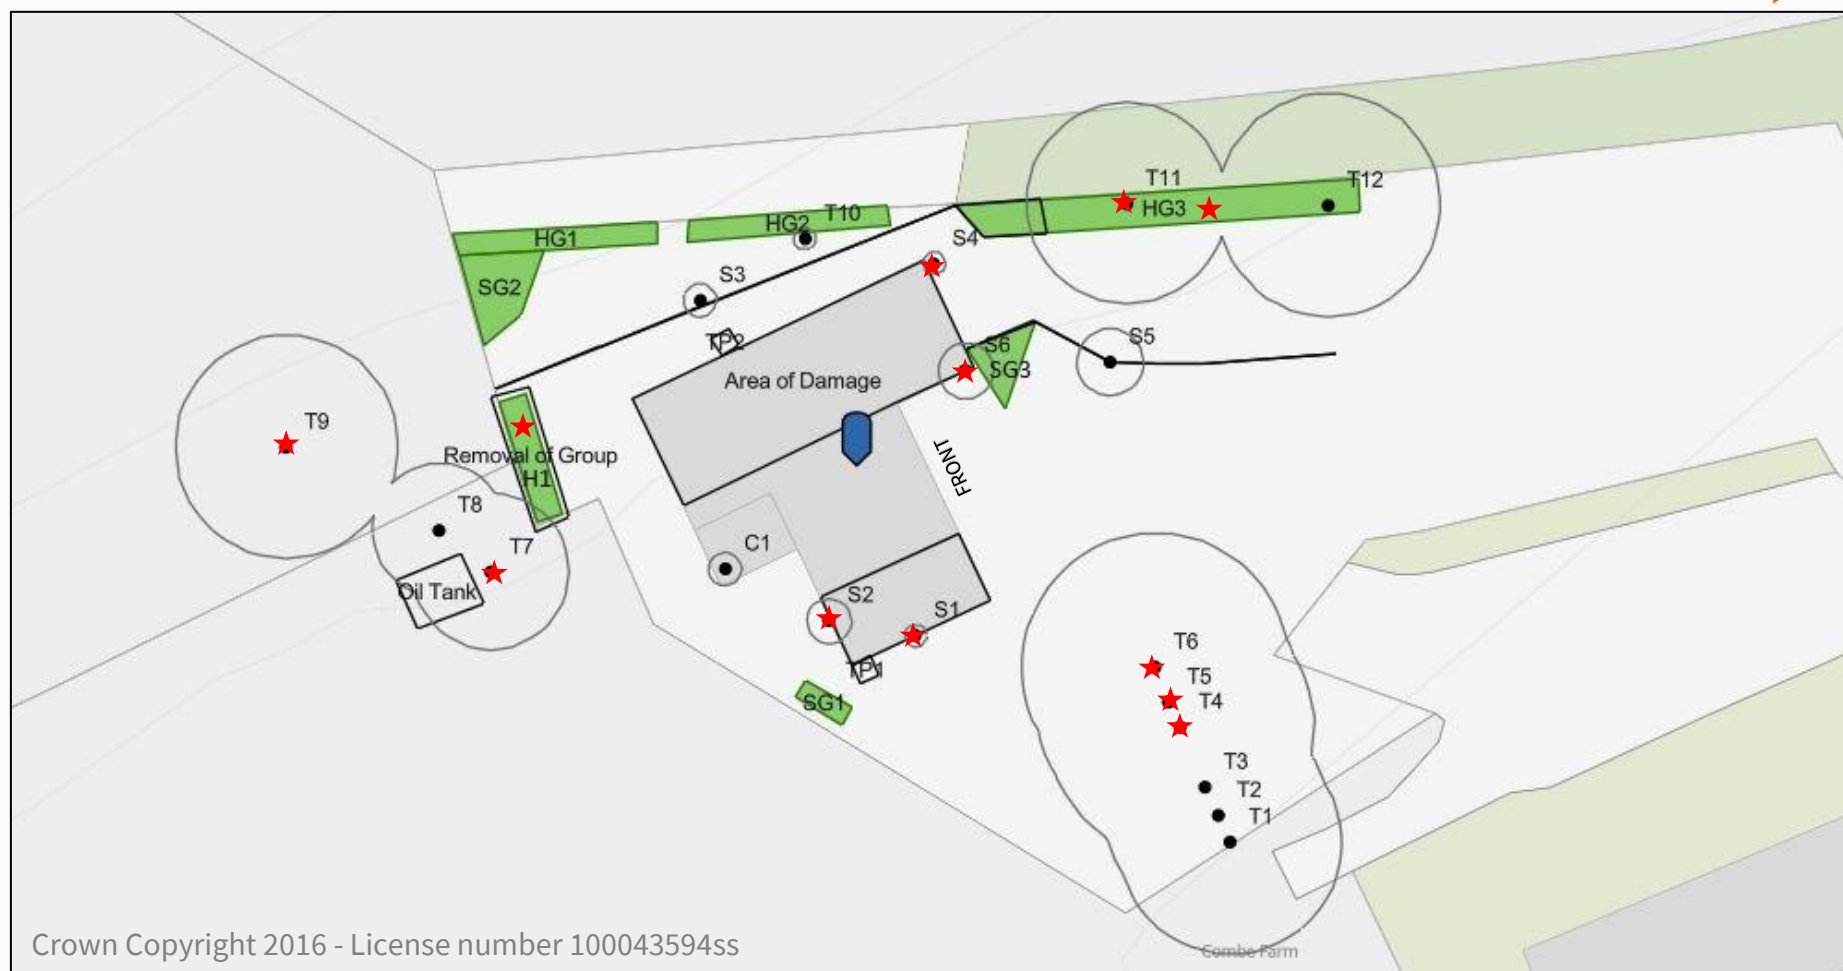

Location: Coombe Farm, Coombe Lane, Bratton, Westbury BA13 4SY

Job Ref: 346384

Survey date: 14-01-2026

By Property Risk Inspection - Insurance Services

8.0 APPENDIX 3: SITE PHOTOGRAPHS



H1 Beech (Common)



H1 Beech (Common)



HG3 Mixed species group



HG3 Mixed species group



S1 Rose



S2 Rose



S4 Rose



S6 Pyracantha




T2 Lime (Common)



T2 Lime (Common)



T3 Lime (Common)

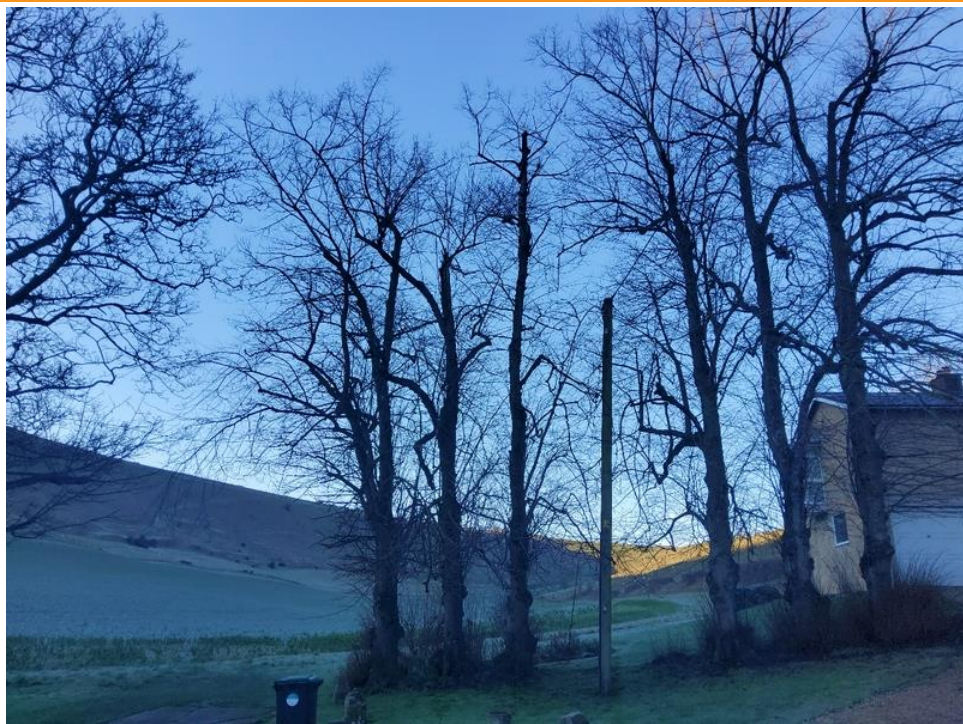

T3 Lime (Common)



T4 Lime (Common)



T4 Lime (Common)




T5 Lime (Common)



T5 Lime (Common)



T6 Lime (Common)

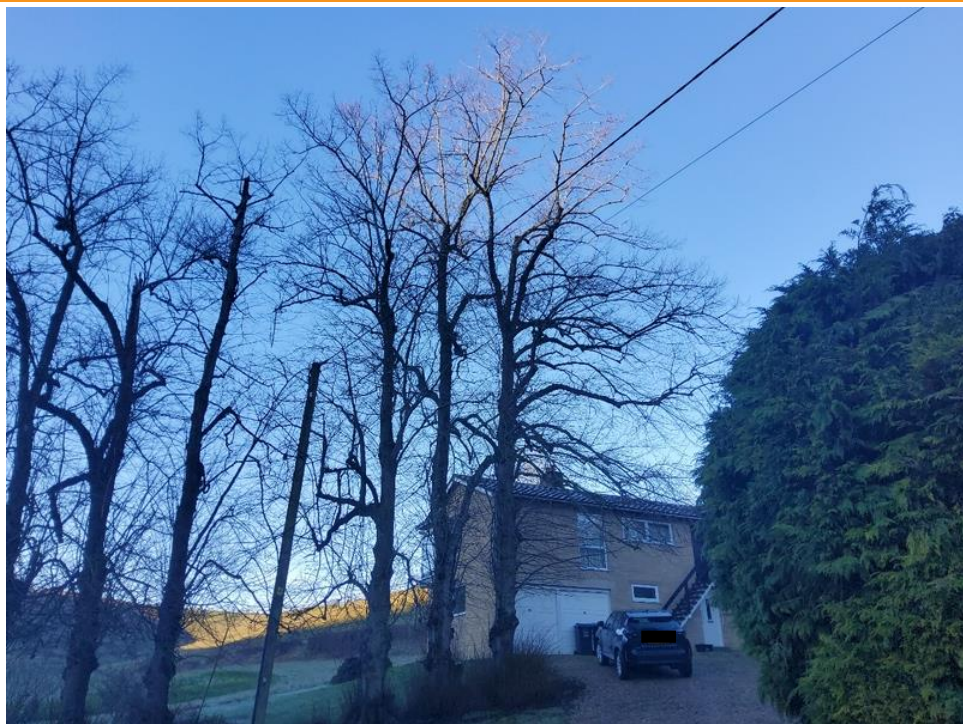

T6 Lime (Common)



T7 Apple



T7 Apple



T9 Sycamore



T9 Sycamore



Further vegetation observed to front of property however considered outside expected influencing distance at point of.



Further vegetation observed to front of property however considered outside expected influencing distance at point of.



Limited to no vegetation to rear LHS of property within an influencing distance or size.



Limited to no vegetation to rear LHS of property within an influencing distance or size.



RHS of property located on raised ground.



RHS of property located on raised ground.



9.0 APPENDIX 4: ENVIRONMENTAL STATEMENT & CO2e POLICY

Tree removal as a remedy for subsidence of low-rise buildings

When subsidence occurs to a residential home which has foundations within clay soils one common cause of movement is the presence of trees, hedges and other vegetation removing moisture from the clay causing a shrinkage of the soil and downward movement of foundations.

There are a variety of ways in which subsidence of low-rise buildings can be mitigated and this report details the vegetation options that can be implemented and that should effectively deal with the cause of movements.

It is acknowledged that removal of trees has impacts on visual amenities for owners and the wider community and that trees play an important role in our towns, cities, and the countryside in a variety of positive ways.

Trees are not recommended for removal without a clear understanding of all these impacts and increasingly of the importance of due consideration relating to the climate crisis, of global climate change and of potential negative impacts in the UK and abroad.

The subsidence event must be remedied to secure the property, its energy efficiency and weather tightness, to maintain its saleability and suitability for mortgage or re-mortgage finance if sold and as a requirement of the insurers commitment under the terms of the policy.

In considering a vegetation remedy the insurer, their advisors and arboricultural specialists are seeking to minimise impacts to the policyholder, to remedy the cause of movement quickly and effectively, and allow subsequent repairs to commence without risk of recurrence of damage. To simply leave the property exposed to intermittent periods of repair based on dry periods would also be hugely disruptive to homeowners and costly in repeat super-structural repairs, vehicle movements, materials and other claim costs in CO2e production and would not comply with a Net Zero agenda.

If vegetation management is not possible or was unsuccessful other remedies that might be attempted whether property underpinning, extensive root barriers or other soil and ground stabilisation have their own issues and impacts. Not least of these is the cost to the environment in CO2e generation from creation of cement and cement substitutes, of steel and other metals production, from costs in plastics and then the material transport, insertion, and excavation effort with heavy machinery.

A single tree removal on a site has a relatively modest annual impact on the CO2e budget loss for a site subject to subsidence of around 25kg CO2e per tree per annum. The cost in total of materials and fuel in tree removal are significantly less than 100kg CO2e.

Heavy engineering and ground stabilisation solutions can range in impacts from around 3000kg CO2e to 10,000kg CO2e in carbon cost and are often difficult to effectively mitigate relative to tree management.

However, this is not simply a “site” consideration and insurers and their advisors through PRI are committed to replace every tree lost on a subsidence scheme in sustainable forests and reforestation projects across the globe with thousands of trees already planted and through carbon reduction investments that stop CO2e being generated to have immediate positive impacts whilst new trees grow.

It's always sad to see a tree lost but we ensure that the loss is mitigated and replaced with new trees, and this avoids heavy engineering solutions far more costly to the planet. You can learn more about our work in tree planting, climate change and carbon capture by visiting our web site at: www.propertyrisk.co.uk.





Property Risk Inspection

LIMITED

Insurance Services

8 The Courtyards
Phoenix Square
Wyncolls Road
Colchester
Essex CO4 9PE

01206 751626

insurance@propertyriskinspection.co.uk

www.propertyriskinspection.co.uk