

Scale: 1:250



British Standard 5837-2012 Tree Categories Key	
	BS 5837:2012 Category B Tree Root Protection Area
	BS 5837:2012 Category C Tree Root Protection Area



G TREE LTD
Tel: 01202 748967
g.tree.c@outlook.com

Copyright 202

T6	Norway Maple	17	43 51 18 21	N E S W	7 3 3 3		1	M	<u>Poor</u> -growing from felled or damaged tree -multi-stemmed at 0.3 m, included bark at stem unions -open forming canopy	-due to included bark and shape of canopy, consider either crown-reduction by 3 m or removal	<20	8.7	C2	
T7	Purple Hornbeam	16	69	N E S W	7 6 #6 6	7 3 3	1	M	<u>Fair</u> -sap exudation main stem south at 1 m -historic fence post embedded in tree south -minor deadwood within canopy	-monitor for any increase in sap exudation, if increase occurs contact arborist	<30	8.3	B1/2	
G4	Hornbeam x7	<17	<56	N E S W	9 9 9 9	2+	1	< M	<u>Poor</u> -linear planting -large central tree ivy clad -all trees extensive main stem bark damage, possible cause of heart rot -few trees crying, trees unlikely to recover	-sever and band ivy -further assessment required, consider possible crown-reduction to reduce loading upon weakened stems	<20	<6.7	C2	
T8	Ash	#20	#55	N E S W	#8 #8 #8 #8	#6	5	M	<u>#Fair/Poor</u> -unable to completely assess, neighbours' tree -minor canopy dieback	-monitor for any increased deadwood, if increase occurs contact tree owner	#2 0	6.6	#B/C1	
G5	Privet Ivy Nettle Bramble Hazel Eln Elder Hawthorn	<8	#20	S W	<3	0	0	M	<u>Poor</u> -poor diversity in woody species, Privet & Bramble dominant -dead Elms within hedge	-remove dead trees -consider producing hedgerow management plan to create more diverse hedgerow	<20	2.4	C2	
T9	Hawthorn	8	#35	N E S W	<4 -4 -4 -4			0	M	<u>Fair</u> -bifurcated main stem at 0.5 m -Ivy clad -unable to completely assess due to vegetation -low canopy	-sever Ivy & resurvey	<30	4.2	B/C2
G6	Horse Chestnut x 2 Cherry x 2	<11	<34	W W W W	4 6 3 3	3	1	E M	<u>Poor</u> -Horse Chestnut main stem sap exudation <u>Poor/Fair</u> -Cherry growth suppressed	-consider removal of Horse Chestnut and replanting with different species -prune branches back to 1 m past fence line to retain visual screen but clear paddock	<20	4.1	C2	
T10	European Lime	18	58	N E S W	5 4 6 8			S M/ M	<u>Fair</u> -unable to completely assess due to epicormic growth and ivy on main stem -slight growth suppression from adjacent trees	-remove epicormic and Ivy resurvey	#<3 0	7	#B2	
T11	Robinia Acacia	19	45 40	N E S W	4 6 7 7	4		M	<u>Fair/Poor</u> -bifurcated main stem at 0.5 m, no evidence of movement -growth slightly suppressed -minor deadwood within canopy	-monitor bifurcation for sap exudation and excessive movement in windy conditions	<30	7.2	B/C2	
T12	Ash	#11	#35	N E S W	#3 3 #3 #3	3	3	S M	<u>Poor</u> -unable to completely assess, Ivy clad -poor growing location	-consider removal	#2 0	4.2	C1	

THIS PLAN MUST BE VIEWED IN CONJUNCTION WITH THE ARBORICULTURAL REPORT: GH23104