

The hearth is of ceramic-clad concrete.

The fire place is defined with a red clay tile trim, separating the fire bricks from the decorative tile surround.

The mantle is butted against painted wood panelling

To prevent any further movement between the pilasters and entablature it is suggested that stainless steel pins are drilled in and resin anchored with the holes plugged with a lime mortar and matching lime-based paint.



G02 – Fireplace

C18 fireplace to be retained and repaired.


Mantle is painted stonework.

There is outward movement by the pilasters from the joints with the entablature base at circled areas.

Fire brick linings to be replaced to match existing.

Brickwork to be cleaned and re-pointed with lime-based mortar and flush jointed.

Flue to be cleaned and lined, if it is to used as an open fire.

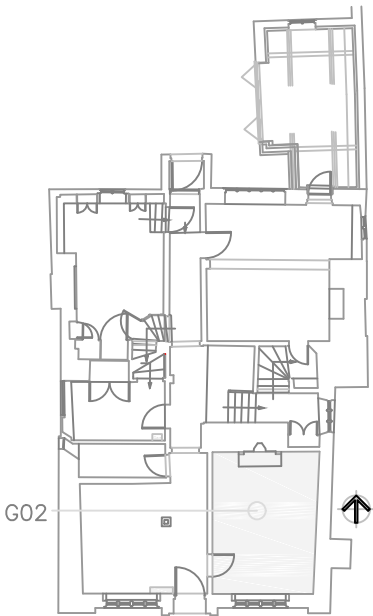

Ground floor plan NTS

Title : 17 Cathedral Close Salisbury SP1 2EB

Drawing : Detail Specifications for repair works to:

Mantle Surround - Room G02

Revisions : Rev Date

Scale : NTS

Drawn : CP

Date : December 2025

Drawing No.

1306.D.14