


Drawing from outside

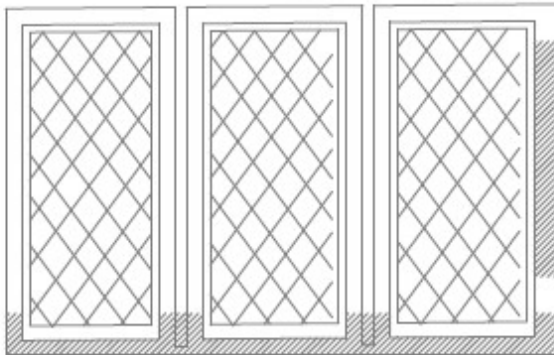

Description:

Stone mullioned window with hollow moulded chamfers.

Casements are fixed lights with lattice leaded glazing.

There is a steel security bar let in to the head and sill.

The sill on the outside is soft.



The side of the wall abutment is also soft with some wastage.

Plain wood, splayed lining boards.

Schedule of Works:

Remove the cement-based render to the sills.

Replace with sections of matching stone for areas where there is a large amount of wastage.


Use a lime-based plastic repair for smaller areas of soft stone.

On completion add 3 coats of lime shelter coat.

Fixed casements to have the putty and pointing checked and repaired or replaced where leakage occurring.



Photo of interior

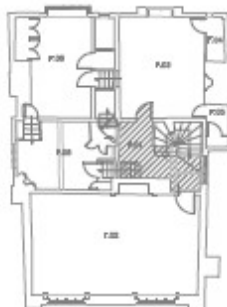

Detail Specifications for repair works to:
Window W.11/G.05

1306.D.43