

 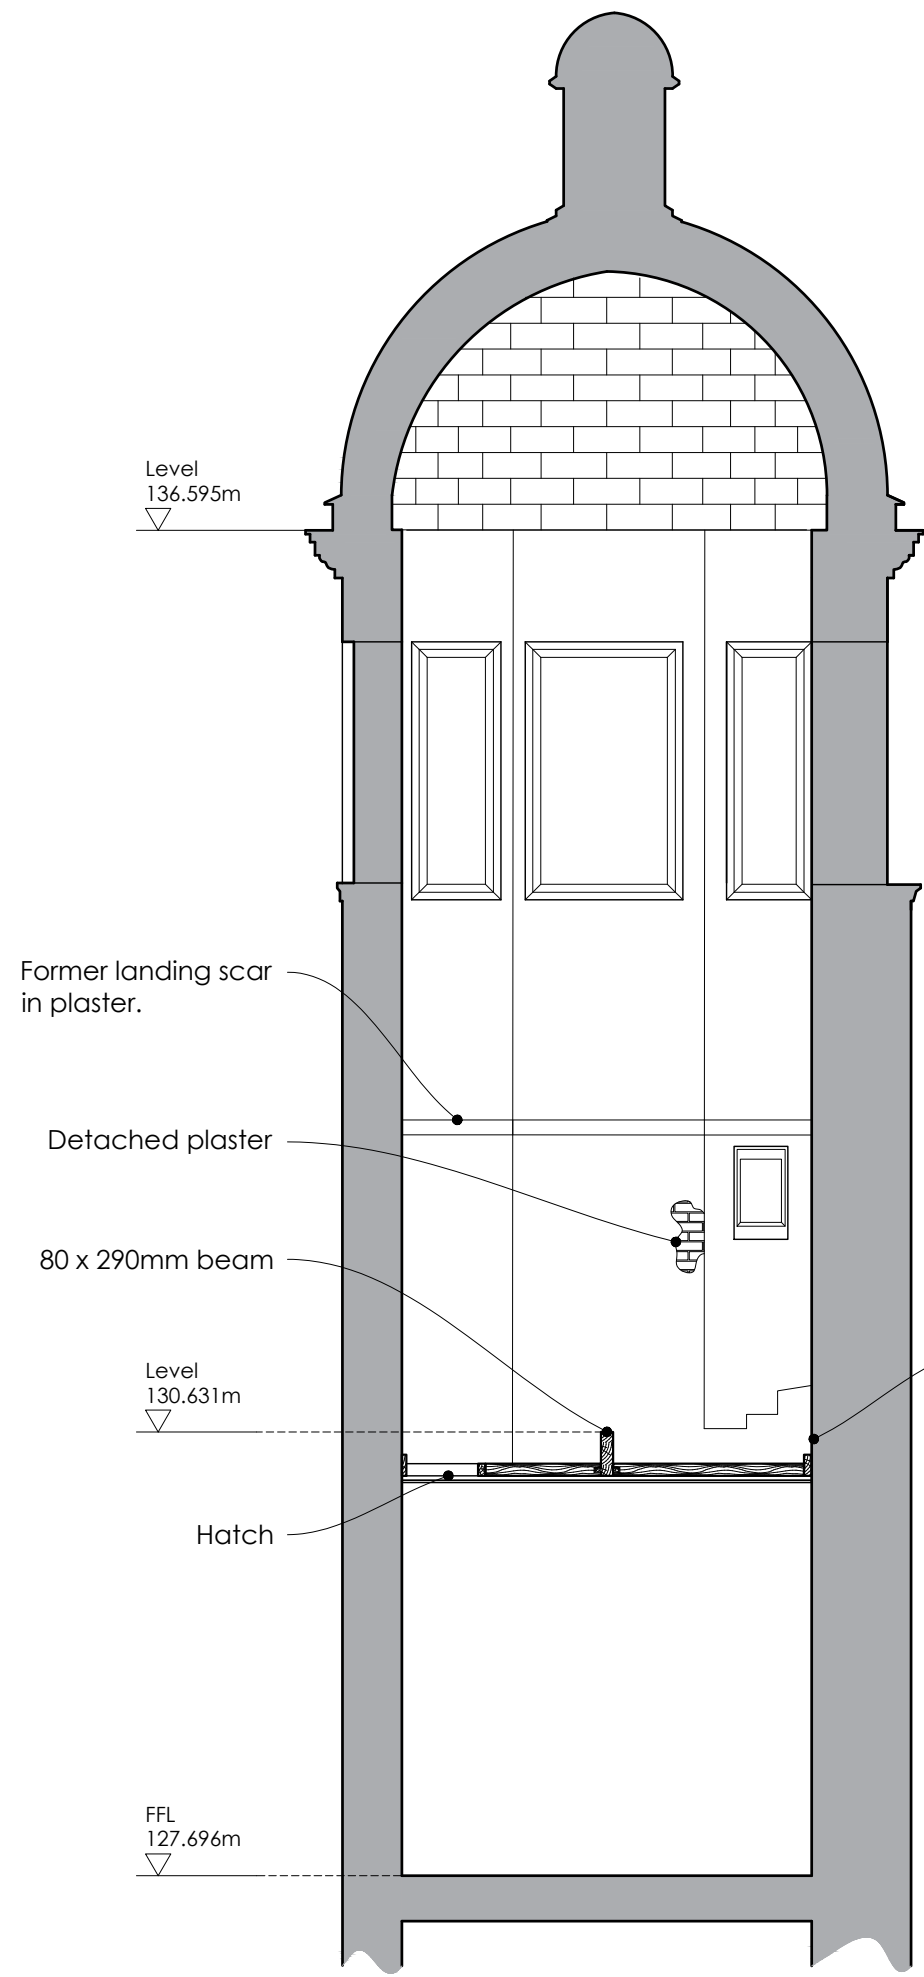


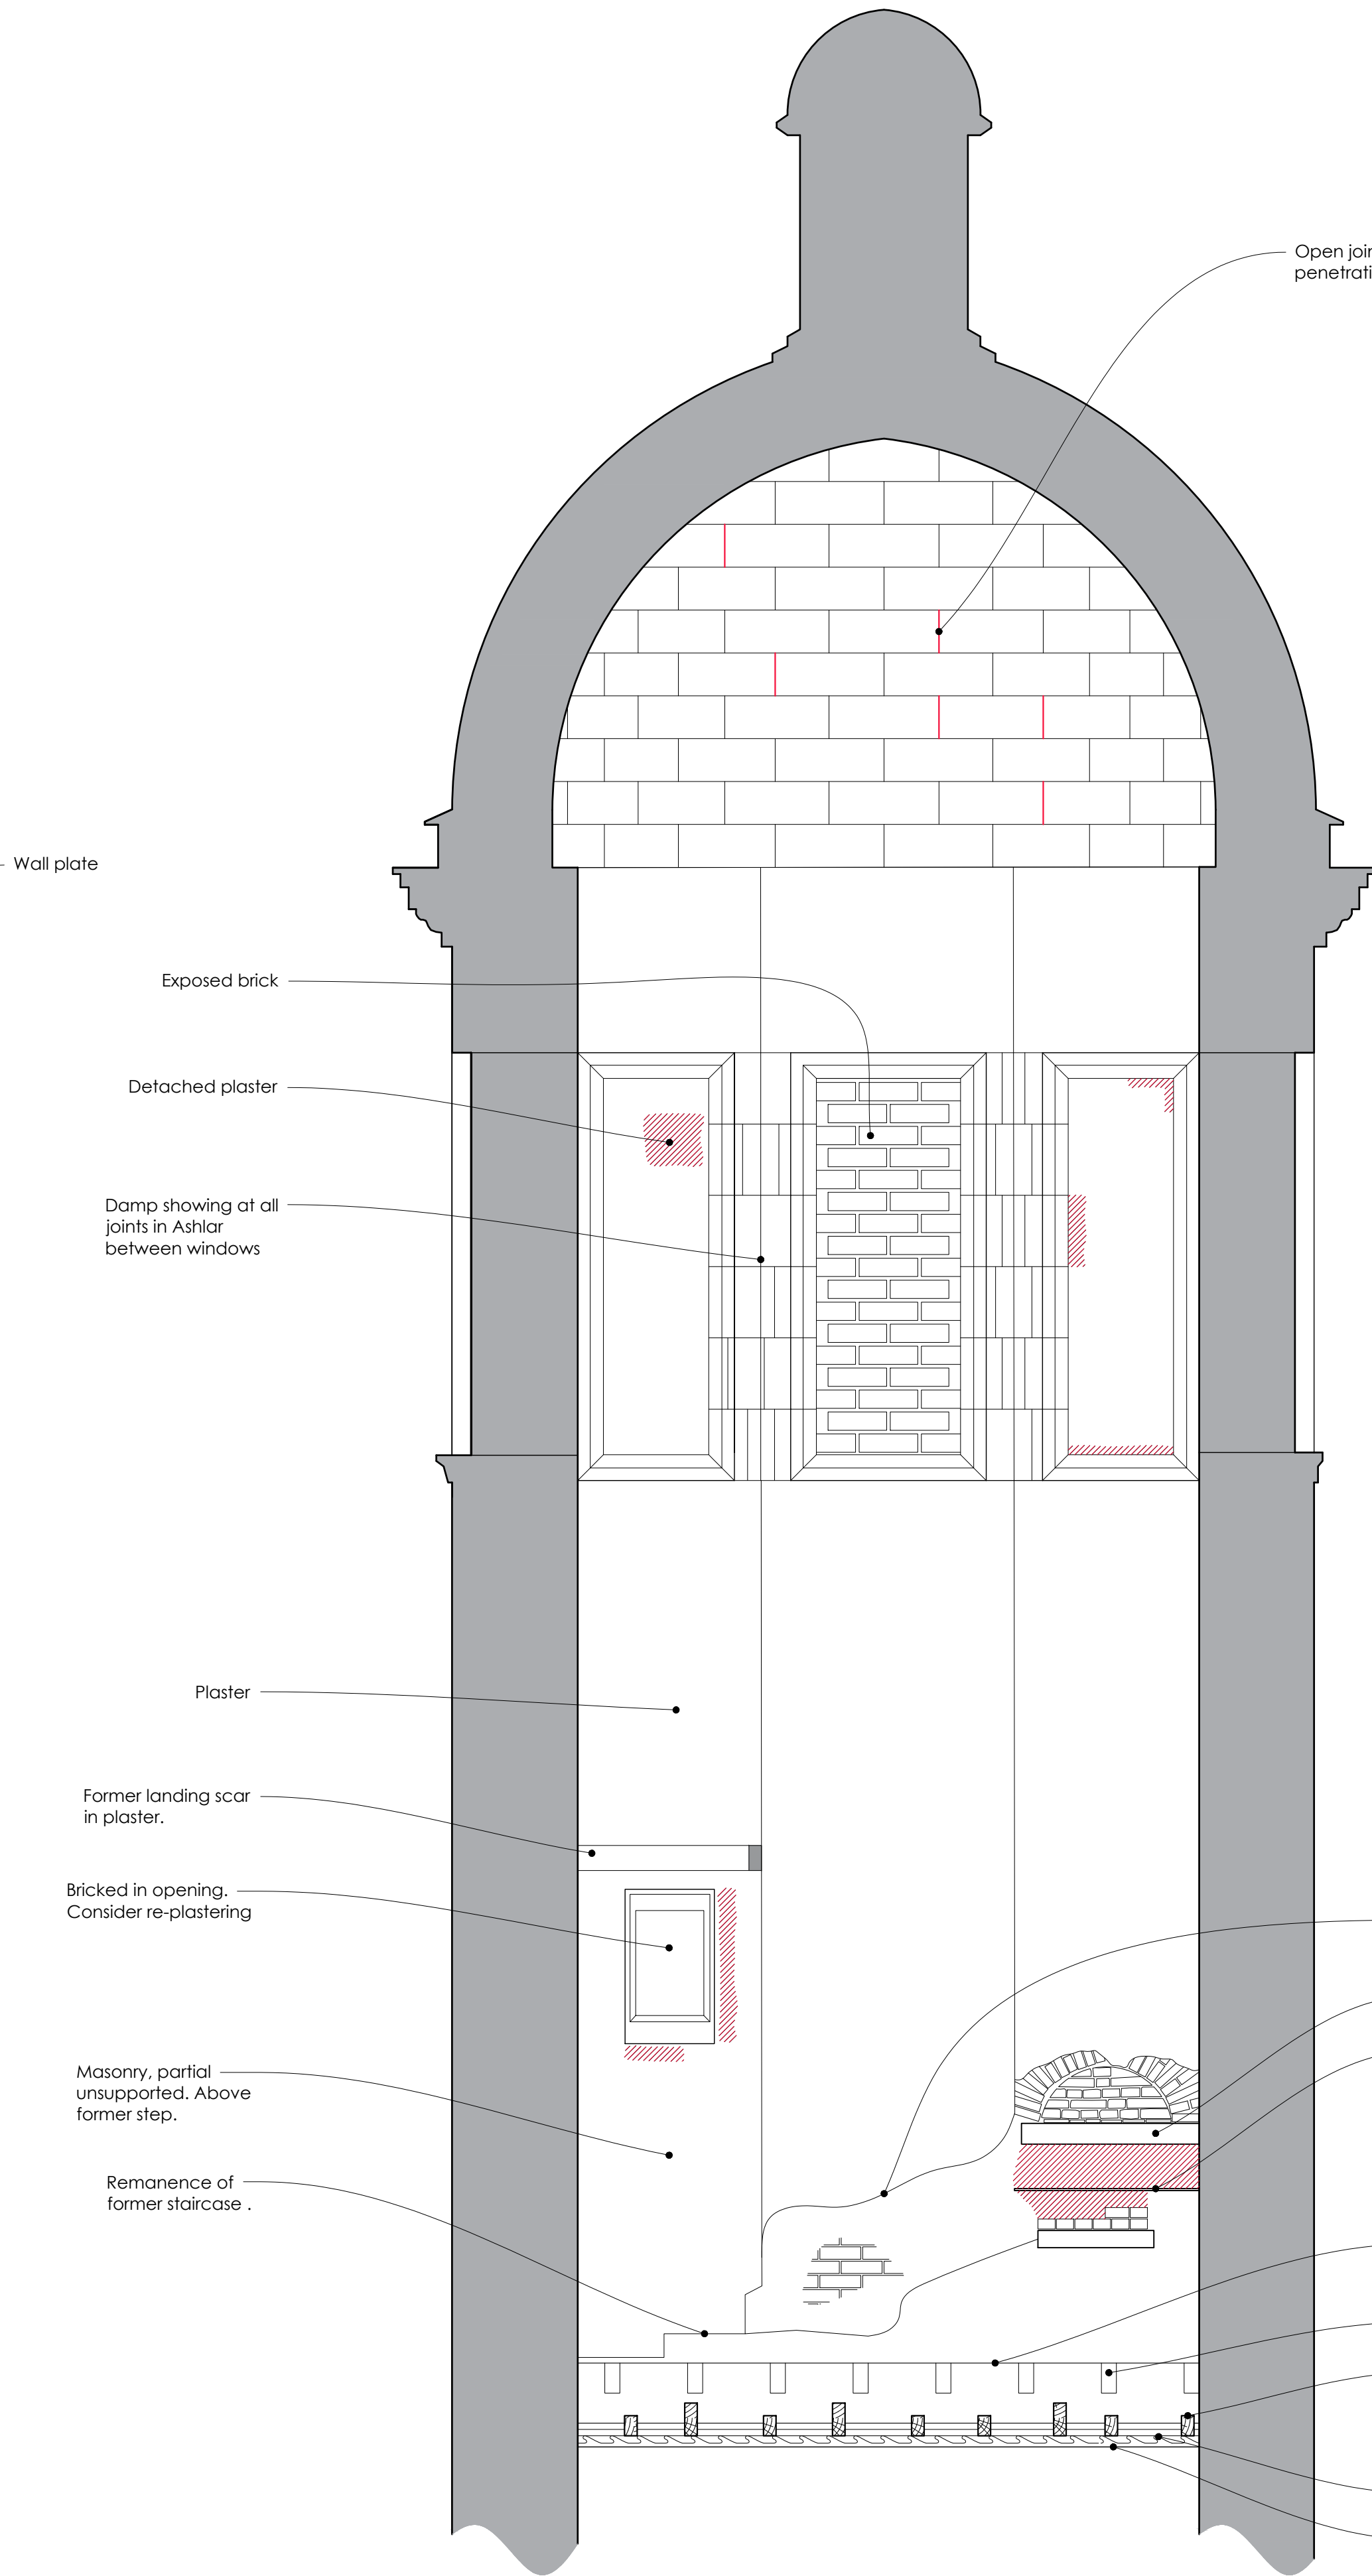

Section A
Scale 1:50



Section B
scale 1:20

Open joints in the roof structure allow water penetration into the roof slip.

Masonry decay to cornice on south elevation.

Render failure.

Stone erosion needing mortar repair.

Detached plaster

Timber lintel

Flat steel with unbonded masonry (brick above). Part rebuild required with improved support.


80 x 290mm beam

60 x 120mm pockets

25mm beam

Lath

Plaster line

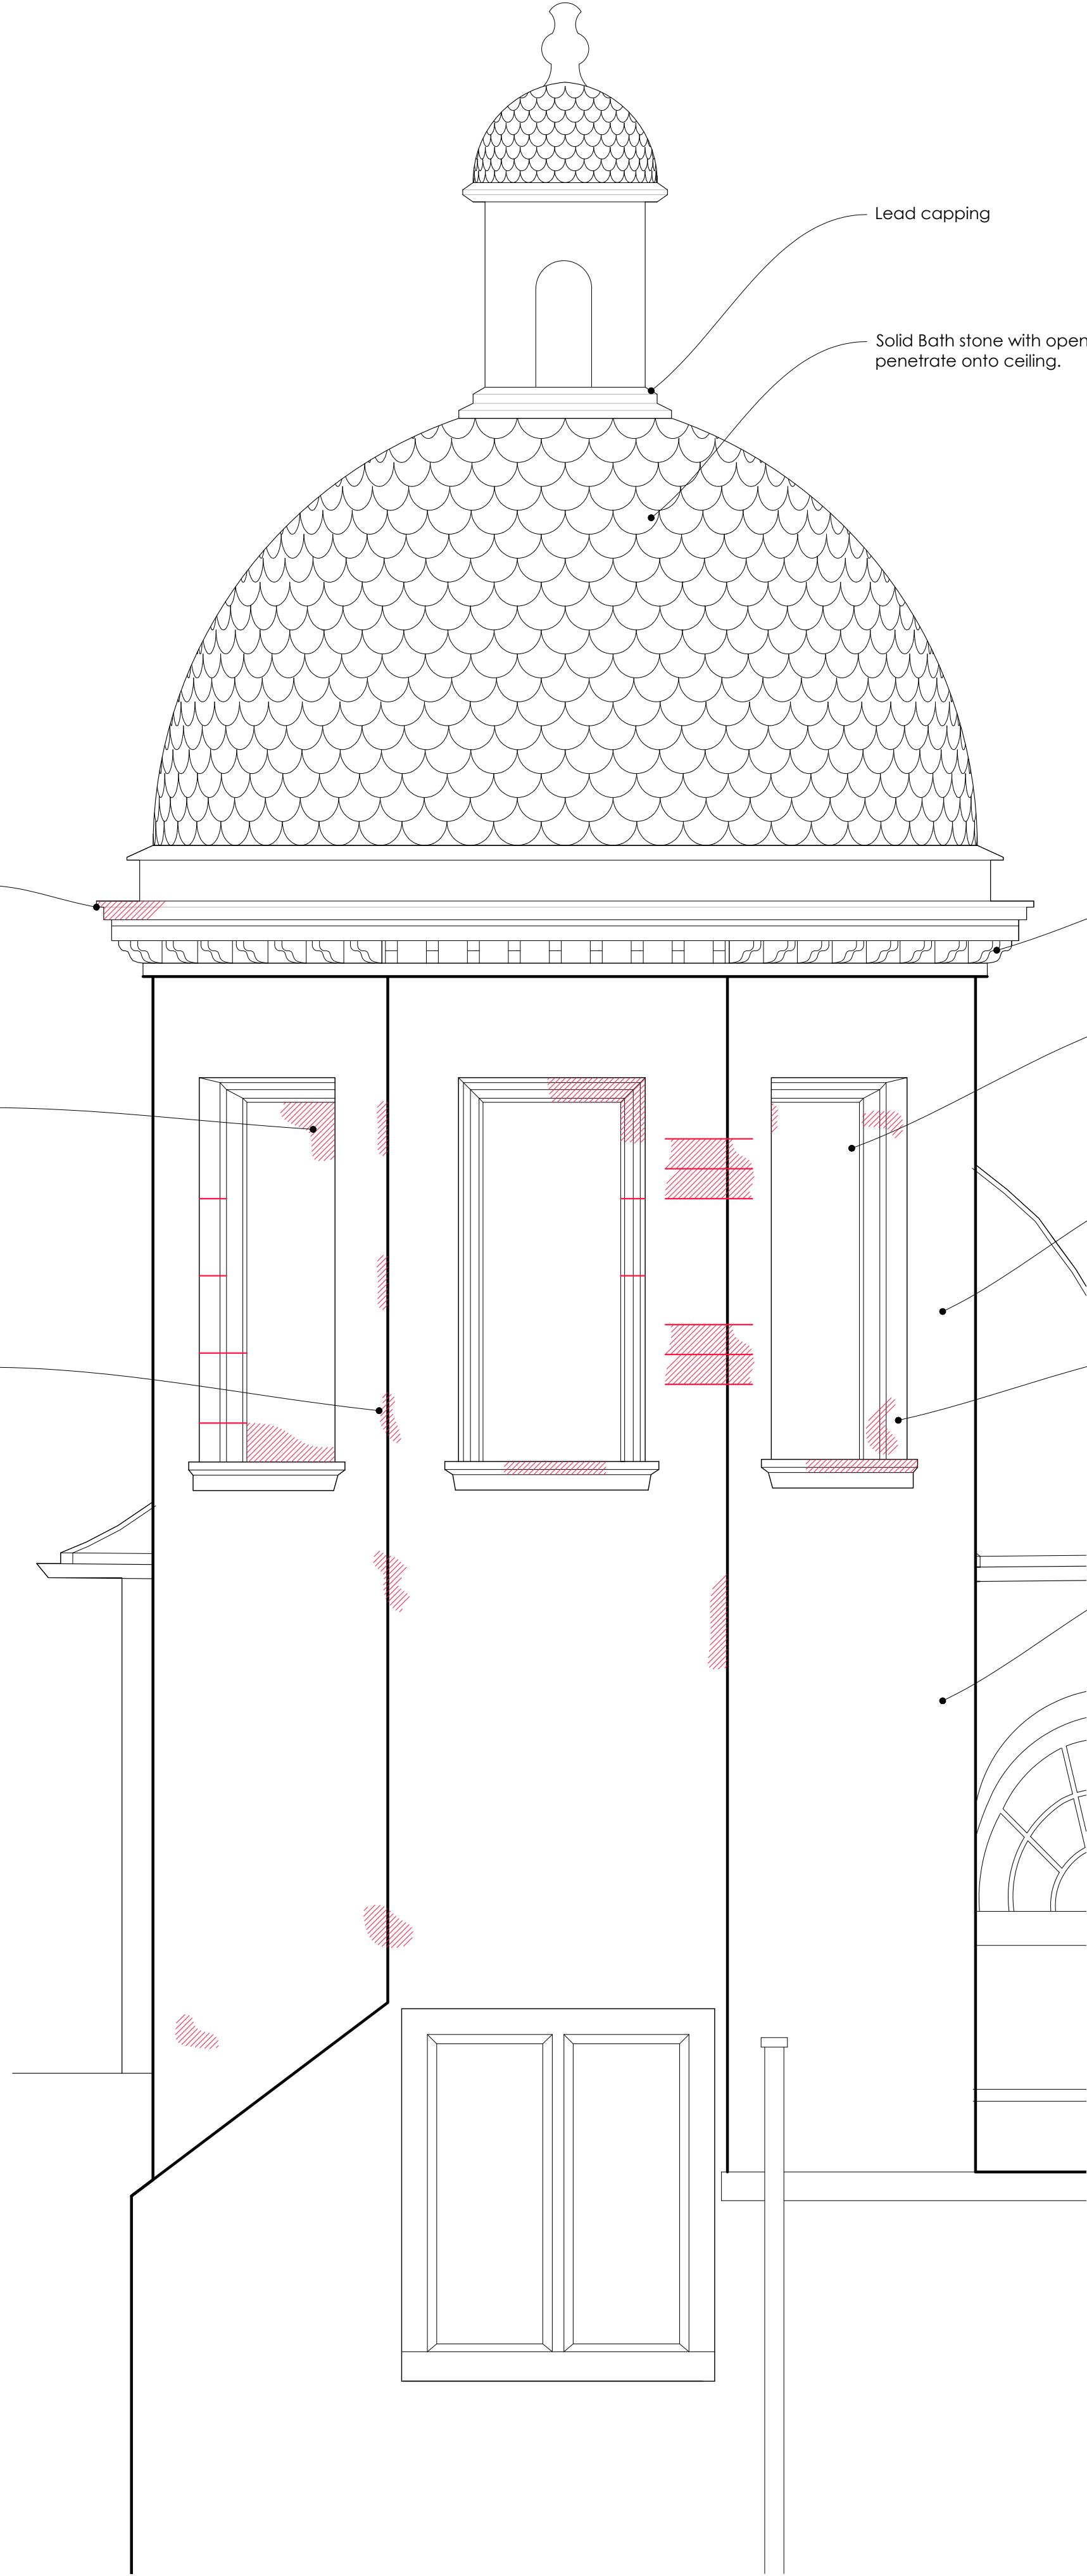

East Elevation
scale 1:20

Lead capping

Solid Bath stone with open joints between allowing water to penetrate onto ceiling.


Dentils require checking by rope access mason.

Rendered blind windows in fair to poor condition.

Bath stone Ashlar masonry.

Cill and jamb eroded requires mortar repairs .

Part render repairs with scribed Ashlar lines.

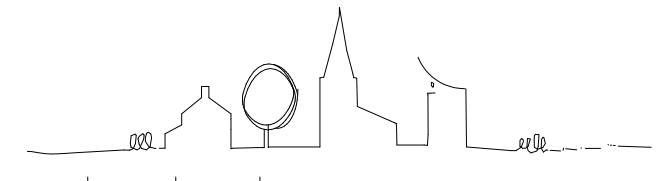

LONGLEAT
Longleat House

Title
Elevation Roof Slip D
Ceiling Condition Survey
Stage
Survey

benjamin + beauchamp
architecture design conservation
the borough studios, the borough,
wedmore, somerset BS28 4EB
T 01934 713313 F 01934 713314
Drawn By: JLB Date: 11.12.2025 Scale: 1:20 at A1
Drawing No: 0155.S.094
Studio: b2architects.com www.b2architects.com