


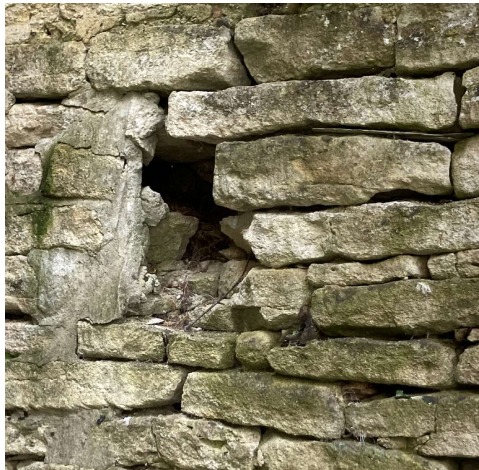

To the north elevation there are large holes where stones are missing or worn back. New replacement stones used for repairs to be reclaimed or locally quarried similar stone



The existing roll top ridge is heavily covered in moss and the tiles are loose with the mortar bedding missing or loose.
The existing roof is in poor condition with numerous slipped tiles especially to the north elevation, cracked and broken tiles are also evident across the roof across the roof slopes. There is also decay evident to some of the roof timbers although most look to be in adequate condition. These are to be inspected by a structural engineer

Existing timber to the verge of the ambulance station roof to be replaced.
Mortar fillet also to be replaced with a lime mortar fillet



Existing lead valleys to be removed, the timber lay boards inspected and replaced before new lead installed

