
Section through of wall extent for repair
scale 1:50

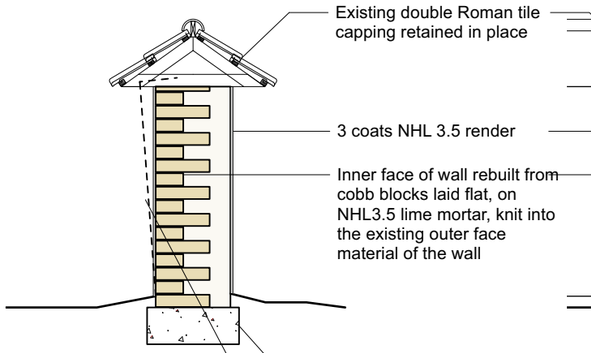

Existing double Roman tile capping retained in place


3 coats NHL 3.5 render

Inner face of wall rebuilt from cobb blocks laid flat, on NHL3.5 lime mortar, knit into the existing outer face material of the wall

New foundation cast to support wall extent where erosion is evident. Wall currently does not have a foundation.

Dotted line indicates existing garden side leaf leaning inboard and endangering collapse

West elevation of wall extent for repair
scale 1:50

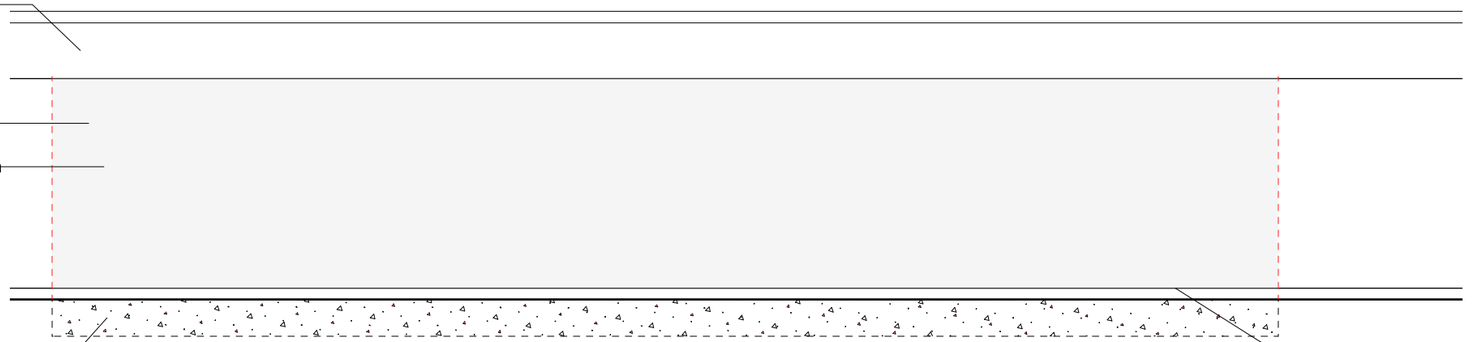





Photographs of wall extent for repair from garden side

Rosamund Leverett Architects Ltd.
19 Butt Street, Ludgershall, SP11 9QQ
Reg No. 11092843 in England & Wales
t: 07879007946 e: ros@leverettarchitects.co.uk

Project : Manor Farm
Netheravon
Wall repairs

Sheet Title : Wall Elevations - Extg & Proposed

Scale : 1:50 @ A3

Date : Jan 2024

Drawing : 2317/01_003

Rev : -