

Repairs:

Masonry

- M1

Make good hole around old beam/joist opening
- M2

Infill masonry to depth of wall
- M3

Replace timber bearers in brick wall with masonry
- M4

Replace timber bearers in masonry wall with brick
- M5

Reform brick wall and opening
- M6

Rebuild masonry wall
- M9

New limecrete floor
- M10

Lift and relay stone flags
- M14

Masonry arch to be rebuilt traditionally

Plaster

- P1

New plaster boxing to replicate historic casing
- P2

Remove plaster, carry out deep re-pointing of masonry below 50mm deep

Carpentry

- C1

Replace timber plate

Structural

- S1

Replace timber lintel - see Structural Engineers' details
- S2

Allow for horizontal ties to masonry

Joinery

- J2

Picture rail reinstated


Generally

- M2

Infill masonry to depth of wall
- M6

Rebuild masonry wall
- P2

Remove plaster, carry out deep re-pointing of masonry below 50mm deep

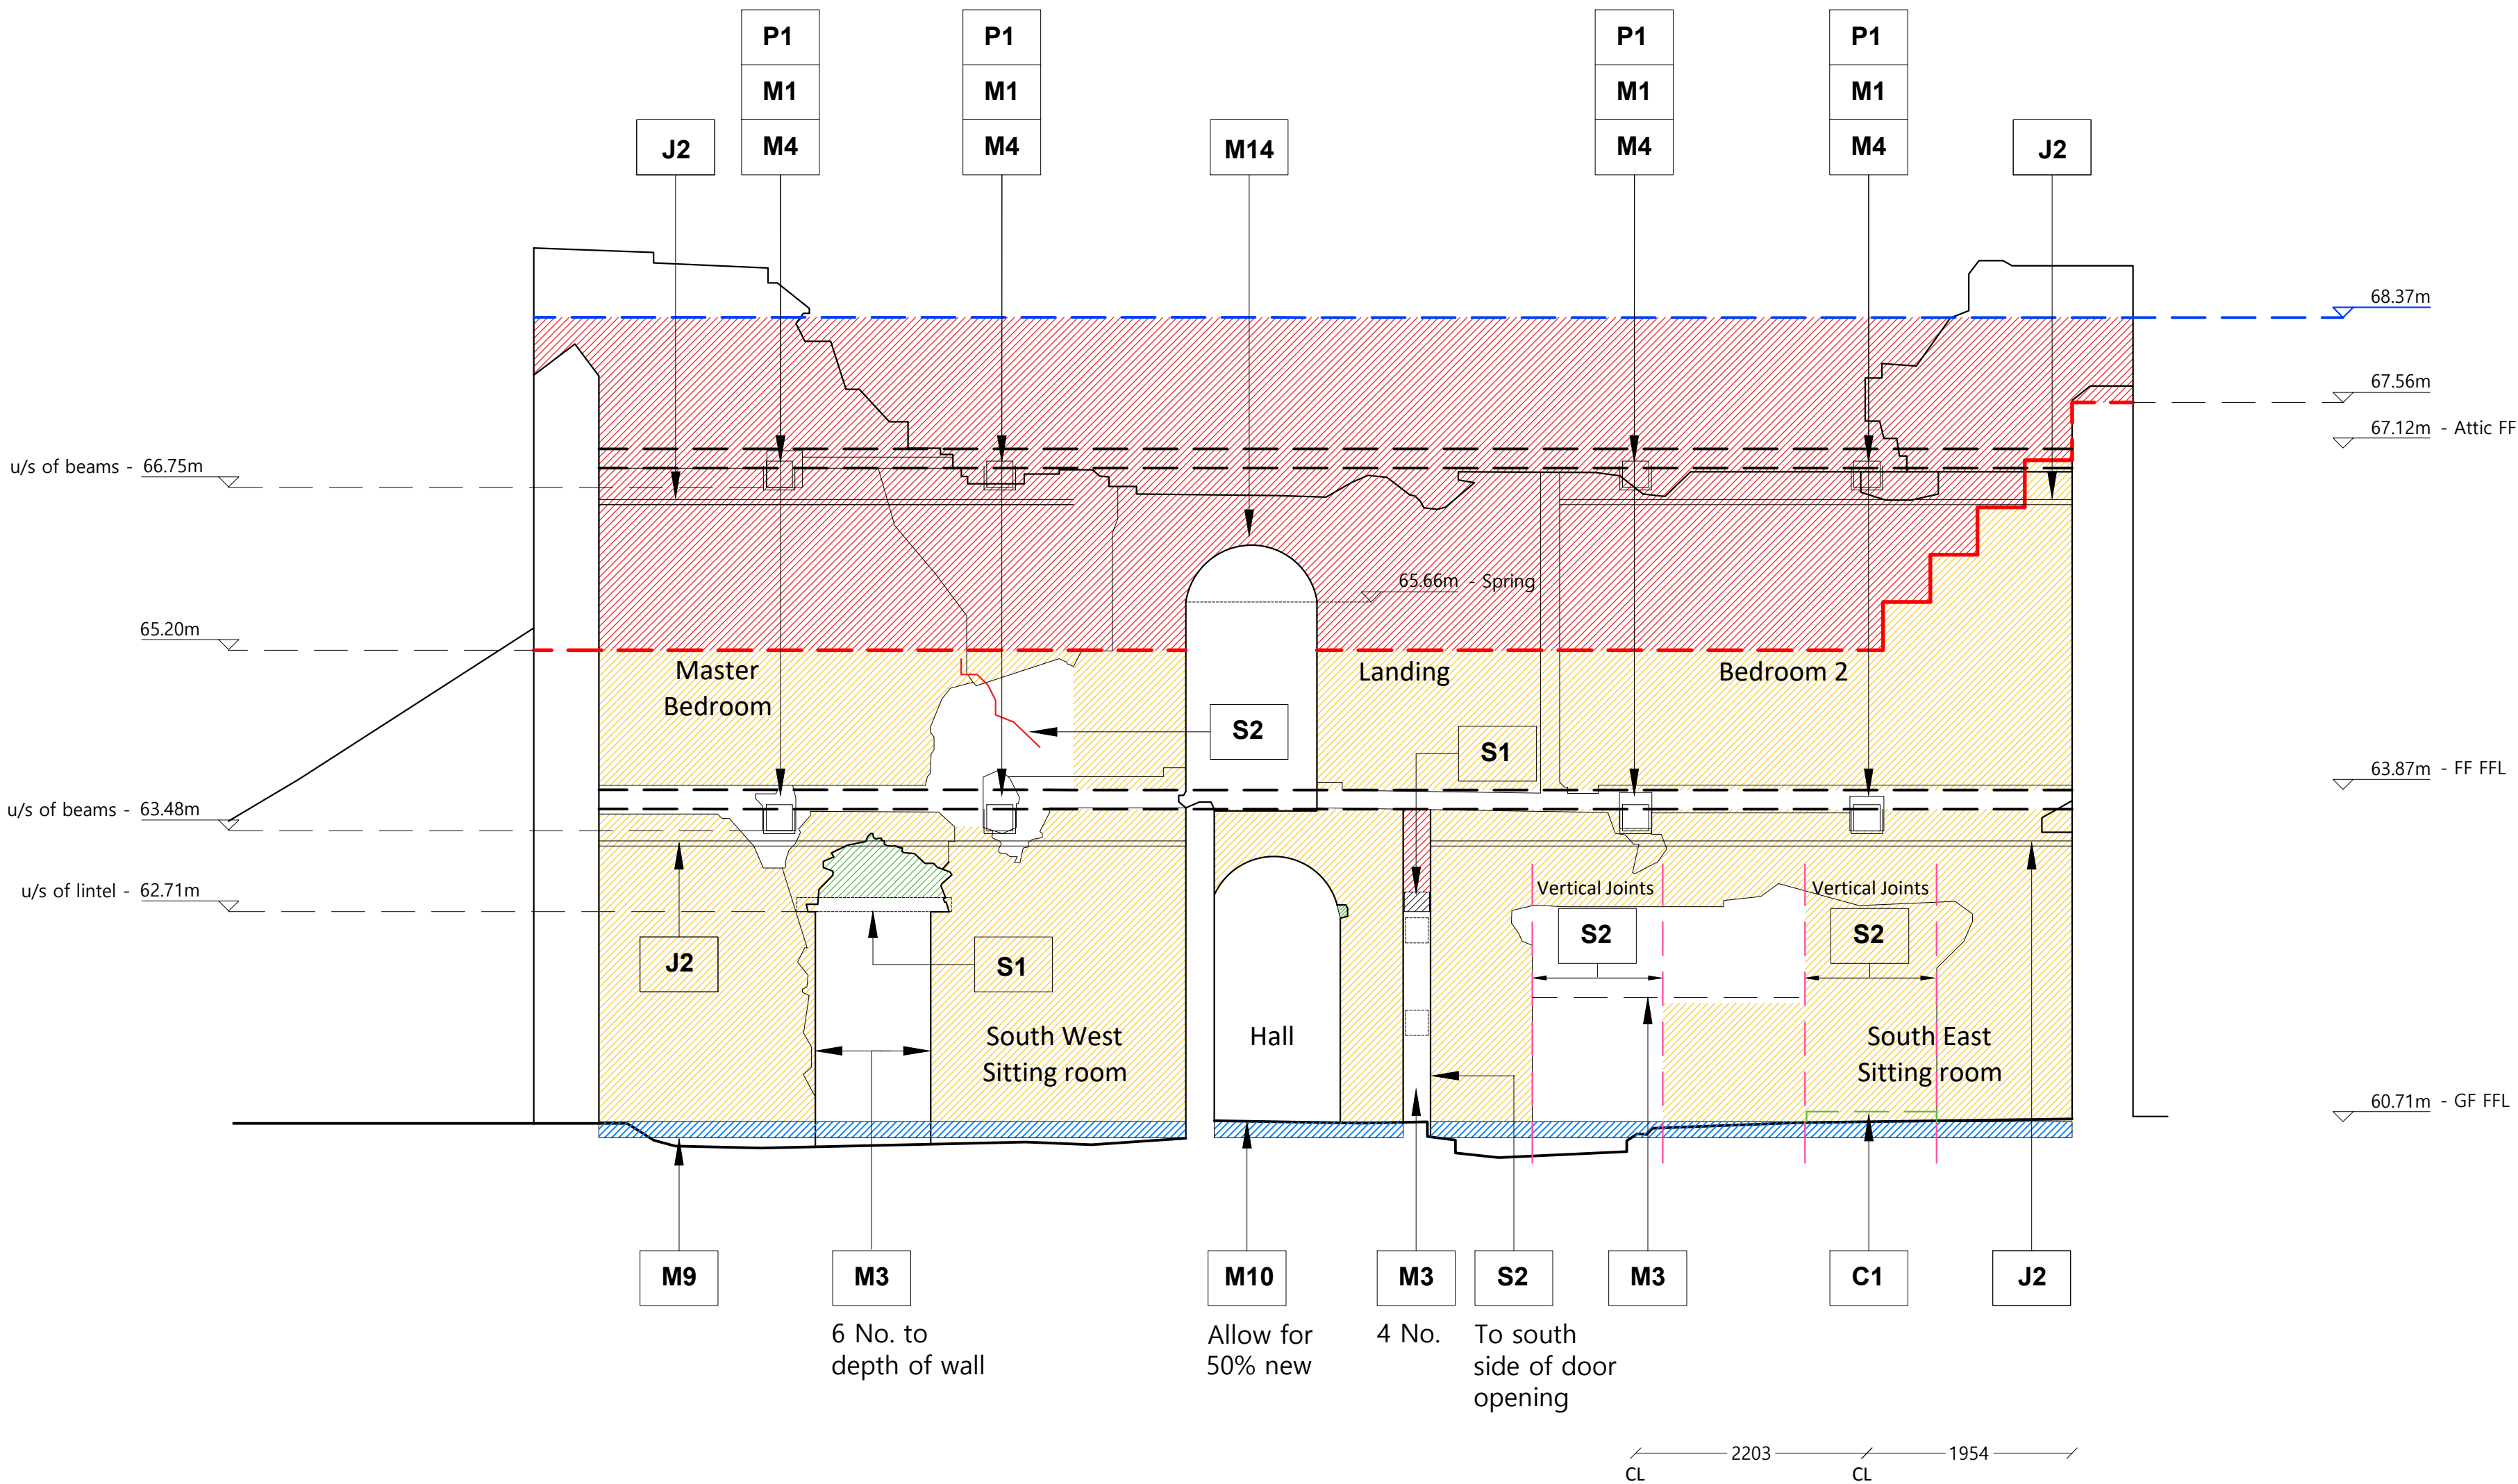

1.0 IE9 - Spine wall - South facing Elevation

Key

- Line of Rebuild


Underside of wall plate level

NOTES

Drawings are based on survey data and may not accurately represent what is physically present. Scale for planning purposes only. All dimensions are to be verified on site before proceeding with the work.

All dimensions are in millimeters unless noted otherwise.

James Mackintosh Architects shall be notified in writing of any discrepancies.

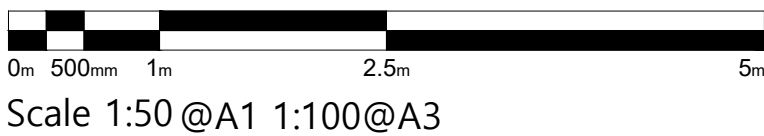

- Nov25 AS JPM First issue

ISSUE DATE DRAWN CHECKEDDESCRIPTION

JAMES
MACKINTOSH
ARCHITECTS

DESIGN / CONSERVATION / HISTORIC INTERIORS

E. studio@jmacintosh.com
T. 01608 692310 W. www.jamesmackintosharchitects.com

PROJECT Idover Demesne Farm

CLIENT Vaughan Consultancy

DRAWING STATUS Planning/LBC

DRG TITLE IE9 Spine Wall
South Facing Elevation - Repairs

JOB/DRG No. 381 / 319

SCALE 1:50@A1 1:100@A3 REVISION 0