


Room 17 18 Data Sheet


Scale: 1:25

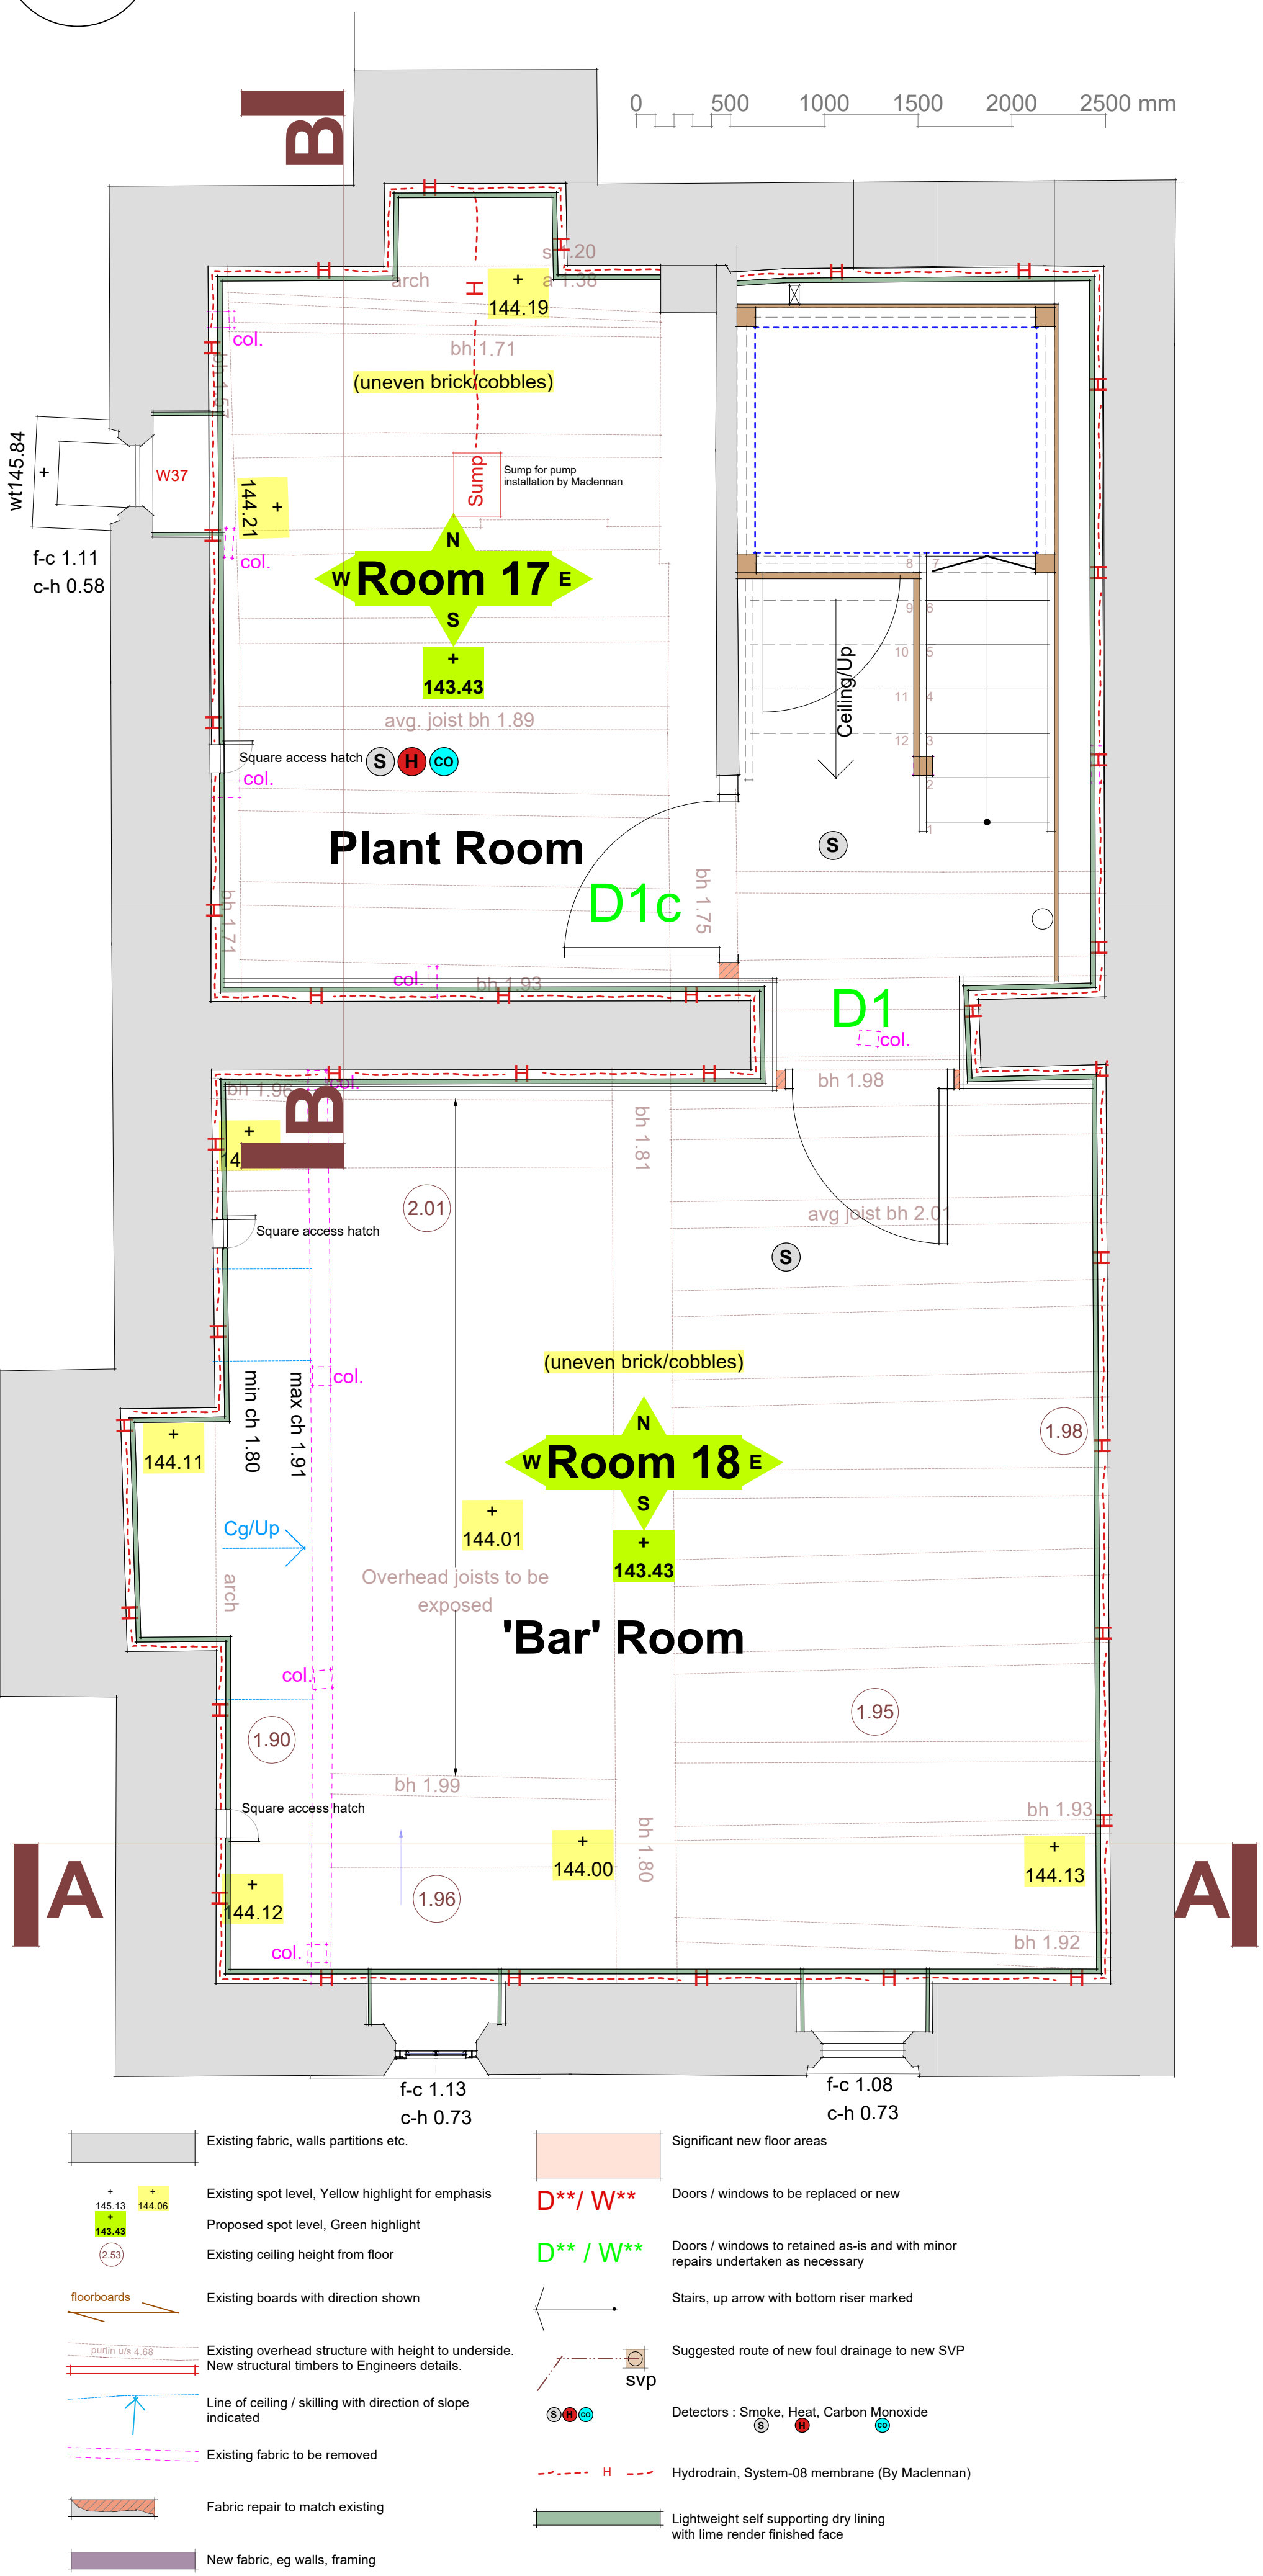

Photograph in-situ room 18

Red line indicates top of dry lining wall: typically, 3 courses below timber lintels

Photograph in-situ room 17

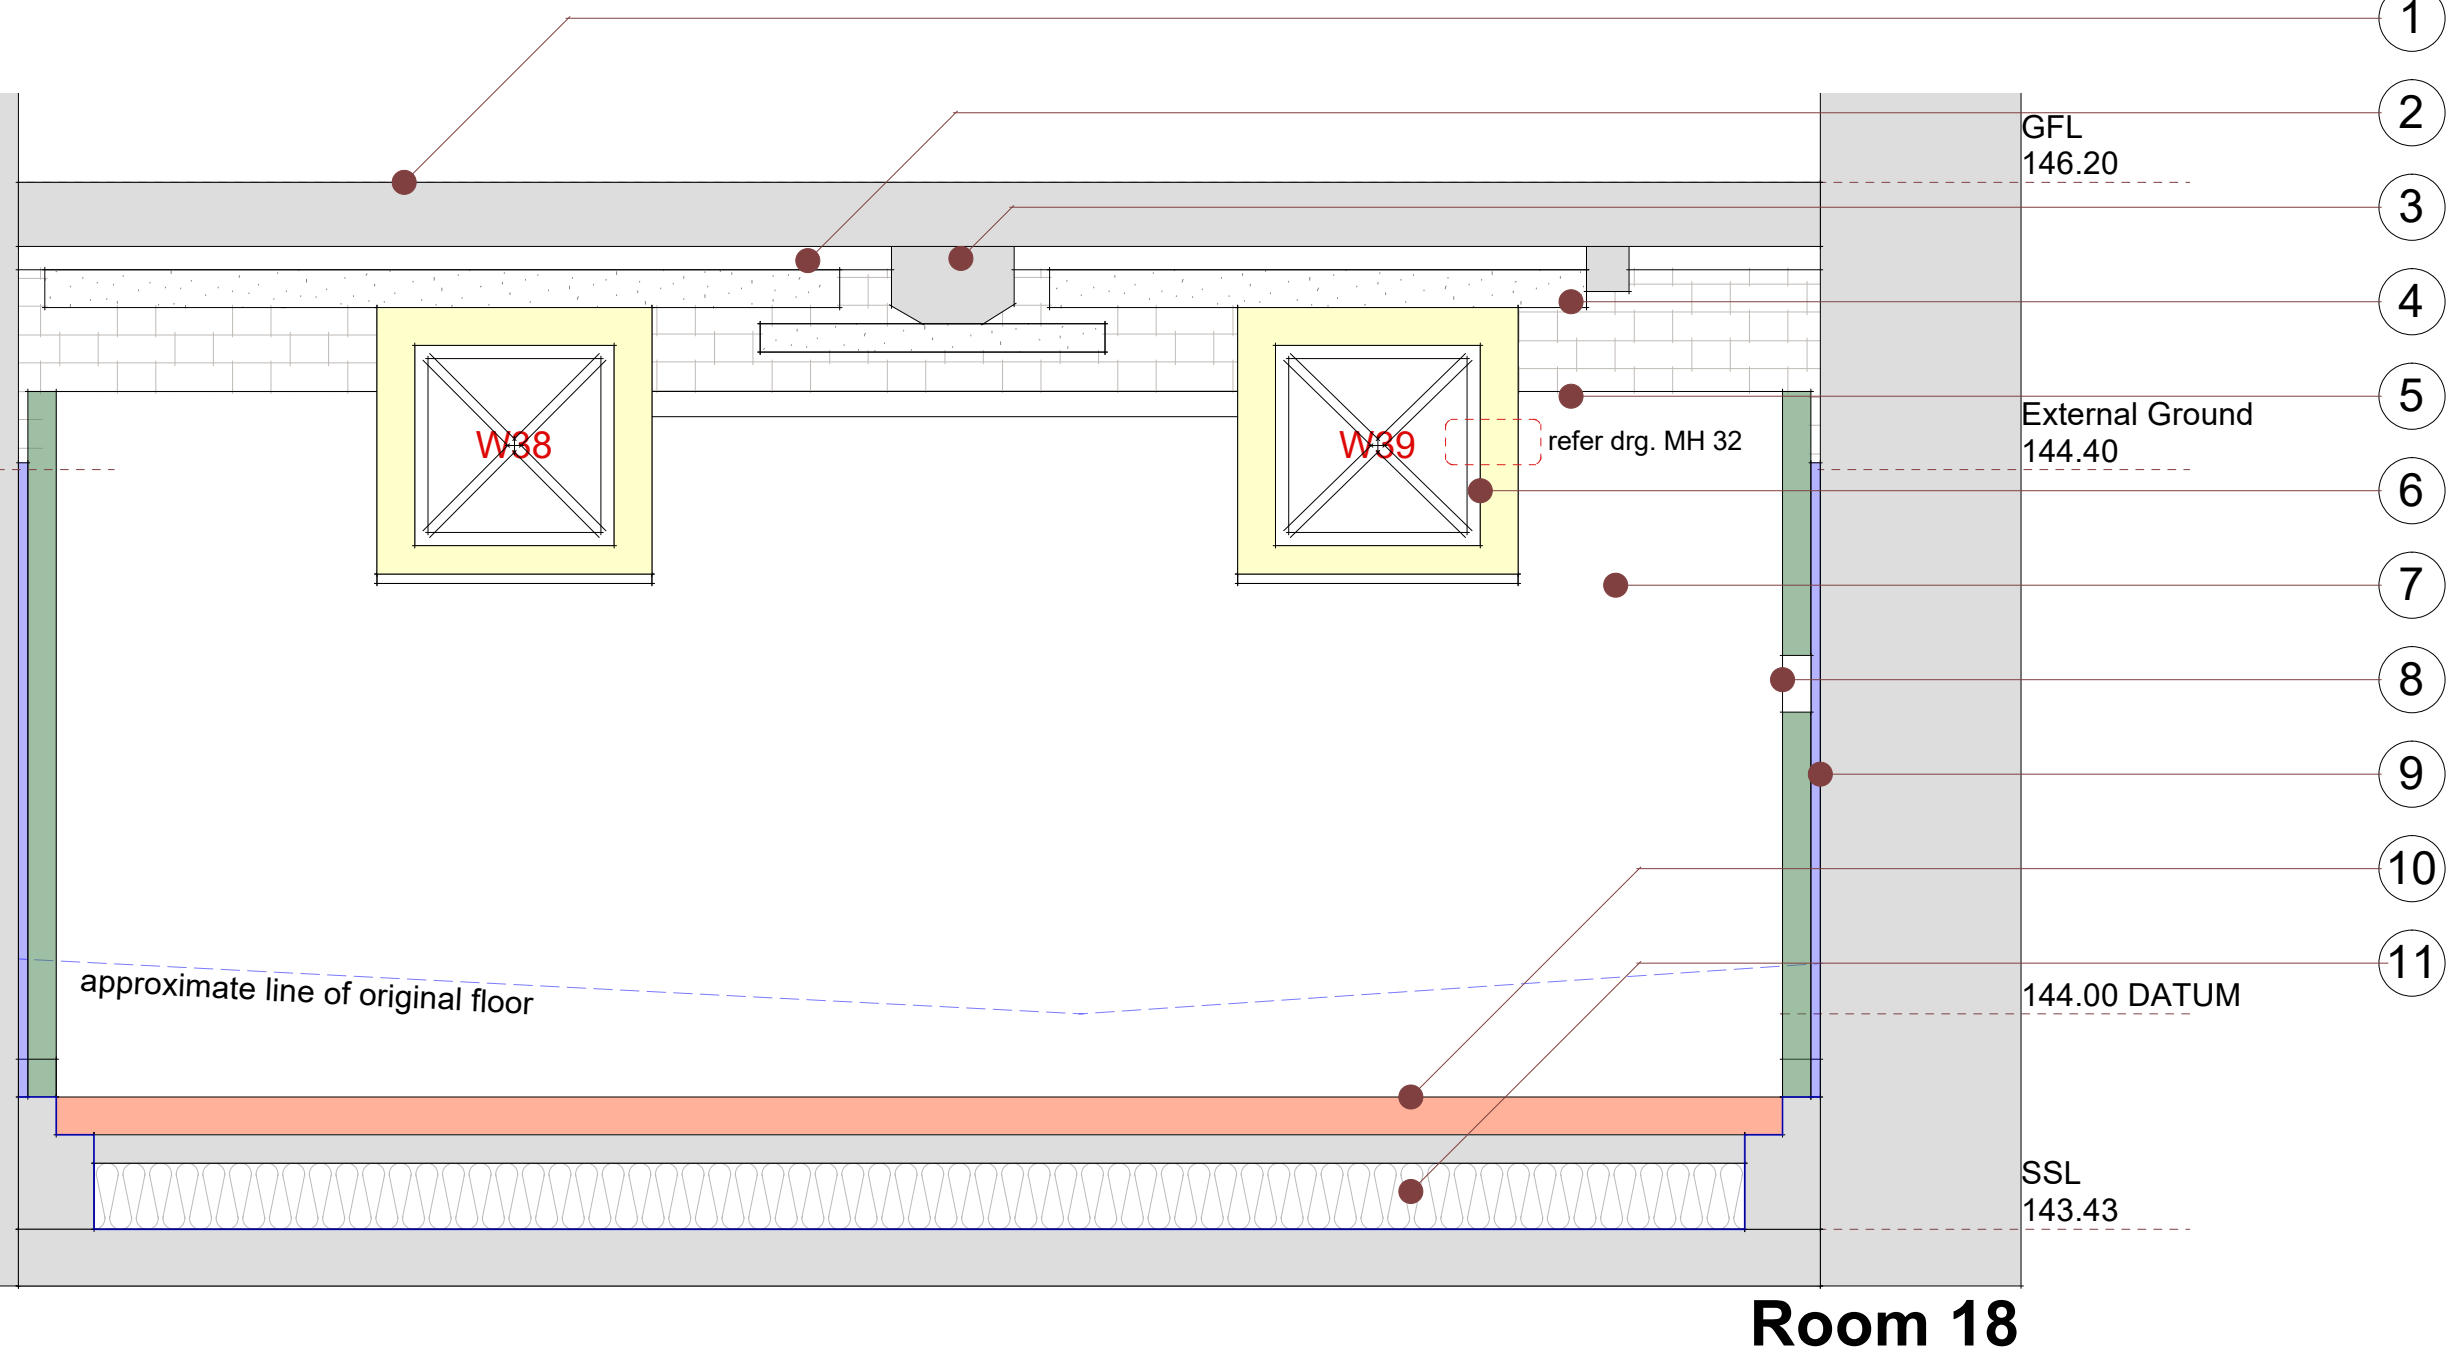

Section on AA

- Ground floor above , FFL indicated.
- Floor joists, new ceilings infilled between.
- Floor cross beams, downstand shown.
- Timber plates, existing, embedded in brickwork over windows.
- Facing brickwork existing, repointed and on clear view above new independent dry lining.
- Window, with existing stone surround indicated. Metal framed single casement opening light. Refer Drg. MH 32
- Self supporting dry lining. Lime render finish on suitable substrate, wall stops 100mm over height of tanking membrane.
- ditto, in section. Square plate inspection access hatch indicated, 150mm opening
- Tanking membrane, details and fixings by specialist . System -08 by MacLennan
- Replaced brick and cobble floor using retained materials. Level to be confirmed.
- New sub wall/floor foundation and slab to engineer's detail, incorporating insulation and screed to support existing relaid bricks.



Section on BB