



© This Drawing is the copyright of benjamin + beauchamp architects ltd.
All dimensions to be checked on site by contractor and not scaled from this drawing. Scaling for planning purposes only.
benjamin + beauchamp architects ltd accept no liability for any expense, loss or damage of whatsoever nature and however arising, from any variation made to this drawing; or in the execution of the work to which it relates, which has not been referred to them and their approval obtained.
p:\longleat - longleat house - 0155\drawings, photos & graphics\b2 drawings\drawing board\0155.s.093 roof slip d ceiling condition survey.dwg

Key Plan

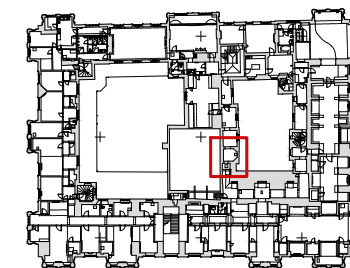


Key

- A** Detached not supporting very soft lots of decay
- B** Wall plate end thinned down 10mm width
- C** Bearing at wall plate gone. 50 - 75% gone
- D** Bearing at wall plate gone. 50 - 75% deterioration
- E** Surface soft but intact
- F** Deteriorated centrally 50 - 75% integrity
- G** No bearing at beam 50% integrity
- H** No bearing at beam 50% integrity
-  Water damage from roof. Stained plaster with some detachment.

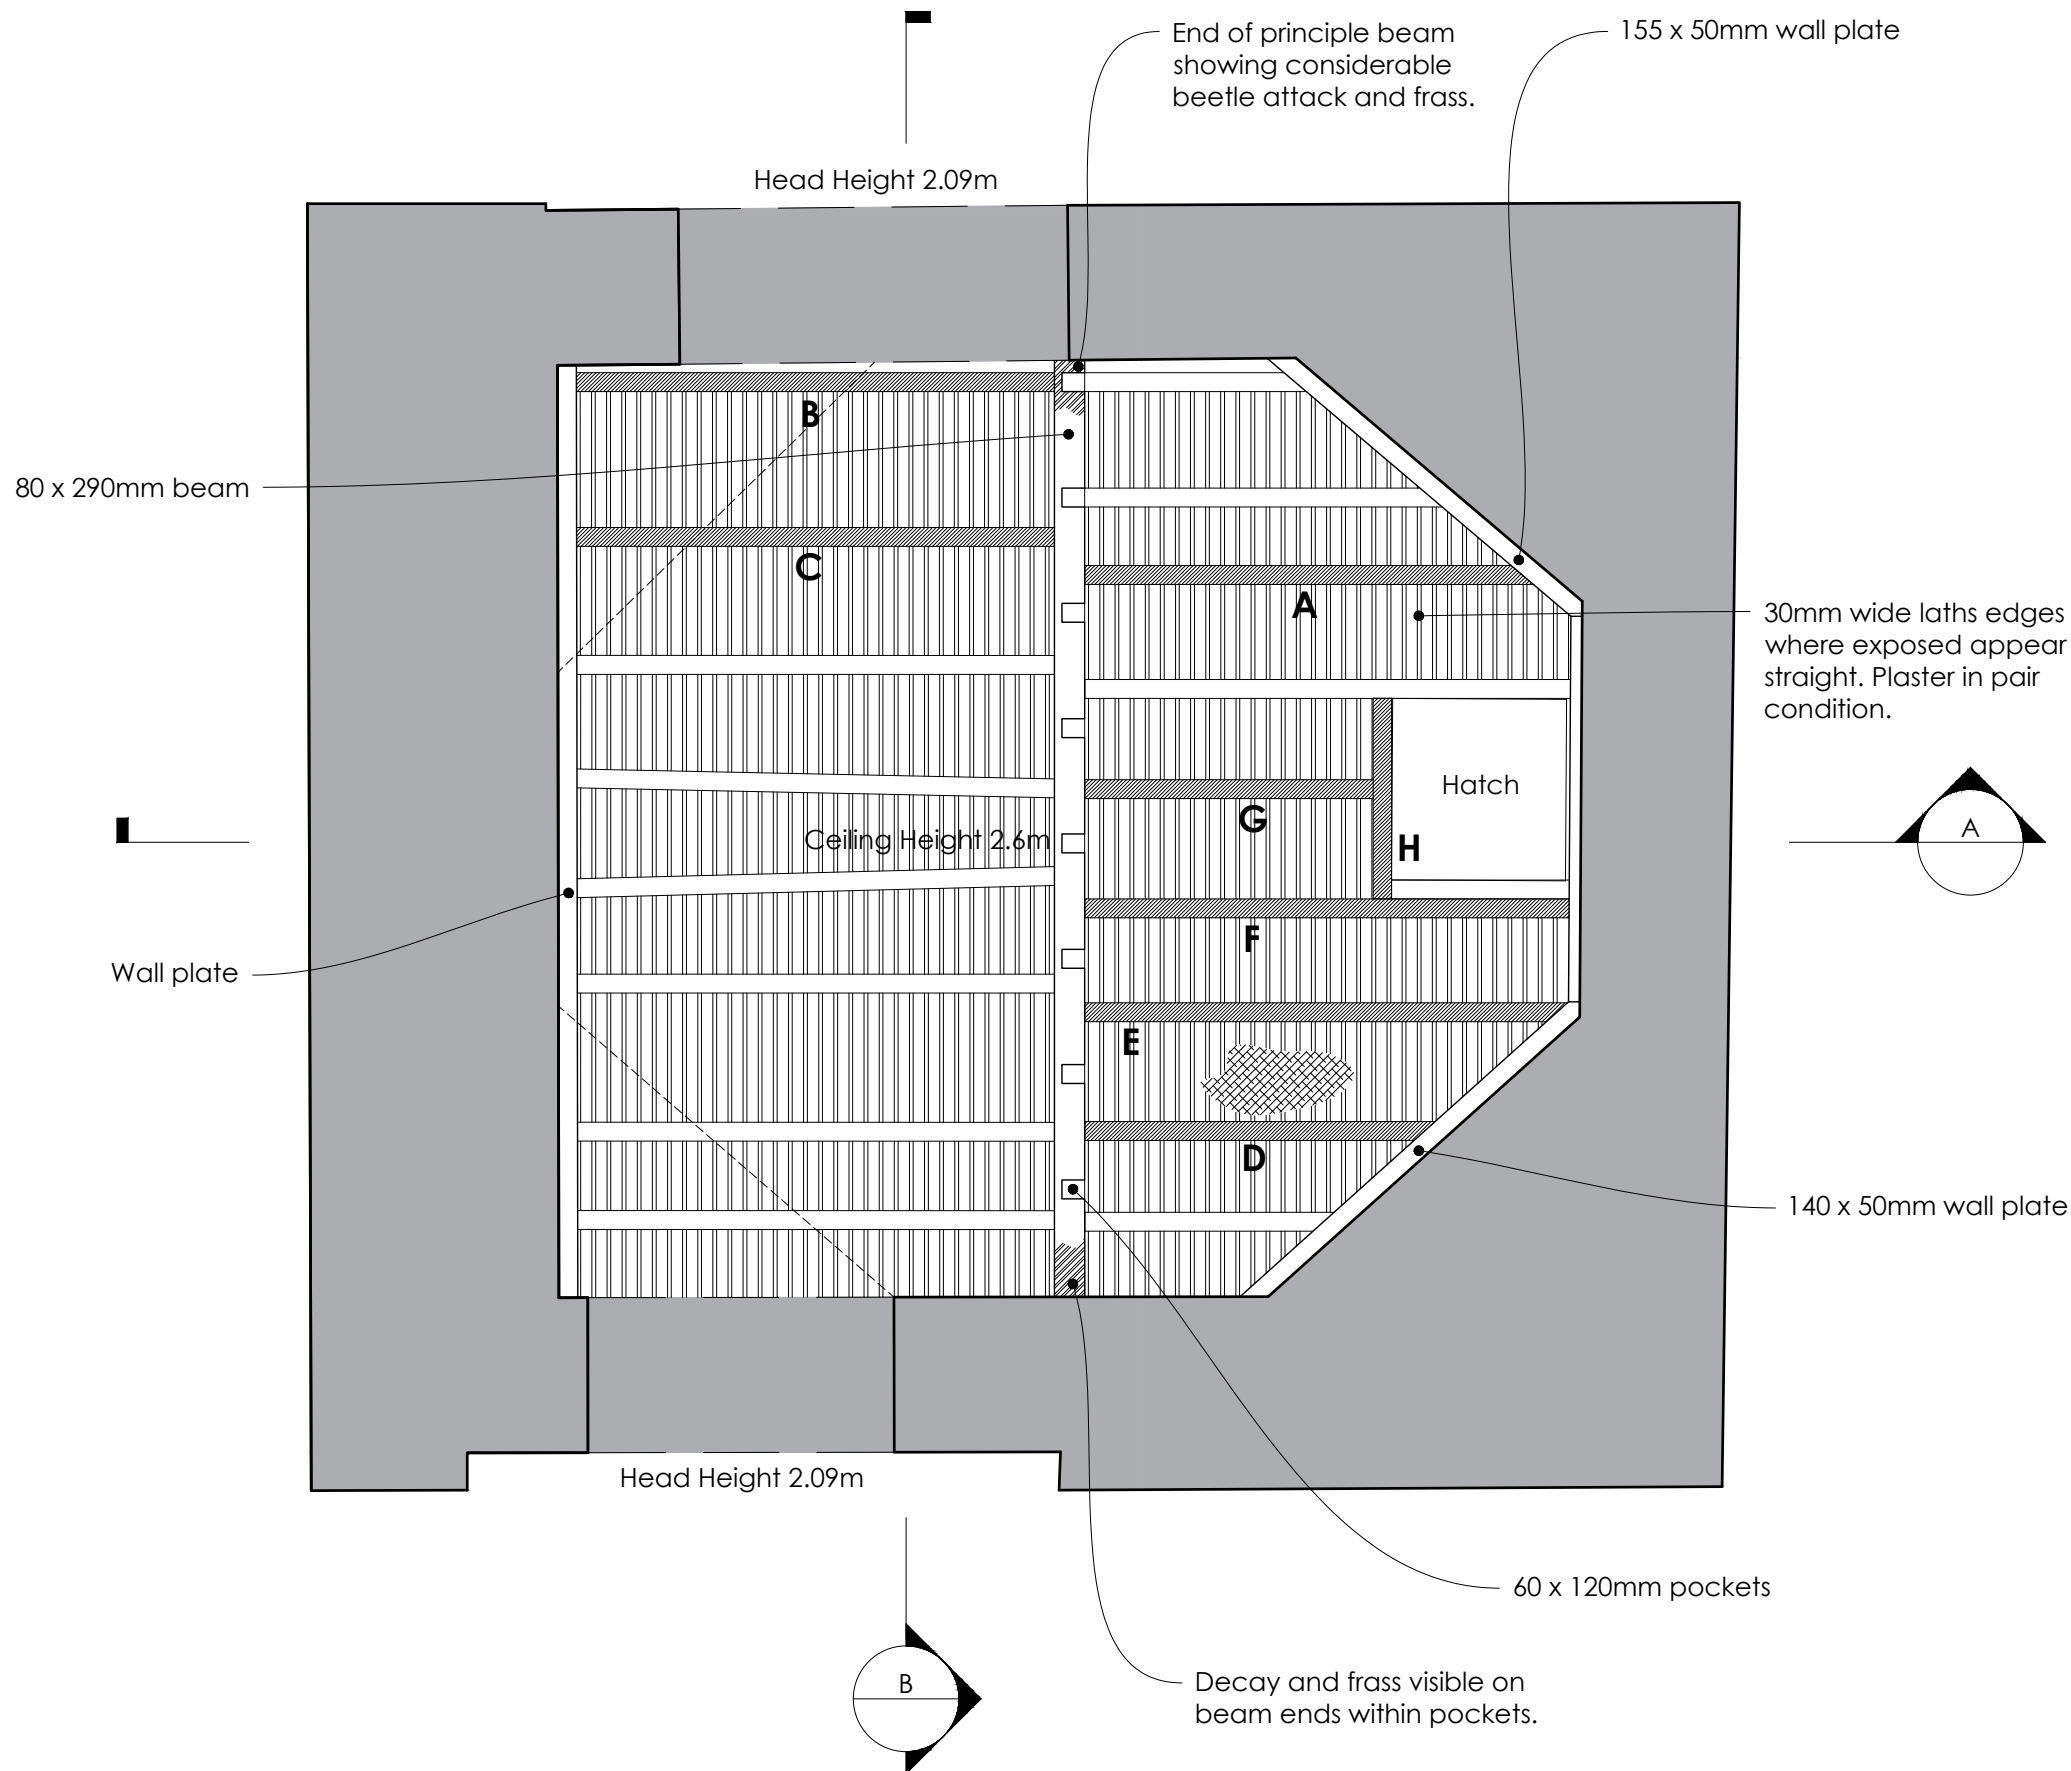

Ceiling Layout Plan

1:20
metres

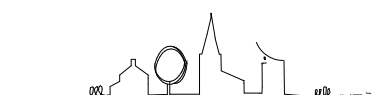

Revision Project Date Initials Notes

LONGLEAT
Longleat House

Title

Roof Slip D Ceiling
Condition Survey

Stage

Survey

b² benjamin + beauchamp
architecture design conservation
the borough studios, the borough,
wedmore, somerset BS28 4EB
T 01934 713313 F 01934 713314

Drawn By Date Scale
JLB 15.12.2025 1:20 at A3

Drawing No. 0155S.093 -