



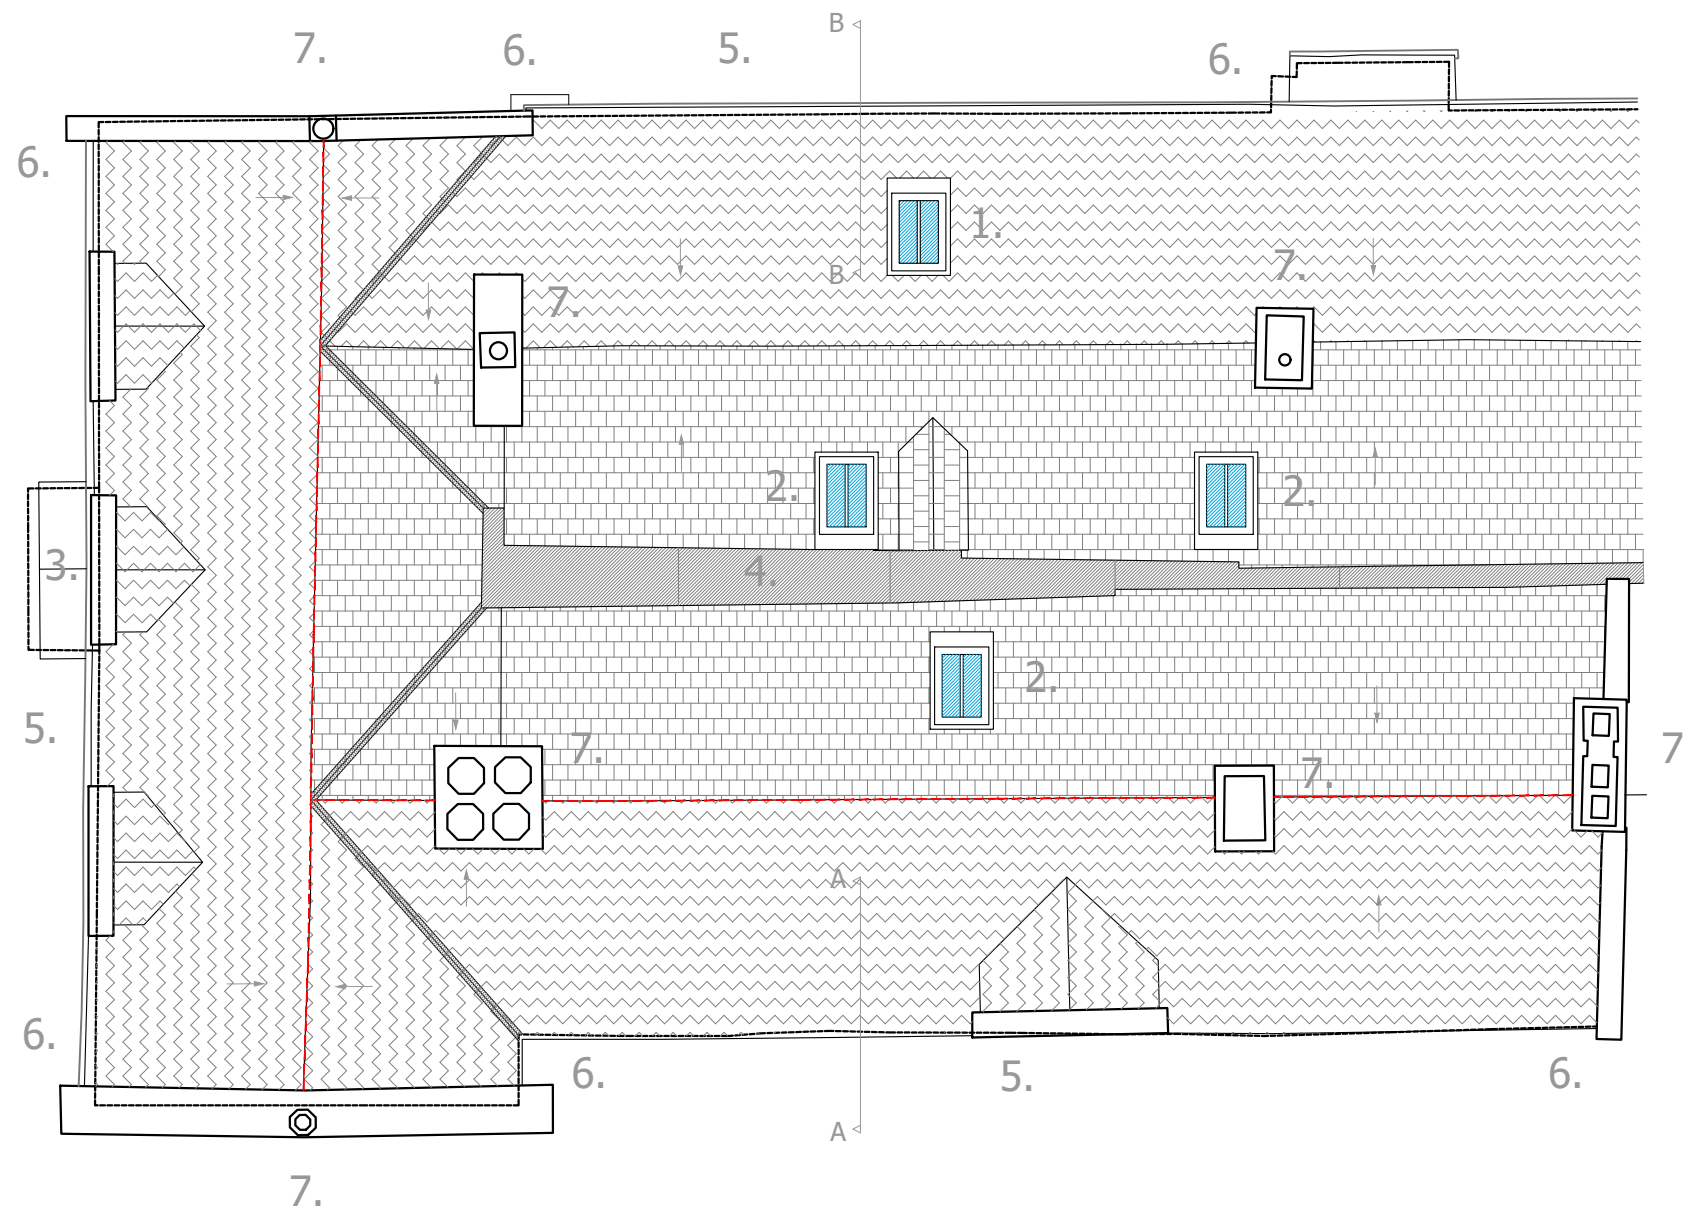


NOTES:

- Existing roof light replaced with new Conservation Rooflight from the Rooflight Company. Clear viewable width of 517mmx828mm (to be confirmed).
- Existing GRP roof lights replaced with new Conservation Rooflights from the Rooflight Company. Clear viewable width of 517mmx828mm (to be confirmed).
- Leadwork to the porch roof replaced with new lead. Code 5 (min.) or in accordance with the LSA guidelines.
- Central valley gutter overhauled and rebuilt in accordance with LSA guidelines using Code 7 sandcast lead.
- All uPVC guttering replaced with new powder coated aluminium ogee gutters (black).
- All existing downpipes replaced with new powder coated aluminium downpipes (black).
- All chimney stacks and parapet walls assessed and repaired using Bath limestone. Flashings and valley gutters overhauled and repaired/renewed as necessary in accordance with LSA guidelines using Codes 4 and 5 lead as appropriate (min.). Pointing to be in lime mortar (NHL 3.5/sharp sand).

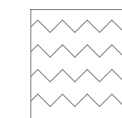

New handmade natural clay club tiles (Dark Antique).

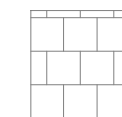


New clay double romans.



Redbank clay Fleur de Lis inserts to ridge.

Scale— 1:100

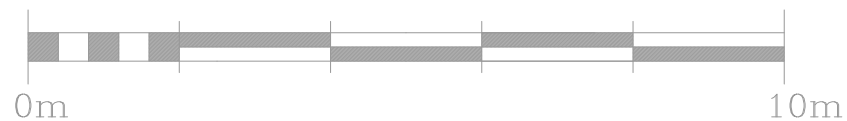

A

AUGUST 2026

MURHILL HOUSE
MURHILL

REFURBISHMENT
DRW REF: HS-04-26-04
ROOF PLAN

AS PROPOSED

SCALE: 1/100@A3