

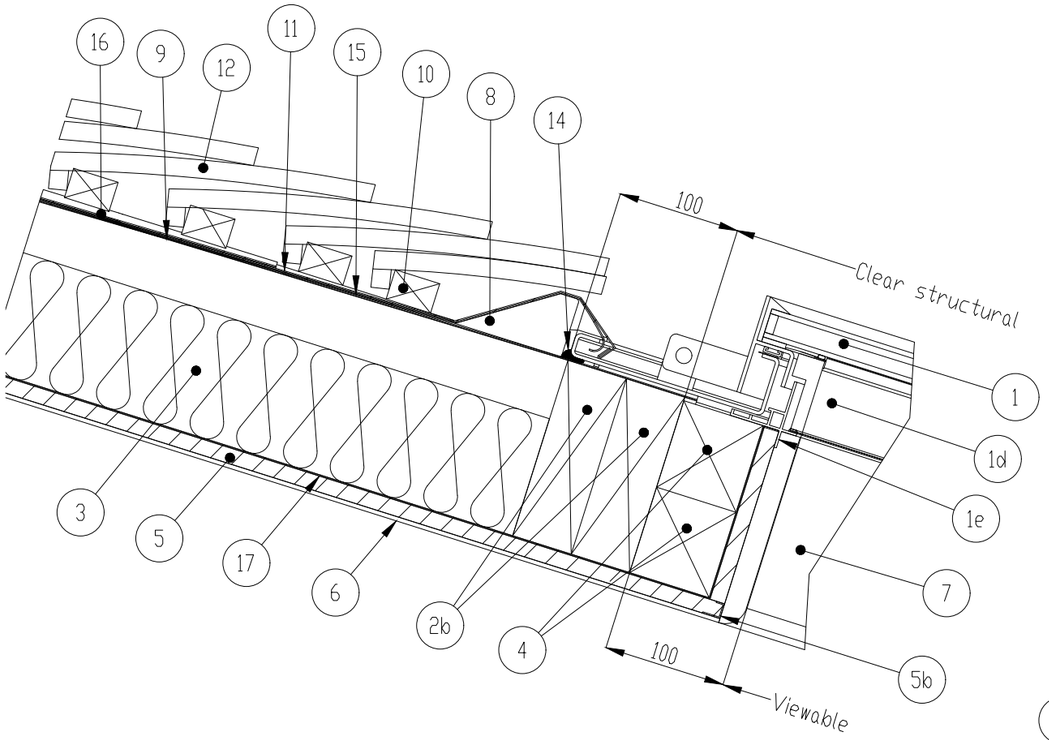


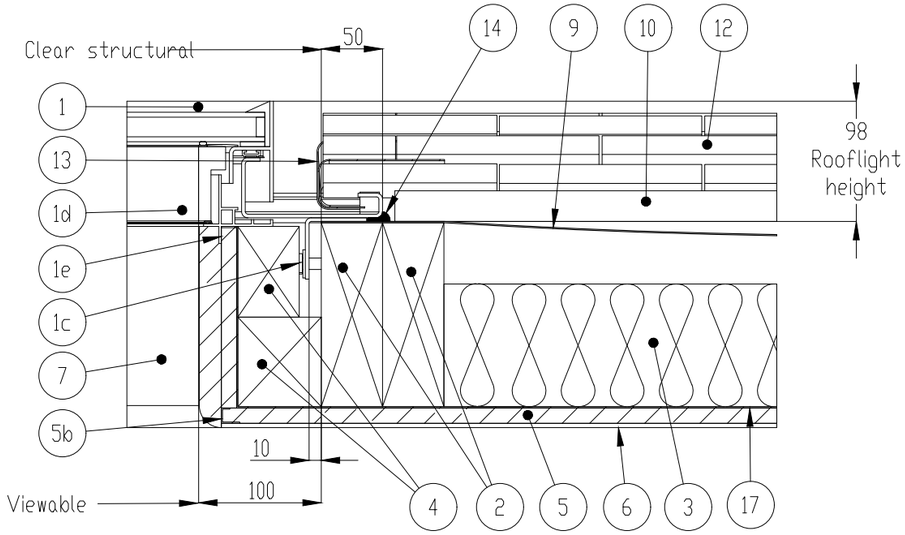

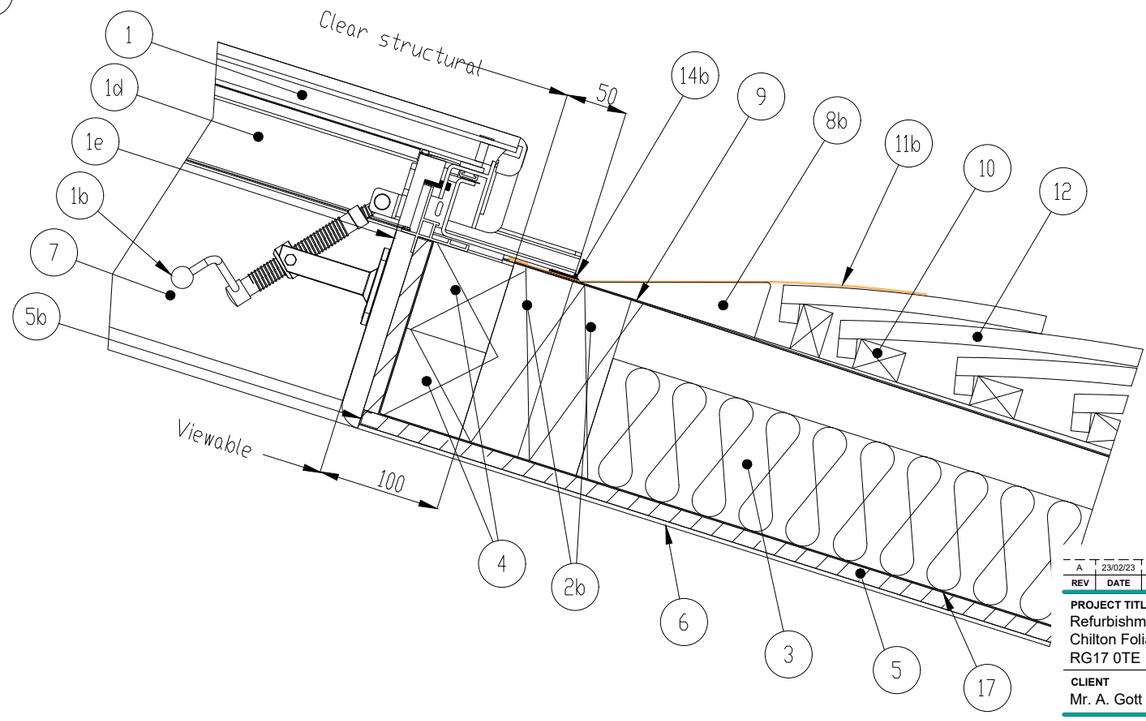

Key:
1. The Conservation Rooflight, with Ironmongery Option 1b fixed to structural rafter supports 2 at jamb using coach bolts fitted through fixing rail 1c.
2. Structural rafter support at jamb and structural trimmer support at head and cill 2b.
3. Insulation fitted between structural supports.
4. Timber packers fixed to structural supports 2, 2b to which plasterboard / timber lining is fixed.
5. Plasterboard lining with plasterboard stop 5b to protect the corner. Plasterboard fitted behind the thermoliner of the roof window 1e.
6. Plaster skim.
7. Timber reveal to align with rooflight linings 1d to provide 'frameless' internal appearance. Rooflight linings 1d MUST BE PAINTED with a timber finishing paint once the rooflight is installed to ensure longevity of this component. If the linings 1d have been factory painted, they do not require an additional paint finish. Please refer to label attached to roof window frame.
8. Head hardwood tilting fillet.
8b. Cill hardwood tilting fillet - to provide minimum 5 degree fall for shedding rain water.
9 & 16. Line of general roofing membrane.
10. Softwood battens.
11. Code 3 (consider using code 4 and clipping down roof tiles in severer exposures) lead flashing at head. Carry flashing up the roof and lap UNDER general roofing membrane 9, 16 and UNDER head membrane 15.
11b. Code 4 (consider clipping flashing and roof tiles down in severer exposures) lead flashing at cill over tilting fillet 8b. Make the flashing long enough to give triple lap to the tiles below.
12. Roofing tiles.
13. Jamb flashing - lead soakers as shown (or mortar bed).
14. Perimeter silicone seal. Seal perimeter of rooflight 1 JUST PRIOR TO installation of the rooflight using a thick continuous bead of low modulus neutral cure silicone sealant. Ensure sealant to cill 14b is located in a position where it will be covered by the cill flange of the rooflight.
15. Roofing membrane to rooflight head. Dress UNDER general roofing membrane 16, UNDER lead flashing 11 and OVER general roofing membrane 9 to ensure suitable lap.
17. Vapour barrier.

Please Note:
These sectional details are provided as an installation suggestion. Due to the differing nature of installations we strongly advise you to consult your rooflight installer to verify fitness for purpose. This drawing does not constitute a structural proposal. Sufficiency of structural supports to be checked by rooflight purchaser's structural consultant.

NOTES

NOT FOR CONSTRUCTION

DO NOT SCALE FROM THESE DRAWINGS

ALL DIMENSIONS TO BE CHECKED ON SITE

REV	DATE	DRWN	CHKD	REVISION DETAILS
A	23/02/23	HB	ARW	PLANNING ISSUE

PROJECT TITLE
Refurbishment of The Wheatsheaf,
Chilton Foliat, Wiltshire,
RG17 0TE

CLIENT
Mr. A. Gott

© Harrison & Pitt Architects Ltd

DRAWING TITLE
AS PROPOSED
Conservation Rooflight Details

DRAWING STATUS
PLANNING

DRAWING No.
2398-020

REVISION
A

SCALE : 1:5 @ A3
DATE : December 2022
DRAWN : HB
CHECKED : ARW

0 | 100 | 200mm

HPA CHARTERED ARCHITECTS
29 CASTLE HILL, LANCASTER LA1 1YN
01524 32479
hpa@hpa.ltd
www.hpa.ltd

DO NOT SCALE SITE DIMENSIONS FROM THIS DRAWING