Isolated replacement to spalled brickwork along parapet, appox 5.5m2. Defective mortar joints to be raked out and replaced using lime mortar to match existing. Where loose stonework to parapet is to be refixed and where damaged replaced.




Ridge and hip tiles to be repaired. Isolated slate replacement to be undertaken to broken or missing slate roof tiles across roof pitch.

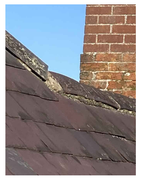

Moss and vegetation growth to be removed. Cornice bedjoint to be rakeout and repointed.


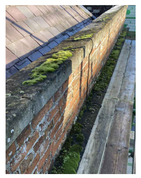

Existing roof covering to be removed to allow for internal timber repairs and treatment.



East Elevation

Hoppers & downpipes to be cleared. Areas of corrosion are to be made good or replaced in cast iron to match exisiting. Redecoration to downpipe and hopper to be undertaken to match existing.

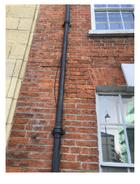
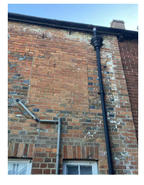


Door and frame to be redecorated and metal weather bar installed to threshold.

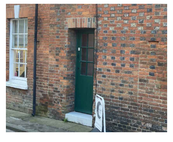

Metal anchor plates to be cleaned and redecorated.


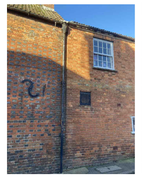


Individual spalled bricks to be replaced. Defective mortar joints to be raked out and repointed using lime mortar to match existing. Area of brickwork replacement to the East Elevation approx 21.5m2.








0.5 0 0.5 1 1.5 2 2.5 m
SCALE 1:50

DISCLAIMER NOTES:

- THIS DOCUMENT IS COPYRIGHT OF THE ORIGINATOR AND MUST BE TREATED AS CONFIDENTIAL
- THIS DOCUMENT MUST NOT BE ALTERED, REPRODUCED OR DISTRIBUTED WITHOUT PRIOR WRITTEN CONSENT OF THE ORIGINATOR
- THIS DOCUMENT MUST NOT BE ALTERED - THE ORIGINATOR ACCEPTS NO RESPONSIBILITY FOR ANY DISCREPANCIES ARISING AS A RESULT OF THE ORIGINATORS INFORMATION BEING ALTERED BY OTHERS
- ANY DISCREPANCY MUST BE REPORTED TO THE ORIGINATOR
- DO NOT SCALE THIS DOCUMENT - USE FIGURED DIMENSIONS ONLY
- ALL DIMENSIONS MUST BE CHECKED ON SITE PRIOR TO COMMENCEMENT OF ANY RELATED WORKS
- THIS DOCUMENT MUST BE READ IN CONJUNCTION WITH ALL SUPPORTING DOCUMENTS PRODUCED BY THE ORIGINATOR AND OTHER PROJECT DISCIPLINES
- THE ORIGINATOR ACCEPTS NO RESPONSIBILITY FOR THE ACCURACY OF BACKGROUND INFORMATION PRODUCED BY THIRD PARTIES - THIS MUST BE TREATED AS INDICATIVE ONLY
- USERS OF THIS DOCUMENT ARE RESPONSIBLE FOR CHECKING WHICH REVISION IS CURRENT
- THE DOCUMENT STATUS "INFORMATION" OR "PRELIMINARY", INDICATES THAT THIS DRAWING IS FOR REFERENCE PURPOSES ONLY - THE ORIGINATOR WILL ACCEPT NO RESPONSIBILITY FOR THE COMPLETENESS OF INFORMATION UNDER THIS STATUS
- THE DOCUMENT STATUS "RECORD" OR "AS BUILT" HAS BEEN PREPARED, IN PART, BASED UPON INFORMATION FURNISHED BY OTHERS. WHILE THIS INFORMATION IS BELIEVED TO BE RELIABLE, THE ORIGINATOR ASSUMES NO RESPONSIBILITY FOR THE ACCURACY OF THIS "RECORD" OR "AS BUILT" DOCUMENT OR FOR ANY ERRORS OR OMISSIONS THAT MAY HAVE BEEN INCORPORATED INTO IT AS A RESULT OF INCORRECT INFORMATION PROVIDED TO THE ORIGINATOR. THOSE RELYING ON THE "RECORD" OR "AS BUILT" DOCUMENT ARE ADVISED TO OBTAIN INDEPENDENT VERIFICATION OF ITS ACCURACY

DRAWING NOTES:

CDM REGULATIONS 2015
SIGNIFICANT OR NON-OBVIOUS RISKS AND RISKS WHICH ARE DIFFICULT TO MANAGE ARE IDENTIFIED ON THIS DRAWING USING THE FOLLOWING SYMBOL IDENTIFIED TO THE RIGHT WITH BRIEF ACCOMPANYING TEXT. FOR FURTHER DETAILS OF THE RISKS IDENTIFIED BY DESIGNERS, REFERENCE SHOULD BE MADE TO CDM HAZARD REGISTER.

Key

Shading denoting areas of brickwork and mortar repairs.

REV	DESCRIPTION	DATE	BY	CHKD
P01	Amended for resubmission to planning	07.08.2023	HDB	PW

ORIGINATOR: www.ridge.co.uk

RIDGE

PROJECT NUMBER: 5020855

CLIENT:
Aster Group

IN ASSOCIATION WITH:

PROJECT:
33 - 36a Park Street,
Devizes,
SN10 1DZ

TITLE:
Proposed External Repairs & Redecorations to East Elevation

DRAWN BY:	HDB	CHECKED BY:	PW	APPROVED BY:	PW
SCALE:	1:50 @ A1	DATE:	04.08.2023		
STATUS:	DESCRIPTION:				
S2	SUITABLE FOR INFORMATION				

DRAWING No: 5020855- 33-36a Park Street Devizes Brickwork Repair Elevations.dwg

PROJECT:	ORG:	FUNCTION:	SPATIAL:	FORM:	DISCIPLINE:	NUMBER:	REV:
5020855	RDG	XX	XX	D	B	0007	P01