



Arboricultural Report

Impact assessment and method statement

Windrush
High Road
Ashton Keynes
SN6 6NX

3rd November 2025

Compiled for:

Partridge Homes (Cotswolds) Ltd

By

Phil Dye

BSc (hons) Arb, Cert Arb L4 (ABC), BA
(Hons), MArborA

Ref: WTC_1596.01

Status: FINAL

Wotton Tree Consultancy

24 Haw Street
Wotton-under-Edge
Gloucestershire

07835 444 675
info@wtreec.co.uk

Validation statement for LPA registration

This report is submitted to Wiltshire Council to accompany a planning application. The report contains tree information relating to the proposal 2 detached dwellings and associated infrastructure.

For local planning authority (LPA) validation purposes, this report contains the following:

- A full tree survey compliant to the requirements of BS5837:2012 'Trees in relation to design, demolition and construction – recommendations' undertaken by a competent and qualified arboriculturist.
- A suitably scaled plan with a north point showing the site boundaries and the tree survey information.
- An assessment of the impacts of the proposed development on the existing trees. This includes recommendations of which trees should be removed/retained and the proposed protection measures.
- An arboricultural method statement outlining appropriate methods of tree protection and any specific technical construction methods needed to implement the design proposals with minimal detriment to retained trees.

Summary

2 'U' category groups of mature ash with ash dieback will require removal as part of this application. The remaining trees will be retained and protected throughout the build. Hedgerow planting is proposed around the site.

With works being carried out in accordance with this tree report the overall impact on the trees is considered to be low.

NOTE

This report is the property of Wotton Tree Consultancy Ltd and is issued on the condition it is not reproduced, retained or disclosed to any unauthorised person, either wholly or in part without the written consent of Wotton Tree Consultancy Ltd.

© Wotton Tree Consultancy Ltd 2025

Contents

Validation statement for LPA registration.....	2
Summary.....	2
1.0 INTRODUCTION.....	5
1.1 Instruction:.....	5
1.2 Documents provided:	5
1.4 Limitations:	6
1.5 Ecological Constraints:.....	6
1.6 Tree preservation orders and/or conservation area protection:.....	6
2.0 SITE VISIT AND DATA COLLECTION	7
2.1 Site Visit:	7
2.2 Site Description:.....	7
2.3 Data collection:.....	7
2.4 Interpretation of data:.....	9
3.0 ARBORICULTURAL OVERVIEW	9
4.0 ARBORICULTURAL IMPACT ASSESSMENT	11
4.1 Below ground constraints	11
4.2 Above ground constraints	11
4.3 ARBORICULTURAL IMPACT CASCADE CHART	12
4.4 Trees to be retained	15
4.5 Trees to be removed	15
5.0 ARBORICULTURAL METHOD STATEMENT	16
5.2 Tree works prior to construction.....	16
5.3 Protective fencing.....	16
5.4 Site access.....	16
5.5 Contractors car parking	17
5.6 Site huts and storage.....	17
5.7 Demolition of the existing structure near T13	17
5.8 Service installation	17

5.9	Ground level changes	17
5.10	Foundations within Root Protection Areas	17
5.11	Hard surfaces within Root Protection Areas	18
5.12	Hedge planting	18
5.13	Soft landscaping within exclusion zones	19
5.14	Responsibilities	19
5.15	Arboricultural supervision	20
APPENDIX 1: Tree schedule		23
APPENDIX 2: Tree constraints plan.....		25
APPENDIX 3: Tree retention/removal plan.....		26
APPENDIX 4: Tree protection plan.....		27
APPENDIX 5: Tree protection fencing (source: BS5837:2012)		28
APPENDIX 6: Tree protection fencing signs.....		29
References		30

1.0 INTRODUCTION

1.1 Instruction: I am instructed by **Partridge Homes (Cotswolds) Ltd**, to inspect the trees that could affect or be affected by the development proposal at the land known as Windrush. This report, in compliance with BS5837:2012 'Trees in relation to design, demolition and construction - recommendations' is required to accompany the submission of a planning application for the proposal 2 detached dwellings and associated infrastructure. My instruction is to prepare the following information:

- A schedule of the relevant trees including tree data and condition assessment.
- A tree constraints plan.
- An arboricultural impact appraisal.
- An arboricultural method statement.
- A tree protection plan.

1.2 Documents provided: Drawings WTC_1596.02 (tree constraints plan), WTC_1596.03 (tree retention/removal plan) and WTC_1596.04 (tree protection plan) are derived from the following drawings which were supplied to me by Ian Hitchings:

- Geomap drawing – *Topographical Survey* – Dwg. No. PH-WR-20-11-24 – Dated: 20/11/2024
- Andrew P Jones Assc. Drawing – *Proposed Site Plan* - Dwg. No. 99/00/-/100 Rev D – Dated: 09/09/25

1.3 I am a consulting arboriculturist with Wotton Tree Consultancy Ltd. I have a BSc (hons) Arboriculture and the AA Technicians Certificate in Arboriculture (Cert Arb L4 (ABC)). I am a LANTRA qualified Professional Tree Inspector. I am a professional member of the Consulting Arborists Society, a professional member of the Arboricultural Association and a licensed user of Quantified Tree Risk Assessment (QTRA) - license no. 2278. I am trained in valuing amenity trees using the Capital Asset Value for Amenity Trees (CAVAT) system. I have been a consulting arborist since 2006.

1.4 Limitations:

1.4.1 My survey was a preliminary assessment undertaken from ground level and observations have been made solely from visual inspections for the purposes of assessment in terms relevant to planning and development. Only binoculars, mallet and a probe have been used to aid tree assessment. No invasive or non-invasive internal decay detection devices have been used in assessing tree condition.

1.4.2 The recommendations and conclusions in this report relate only to the conditions found on this site at the time of the site visit and inspection. The recommendations contained within this report are valid for a period of 12 months from the date of this report. Any significant alteration to the site that may affect the trees that are present or have planning implications (level changes, additional tree works, post extreme weather events, hydrological changes) and will necessitate a re-assessment of the trees and the site.

1.4.3 The tree survey that forms part of this report is not a tree safety inspection. The survey has been carried out in order to inform the planning process. Where obvious risks have been observed, they have been addressed in the 'preliminary management recommendations' (see Appendix 1 – Tree Schedule). Potential hazards and levels of risk are likely to change as the site usage changes during and post development.

1.5 Ecological Constraints: The Wildlife and Countryside Act 1981 and amendments made within and subsequent to the Countryside and Rights of Way act 2000 provides statutory protection to bats, birds and other species that inhabit or use trees. The protection afforded to these species could impose significant constraints on the use of a particular site as well as significantly restrict the timing of any works that may be necessary. Any restrictions are in addition to the tree restriction highlighted in this report. Whilst I have some working knowledge of these potential issues they are outside my area of expertise and you must seek advice from a qualified ecologist to ascertain if any further restrictions apply.

1.6 Tree preservation orders and/or conservation area protection:

Having consulted Wiltshire Council's online planning map (<https://wiltscouncil.maps.arcgis.com/apps/webappviewer/index.html?id=74a353612a934bd48fee1f2bc564cdd8&find=18/03160/FUL>) [accessed 29th September 2025] I am informed that the site does not sit within a Conservation Area, nor are any trees on site subject to a Tree Preservation Order. Due to occasional inaccuracies with web-based records it is advisable to check directly with Wiltshire Council before undertaking tree works.

2.0 SITE VISIT AND DATA COLLECTION

2.1 Site Visit: I visited the site on 5th September 2025. All observations were made from ground level (aided by the Visual Tree Assessment method – Mattheck and Breloer, 1994) and all measurements except stem diameter were estimated unless otherwise stated in the tree schedules. The weather at the time of the visit was cool and overcast; these conditions in no way hindered my ability to view the trees.

2.2 Site Description:

The site consists of old, dilapidated barns and stables. A water course runs along the south boundary.

2.3 Data collection: Each tree or group was inspected and allocated an identification number as indicated in the tree schedule (appendix 1) and tree survey plan. For each tree the following information was collected:

- species
- height (m)
- stem diameter (mm)
- average radius of crown to 4 cardinal points (m)
- height and orientation of first significant branch
- average height of canopy clearance
- life stage
- observations regarding condition
- preliminary management recommendations
- safe useful life expectancy

As encouraged in BS5837:2012, each tree or group was allocated to one of four categories (A,B,C or U), which reflects its suitability for retention in context of the development. Please see table 1 for explanation of the criteria for tree categorisation.

Table 1: cascade chart for tree assessment, adapted from Table 1 of BS5837:2012


Category & definition	Criteria (including subcategories where appropriate)			Identification on plan
Trees unsuitable for retention				
Category U Trees in such a condition that they cannot realistically be retained as living trees in the context of current land use for >10 yrs	- Trees that have a serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other category U trees - Trees that are dead or showing signs of significant, immediate and irreversible decline - Trees infected with significant pathogens affecting health or safety, or very low quality trees suppressing trees of better quality <i>NOTE: these trees can have existing or potential conservation value making retention desirable</i>			DARK RED
	1 Mainly arboricultural qualities	2 Mainly landscape qualities	3 Mainly cultural values incl conservation	
Trees to be considered for retention				
Category A Trees of high quality with an estimated remaining life expectancy of >40 yrs	Particularly good examples of their species, esp if rare or unusual. Those that are essential components of groups or formal or semi-formal arboricultural features	Trees, groups or woodlands of particular visual importance as arboricultural and/or landscape features.	Trees, groups or woodlands of significant conservation, historical, commemorative or other value	LIGHT GREEN
Category B Trees of moderate quality with an estimated remaining life expectancy of >20 yrs	Trees that might be included in category A but are downgraded because of impaired condition such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit category A designation.	Trees present in numbers, usually growing as groups or woodlands such that they attract a higher collective rating than they might as individuals. Trees occurring as collectives but situated so as to make little visual contribution to the area.	Trees with material conservation or other cultural value	MID BLUE
Category C Trees of low quality with an estimated remaining life expectancy of >10 years, or young trees with a stem diameter <150mm	Unremarkable trees of very limited merit or such impaired condition that they do not qualify in higher categories.	Trees present in groups or woodlands, but without this conferring on them significantly greater collective landscape value; and/or trees offering low or only temporary landscape benefits.	Trees with no material conservation or other cultural value.	GREY

- 2.4 Interpretation of data:** Section 4.6 of BS5837:2012 recommends that the trunk diameter measurement is used to calculate the RPA which can then be interpreted to identify the design constraints of a particular site. Once the design principal has been established the construction exclusion zone and location of protective measures can be identified.

3.0 ARBORICULTURAL OVERVIEW

- 3.1.1 A total of 19 items were surveyed within and adjacent to the development site. These items comprised 13 individual trees and 6 groups. The chart below shows the ratio of tree retention categories on the site.

Tree retention category ratios

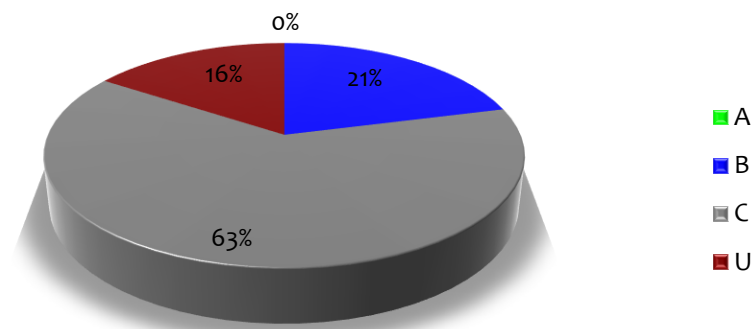

- 3.1.2 G5 and G6 are mature 'U' category ash trees with stage 2 ash dieback. Given their proximity to neighbouring land, these should be removed irrespective of the planning application.



Plate 1: G5 (left) and G6 – 'U' category ash for removal.

- 3.1.3 T13 is a C category hazel. It's RPA lies within the building identified for demolition and so a method statement is provided in section 5 to ensure root disruption is minimised.



Plate 2: T13 – Hazel close to structure for demolition.

4.0 ARBORICULTURAL IMPACT ASSESSMENT

4.1 Below ground constraints

4.1.1 Below ground constraints refer to tree roots. These are easily overlooked during construction operations as they are unseen and often little is understood about their importance. It is essential to ensure that roots are not damaged during building operations as they are the life blood of each tree, providing structural stability by anchoring the tree to the ground and providing transportation of water and nutrients from the soil to the foliage.

4.1.2 In reality the spread of roots for trees in an urban environment will rarely be distributed in a perfect circle as the environment below ground level is highly variable. The presence of structural foundations, pipes, impermeable surface coverings and differing soil conditions mean that tree roots will extend in to areas that offer a preferential environment; where water is most available and the soil is least compacted.

4.1.3 Root protection areas (RPAs) are shown as a circle centred on the base of the stem unless site conditions such as nearby structures indicate that the shape of the rooting area deviates from this format.

4.2 Above ground constraints

4.2.1 Trees in close proximity to buildings can provide some constraints, both actual and perceived. Actual constraints may be where low branches conflict with new elevations either at the time of building or in the future. Future growth of young trees should be accommodated in building design. Other constraints include shade, leaf litter and damage from falling branches.


4.2.2 Large tree canopies close to buildings can also cause 'post-development pressure' by way of requests for tree removal or pruning as a result of resident anxiety.

4.2.3 Although some shading is possible it is not considered to be significant.


4.2.4 It is possible that leaf fall could block gutters and downpipes. This can be mitigated through regular maintenance of the guttering or by installing a proprietary gutter guard.

4.3 ARBORICULTURAL IMPACT CASCADE CHART

4.3.1 Tree **Values** are taken from BS: 5837 and comprise of the following:



4.3.2 The **Impacts** comprise of 6 elements:



4.3.3 Causes of impacts comprise of 6 factors: '**None**', '**To facilitate development**', '**Due to poor condition**', '**Direct disturbance to roots**', '**Pruning required**' and '**Possible future pruning pressure due to shade and other factors**'.

4.3.4 Comments are also included providing more information where necessary.

	REMOVAL	PARTIAL REMOVAL	HIGH	MODERATE	LOW
TO FACILITATE DEVELOPMENT	Tree / group requires removal.	Partial removal of group is required. I.e., 'a section of hedge may require removal to allow a new access road'.	N/A	N/A	N/A
DUE TO POOR CONDITION	Tree or group require removal due to poor structural and / or physiological condition.	Part of group require removal due to poor structural and / or physiological condition.	N/A	N/A	N/A
DIRECT DISTURBANCE TO ROOTS	N/A	N/A	In many case this will result in the loss of tree/s - refer to ' TO FACILITATE DEVELOPMENT '. In rare cases a Tree/s may be retained but damage will occur to the roots. Up to 30% of total RPA area affected.	Disturbance will be caused to roots of a tree/s that are likely to result in some physiological and structural dysfunction. The extent of damage does not require trees to be felled. Remedial actions may be taken in some cases that would help mitigate against damage but site topography, tree age, condition and species condition may result in disturbance being considered MODERATE as opposed to LOW . Up to 20% of total RPA area affected.	Activity will occur within the root protection area of trees which will have a low impact, or can be mitigated by special measures. Up to 10% of total RPA area affected.
PRUNING REQUIRED	N/A	N/A	Pruning that may retain a tree but will have a potential impact on the tree condition and visual appearance	Pruning is required that is acceptable within recommendations within BS3008:2010, but would require a material alteration to the tree/group affected.	Pruning is required that will have little impact to the structural, physiological and visual amenity of a tree or group.
POSSIBLE FUTURE PRUNING PRESSURE DUE TO SHADE OR OTHER FACTORS	Removal of tree/s required as retention is unsustainable and/or undesirable within the context of development. I.e. fast growing tree in small garden.	Partial removal of tree/s required as retention is unsustainable and/or undesirable within the context of development. I.e. fast growing tree in small garden.	Tree/s likely to cause significant shading. I.e. small garden areas with dense mature trees to south.	Some level of shade or other inconvenience will occur. Not highly oppressive, but some residents may seek management of trees in long term.	Some level of shading / overhang will occur.

Table and cascade chart courtesy of Mike Gregory (2021)

Arboricultural Implications Assessment						
Ref No.	Species	Value	Impact	Impact Cause	Management Options / Comments	Other
T1	Ash	U (Poor)	None	None	Not affected by the proposals	No Tree protection required
G1	Apple x 2	B (Moderate)	None	None	Not affected by the proposals	No Tree protection required
T2	Apple	C (Low)	None	None	Not affected by the proposals	No Tree protection required
T3	Common walnut	B (Moderate)	None	None	Not affected by the proposals	No Tree protection required
T4	Quince	C (Low)	None	None	Not affected by the proposals	No Tree protection required
G2	Apple x 3	B (Moderate)	Low	Direct disturbance to roots	Post and rail fencing proposed within RPA. Method statement provided in section 5 - 'Phasing of Arboricultural Works'	Tree protection required - See WTC_1596.05
T5	Apple	C (Low)	None	None	Tree protection required - See WTC_1596.04	N/a
T6	Apple	C (Low)	Low	Direct disturbance to roots	Post and rail fencing proposed within RPA. Method statement provided in section 5 - 'Phasing of Arboricultural Works'	Tree protection required - See WTC_1596.05
T7	Apple	C (Low)	None	None	Not affected by the proposals	No Tree protection required
T8	Crack willow	B (Moderate)	None	None	Tree protection required - See WTC_1596.04	N/a
T9	Grey willow	C (Low)	None	None	Tree protection required - See WTC_1596.04	N/a
G3	Crack willow x 3	C (Low)	None	None	Tree protection required - See WTC_1596.04	N/a
G4	Leyland cypress x 4	C (Low)	None	None	Tree protection required - See WTC_1596.04	N/a

Ref No.	Species	Value	Impact	Impact Cause	Management Options / Comments	Other
T10	Prunus spp	C (Low)	None	None	Tree protection required - See WTC_1596.04	N/a
G5	Ash x 3	U (Poor)	Removal	Due to poor condition	Stage 2 ash dieback present, so tree is proposed for removal.	N/a
T11	Prunus spp	C (Low)	None	None	Tree protection required - See WTC_1596.04	N/a
T12	Robinia	C (Low)	None	None	Tree protection required - See WTC_1596.04	N/a
G6	Ash x 2	U (Poor)	Removal	Due to poor condition	Stage 2 ash dieback present, so tree is proposed for removal.	N/a
T13	Hazel	C (Low)	Low	Direct disturbance to roots	Existing building within RPA for demolition. Method statement provided in section 5.	Tree protection required - See WTC_1596.04

4.4 Trees to be retained

Of the 13 trees and 6 groups surveyed, 13 trees and 4 groups are proposed to be retained.

- 4.4.1 Tree protection on development sites is of paramount importance if trees are to be retained successfully. The inevitable stress caused by development near an existing tree can, if provision for adequate protection is not made, be a strain that can severely damage the trees or even result in their death. Although the trees appear healthy during and on completion of the development, the full effects may not come apparent for up to five or more years after works have finished.

4.5 Trees to be removed

- 4.5.1 2 groups are proposed for removal as a result of this development.

Retention category	Proposed for removal due to development	Proposed for removal due to poor condition	Total number of removals
A	-	-	0
B	-	-	0
C	-	-	0
U	-	G5 and G6	2
Totals	0	2	2

5.0 ARBORICULTURAL METHOD STATEMENT

- 5.1.1 Control measures for construction works in or near to the root protection zone are detailed in this chapter. This will form the method statement of works and will be the exact principle/methodology utilized during construction periods.

5.2 Tree works prior to construction

- 5.2.1 Following the approval of Wiltshire Council's appointed Tree officer, all tree works will be carried out to BS 3998 "*Recommendations for Tree Work*" (2010) or BS 5837 "*Trees in relation to design, demolition and construction - Recommendations*" (2012) or as modified by more recent research. Tree works will be undertaken before commencement of other site operations.

5.3 Protective fencing

- 5.3.1 Before the commencement of any works on site protective fencing shall be erected to the dimensions shown on the accompanying drawing 'tree protection plan'. Individual root protection areas at the measured m² will be erected for the duration of the development around retained trees. Although these protection measures will be in place for the duration of the development on site monitoring will allow for the successful retention of the subject trees.
- 5.3.2 Tree protection fencing will be constructed to the specification as set out in Appendix 5 of this report. It is imperative that the fencing is constructed in such a way that it cannot be easily moved or opened during construction work.
- 5.3.3 Signs will be affixed to the fencing to inform on-site contractors of the importance of the fencing barriers (Appendix 6).
- 5.3.4 The construction exclusion zones (CEZs) are to be treated as sacrosanct and the following guidelines must be followed:
- NO mechanised excavations
 - NO movement of construction traffic or parking of vehicles
 - NO storage of building materials
 - NO storage of chemicals or fuels
 - NO fires to be lit in close proximity to trees
- 5.3.5 Fences must only be removed following a site visit from the Local Authority officer to confirm on-site construction activity has been completed.

5.4 Site access

- 5.4.1 The site shall be accessed via the entrance from High Road.

5.5 Contractors car parking

- 5.5.1 No vehicles shall be parked on un-surfaced ground within the RPA of retained trees.

5.6 Site huts and storage

- 5.6.1 Any storage required for materials, spoil, plant or welfare facilities shall be positioned outside the RPA of retained trees. Mixing of cement shall be in a designated area where runoff will not enter the RPAs of retained trees. Ground protection in the form of a geotextile membrane will ensure no leaching of mixings enters the soil and kick boards around the perimeter will ensure that runoff is contained.

5.7 Demolition of the existing structure near T13

- 5.7.1 The existing barn near T13 will be demolished at the start of the build.
- 5.7.2 The following method of works shall be undertaken to ensure the rooting area is not adversely impacted by this operation.
- 5.7.3 Any heavy machinery shall be stationed outside the RPA of retained trees and operate either within the barn footprint or outside RPAs.
- 5.7.4 Demolition can then be undertaken inwards within the footprint or away from the RPA, often referred to as 'top down, pull back'.
- 5.7.5 The concrete slab floor will be removed with the plant machinery stationed on hardstanding away from the RPA. The floor can then be carefully lifted and pulled back.

5.8 Service installation

- 5.8.1 I have not been supplied with details of the routing of underground services that may affect the trees on site. The provision of underground services must be led by the site's tree constraints. Should the routing of services cause conflict with the specified RPAs, a detailed and specific method of work will be provided in writing to the LPA for approval prior to installation of services.

5.9 Ground level changes

- 5.9.1 There shall be no changes in ground levels within the RPAs of retained trees during the construction.

5.10 Foundations within Root Protection Areas

- 5.10.1 There shall be no foundations within RPAs of retained trees.

5.11 Hard surfaces within Root Protection Areas

- 5.11.1 There shall be no hard surfaces within RPAs of retained trees.

5.12 Hedge planting**5.12.1 GENERAL**

- 5.12.1.1 All hedge planting to be undertaken in accordance with British Standards publication BS8545:2014 Trees: from nursery to independence in the landscape – Recommendations.

5.12.2 GROUND PREPARATION

- 5.12.2.1 Prior to planting, any tree stumps must be ground out and the planting area treated with an appropriate Glyphosate based systemic herbicide. Please check the current list of approved herbicides and follow the manufacturer's instructions.

- 5.12.2.2 Lightly cultivate the soil removing large stones (>75mm dia), rubbish, concrete, metal and glass.

5.12.3 HEDGE PLANTING METHOD

- 5.12.3.1 All plants shall conform to the relevant section of BS3936 and National Plant Specification. All plants to be true to size specified, healthy, pest and disease free, not dried out, wind burnt, pot bound, waterlogged, leggy or weak.
- 5.12.3.2 Planting should be carried out between November and March. Avoid very wet, snowy or frosty conditions.
- 5.12.3.3 Plant the stock in two staggered rows with the rows being 300 mm apart and plants within rows 400 mm apart. Allow for 5 plants per linear metre. Plant in small single species groups to reduce competition between species. Holly and larger growing trees are to be planted individually.
- 5.12.3.4 Plant the hedging plants in pits larger than the root ball up to the nursery line, having first gently teased out any roots from the root ball of any container grown stock. Firm in.
- 5.12.3.5 Immediately after planting, cut Hawthorn down to 150mm.
- 5.12.3.6 60cm high shrub shelters with stakes are to be used to protect plants from browsing mammals – these are larger in diameter than spiral guards and allow low lateral growth to develop. <http://www.tubex.com/>

5.12.3.7 100mm deep layer of a suitable mulch such as woodchip to be spread at the base of the plants at a minimum of 1m radius from the plants.

5.12.3.8 Hedging plants to be well watered in.

5.12.4 AFTERCARE

The following covers a 10-year programme of aftercare to ensure the establishment of the trees and hedgerow.

Figure 1: 10 year aftercare matrix

TASK	Yr1	Yr2	Yr3	Yr4	Yr5	Yr6	Yr7	Yr8	Yr9	Yr10
Top up mulch	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
Water well, especially during dry periods	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
Beat up – replace any plants that have failed with that of the same size and species.	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
Litter pick	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
Remove weeds by hand (quarterly visits per annum)	✓	✓	✓	✓	✓					
Formative pruning of the hedge by pruning side and leading shoots by 1/3 back to suitable pruning points to encourage a denser hedge base	✓	✓	✓							
Review aftercare plan					✓					

5.13 Soft landscaping within exclusion zones

5.13.1 Soft landscaping must respect the rooting areas of retained trees. Removal of spoil and the import of materials must be outside the specified RPAs.

5.13.2 No level changes or disturbance to the soil will take place within RPAs of retained trees. This includes in particular any rotavating of the ground. Should the soils require cultivating, the use of an airspade can be employed under an arboricultural watching brief.

5.14 Responsibilities

5.14.1 It will be the responsibility of the main contractor to ensure that any planning conditions attached to planning consent are adhered to at all times and that a monitoring regime in regards to tree protection is adopted on site.

5.14.2 The main contractor will be responsible for contacting the Local Planning Authority at any time issues are raised related to the trees on site.

5.14.3 If at any time pruning works are required permission must be sought from the Local Planning Authority first and then carried out in accordance with BS 3998 Recommendations for Tree Works 2010.

5.14.4 The main contractor will ensure the build sequence is appropriate to ensure that no damage occurs to the trees during the construction processes. Protective fences will remain in position until completion of ALL construction works on the site.

5.14.5 The fencing and signs must be maintained in position at all times and checked on a regular basis by an onsite person designated that responsibility.

5.15 Arboricultural supervision

5.15.1 It is recommended a number of short inspections of the subject trees should be undertaken by the project arboriculturist familiar with BS5837:2012 operations during the extent of the project to ensure that methods of works are in accordance with this method statement.



5.15.2 Any works required within the RPA of retained trees that is not covered in this document can only be done so with the written permission of the Local Planning Authority, in accordance with a detailed arboricultural method statement and under an arboricultural watching brief.



Phil Dye - BSc (hons) Arb, Cert Arb L4 (ABC), BA (Hons), MArborA

3rd November 2025

Phasing of arboricultural works

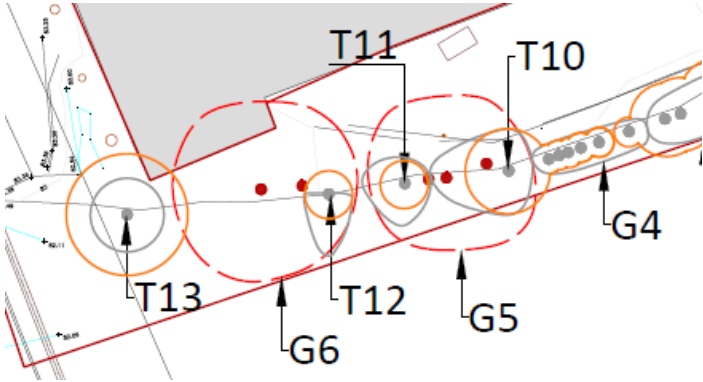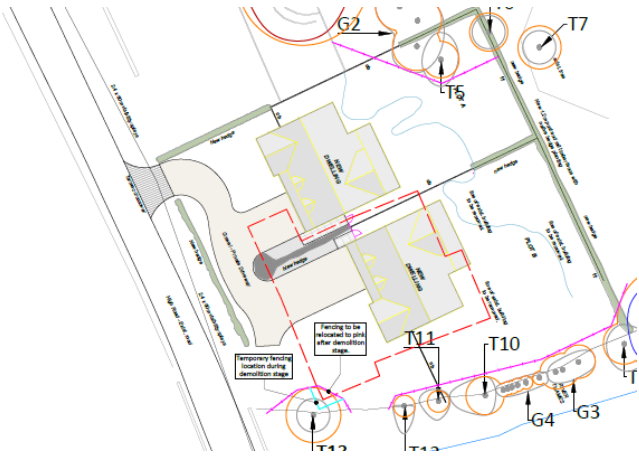Phase	Requirements	Method
1 Prior to any construction works on site	Undertake tree felling. Removal of G5 and G6	Refer to section 4.5 of this report. All tree works to be carried out to BS3998: 2010: by suitably qualified and insured professional tree surgeons. All items requiring felling are marked in red on the Tree Retention/Removal Plan 
2 Prior to any construction works on site	Erection of protective fencing: 	Protective fencing is to be erected in accordance with 5.3 of this report. The fencing must comply with the positions shown in the Tree Protection Plan and agreed at the pre-commencement site meeting. No works, no storage of materials, no access, or any ground disturbance is to take place within the Tree Protection Barrier Fencing. Fenced areas are to be treated as Construction Exclusion Zones. Warning signs to be placed on all protective fencing. For large sections of fencing the signs must be placed at 15m intervals. Signs must be laminated and securely attached at all corners. Two signs are to be placed side by side; copies of which are attached within Appendix 6. 

Phase	Requirements	Method
3 Start of development	Commencement of development	Protective fencing to remain in situ during development phase.
4 Completion of main construction and undertaking of landscaping	Landscaping and Dismantling of tree barrier protective fencing. Hedge planting	It is essential that ground levels within the root protection areas are not altered, either by raising or lowering soil levels; even at the landscaping stage. Landscaping operations must be undertaken in a manner that will not impact trees. Landscaping within the root protection area of trees must be undertaken using hand tools only in line with any approved Landscaping management plans Hedge planting to be undertaken in accordance with the supplied method statement and hedge planting plan.
5 Completion of main construction and installation of boundary treatments	Garden and perimeter fencing within RPA of retained trees	In addition to the points addressed in 4 above, within RPAs of retained trees the wooden fencing shall be installed as follows: 1. Hand tools only 2. Exploratory post holes to be dug. Any roots encountered less than 2.5cm diameter should be cleanly cut back. 3. Roots in excess of 2.5cm can only be removed once arboricultural advice has been sought. 4. Where roots in excess of 8cm are encountered, an alternative location for the post hole is required. 5. Prior to the pouring of concrete a non-permeable membrane must fully line the post hole.



APPENDIX 1: Tree schedule

Tree ID	Species	Ht (m)	Stem Dia. (mm)	Spread (m)				Avg. Canopy Height (m)	Life Stage	Health & vitality	Struct. cond.	General Observations	Preliminary Recommendations	Estimated safe useful life expectancy (Years)	BS5837: 2012 Category	RPA Radius (m)	RPA m²
				N	E	S	W										
T1	Ash	19	660	6	6	7	7	2	Mature	Poor	Good	Onset ash dieback present	-	<10	U	7.9	197
G1	Apple x 2	10	480					1	Mature	Good	Good	-	-	20+	B2/3	5.8	104
T2	Apple	4	160	3	2	2	2	1	Early-mature	Fair	Fair	-	-	10+	C2/3	2.0	12
T3	Common walnut	15	530	8	5	7	5	1	Mature	Good	Good	-	-	20+	B2/3	6.4	127
T4	Quince	4	180	2	2	3	3	0	Early-mature	Fair	Fair	-	-	10+	C2/3	2.2	15
G2	Apple x 3	6	240	-	-	-	-	1	Early-mature	Good	Good	-	-	20+	B2/3	2.9	26
T5	Apple	4	180	3	2	3	2	1	Early-mature	Fair	Fair	-	-	10+	C2/3	2.2	15
T6	Apple	4	190	2	2	2	2	1	Early-mature	Fair	Fair	-	-	10+	C2/3	2.3	16
T7	Apple	4	220	2	2	2	2	1	Early-mature	Fair	Fair	-	-	10+	C2/3	2.6	22
T8	Crack willow	9	540	5	7	6	5	1	Mature	Good	Fair	Managed as a pollard. Old tear out wound down the trunk. Reaction wood present.	-	20+	B3	6.5	132
T9	Grey willow	5	210	2	3	3	2	2	Mature	Fair	Fair	Growing on river bank	-	10+	C3	2.5	20

Tree ID	Species	Ht (m)	Stem Dia. (mm)	Spread (m)				Avg. Canopy Height (m)	Life Stage	Health & vitality	Struct. cond.	General Observations	Preliminary Recommendations	Estimated safe useful life expectancy (Years)	BS5837: 2012 Category	RPA Radius (m)	RPA m²
				N	E	S	W										
G3	Crack willow x 3	6	170	-	-	-	-	2	Young	Good	Fair	Not plotted on topo. Location estimated. Managed as a pollards.	-	10+	C3	2.0	13
G4	Leyland cypress x 4	4	70	-	-	-	-	2	Young	Good	Good	Not plotted on topo. Location estimated.	-	10+	C2	0.8	2
T10	Prunus spp	3	190	2	1	2	4	1	Early-mature	Fair	Fair	-	-	10+	C3	2.3	16
G5	Ash x 3	17	410	-	-	-	-	3	Mature	Poor	Poor	Stage 3 ash dieback. In significant decline	Remove	<10	U	4.9	76
T11	Prunus spp	5	110	1	1	2	2	2	Semi-mature	Fair	Fair	-	-	10+	C3	1.3	5
T12	Robinia	6	100	0	1	3	1	4	Young	Fair	Fair	-	-	10+	C2	1.3	5
G6	Ash x 2	18	480	-	-	-	-	5	Mature	Poor	Poor	Stage 3 ash dieback. In significant decline	Remove	<10	U	5.8	104
T13	Hazel	5	280	2	2	2	2	0	Mature	Good	Good	Not plotted on topo. Location estimated.	-	20+	C3	3.3	35

APPENDIX 2: Tree constraints plan

WTC_1596.02

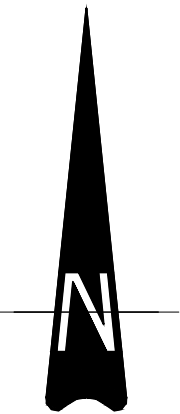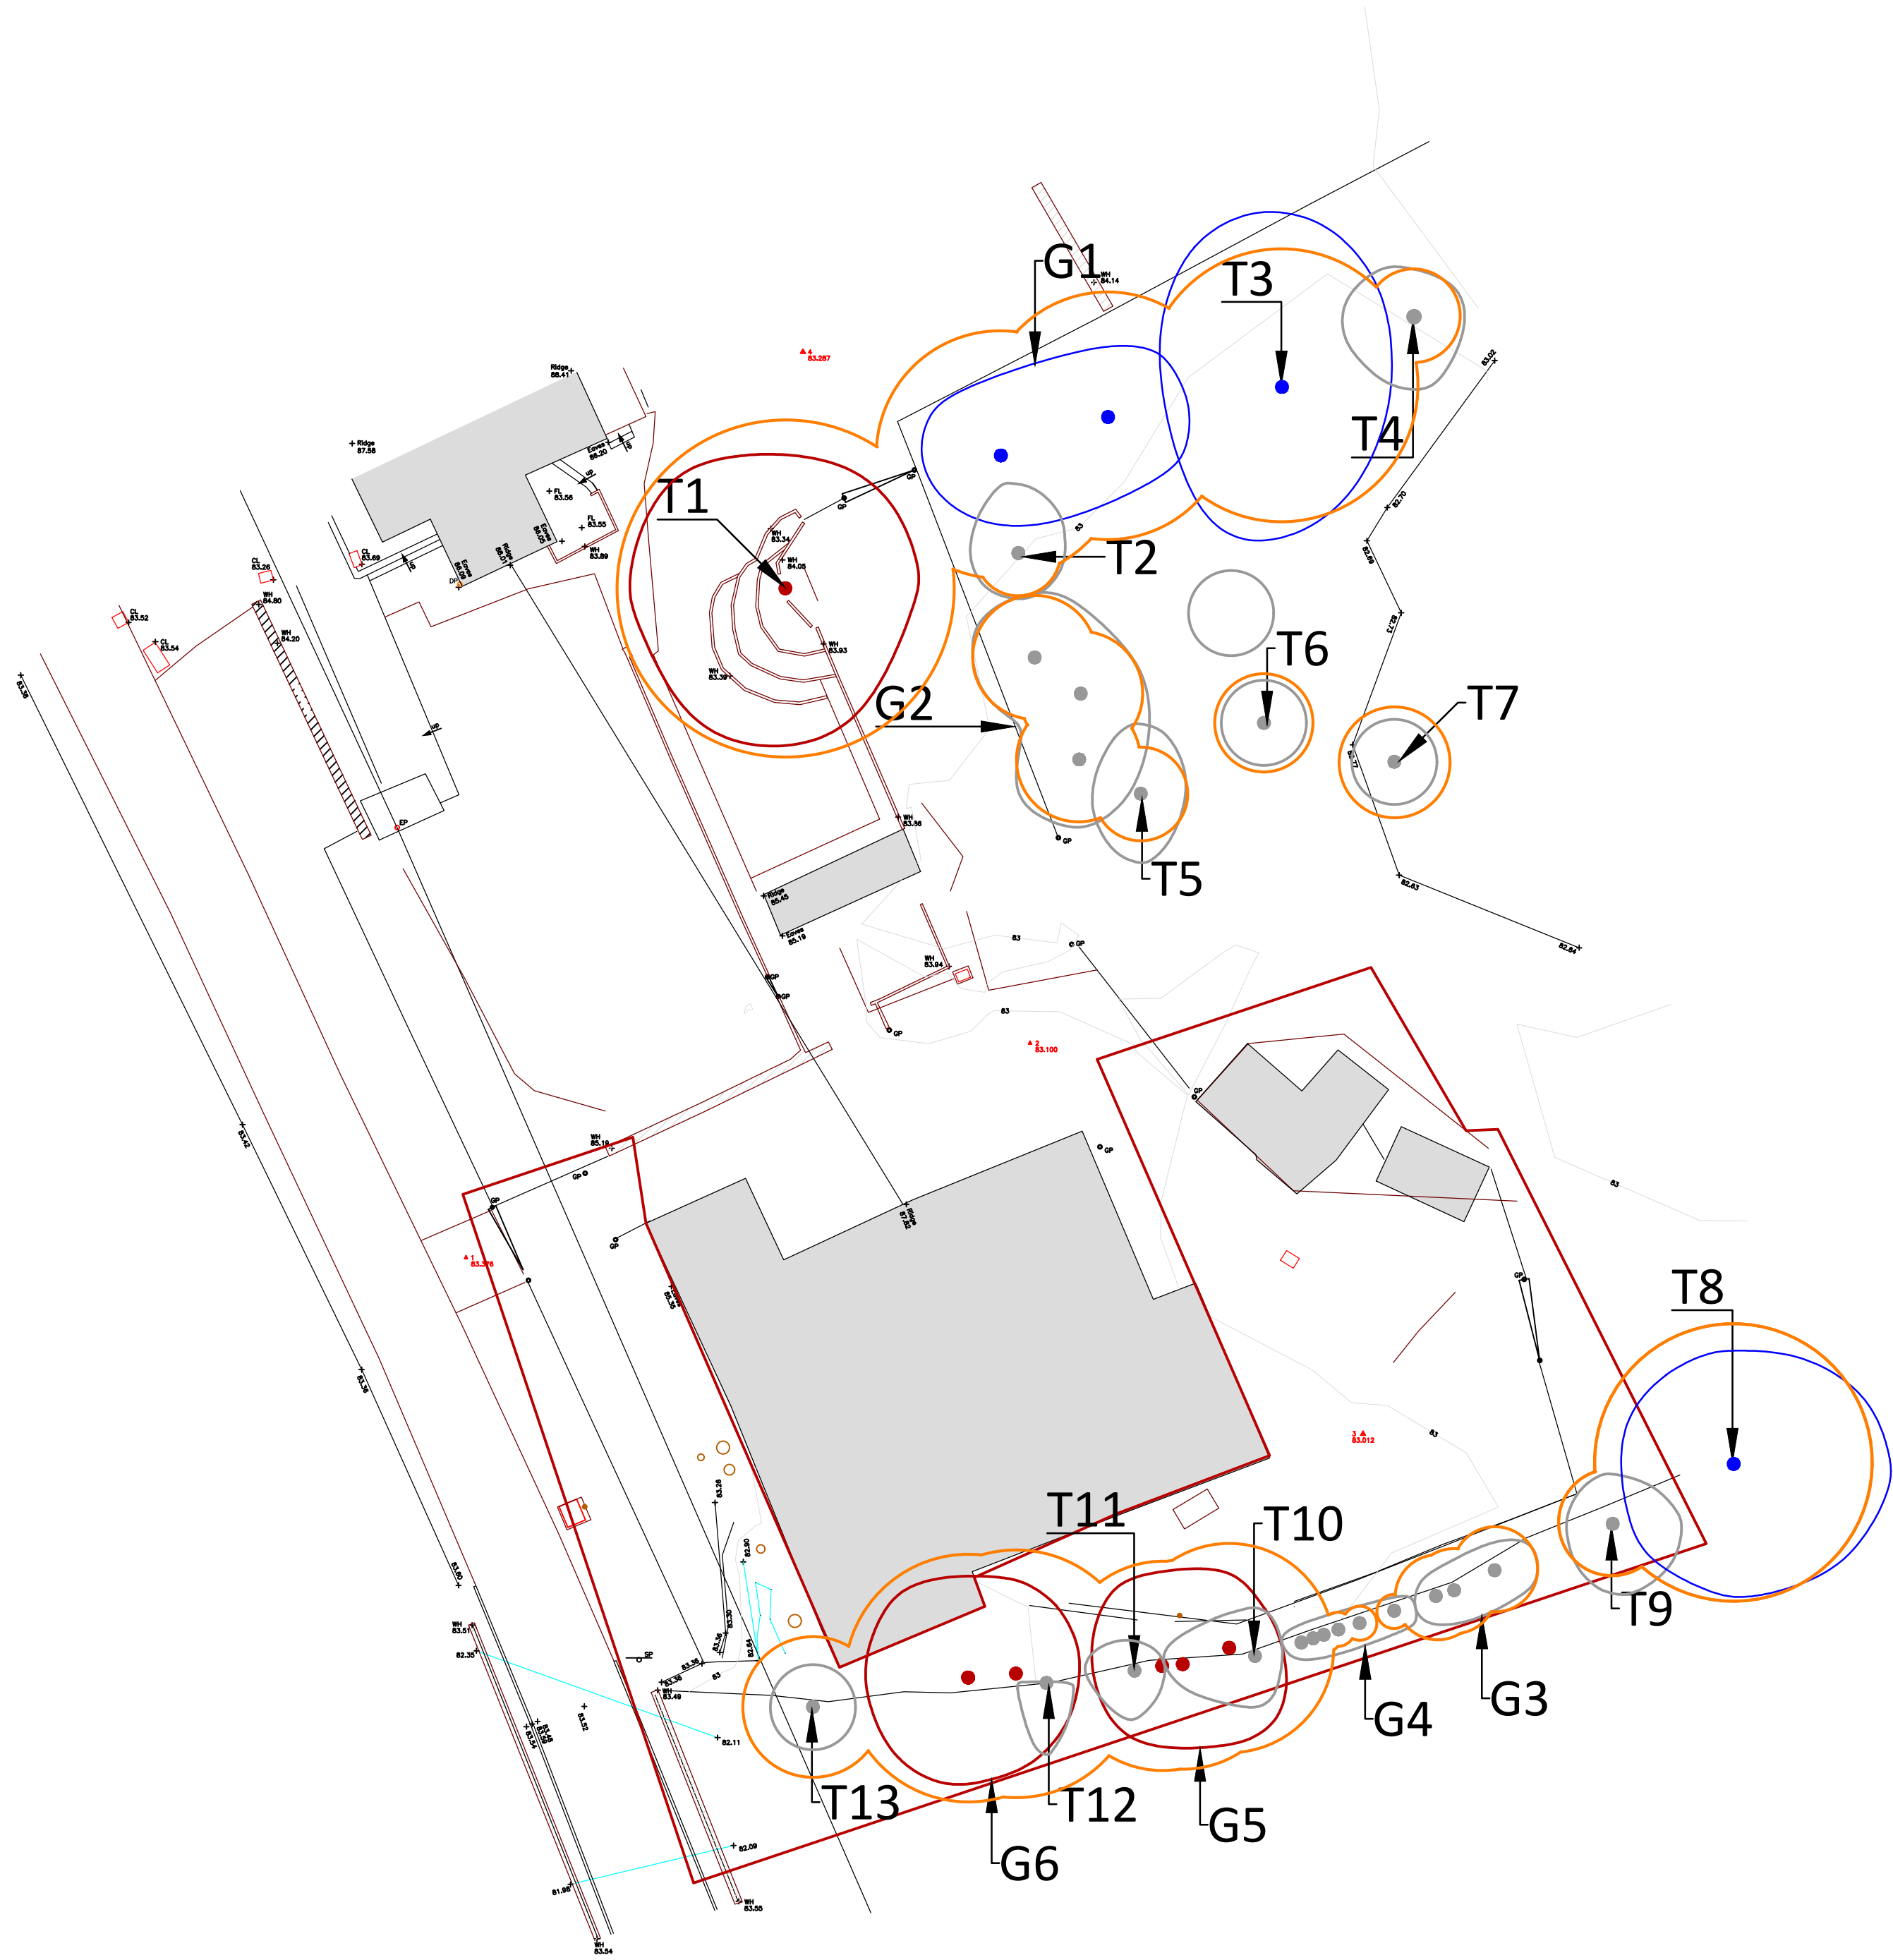

This drawing is solely for planning purposes.
Do not scale from this drawing.
Please check all dimensions on site and notify us of any discrepancies. Wotton Tree Consultancy Ltd (WTC) cannot be held responsible for any discrepancies or inaccuracies in the topographical plan upon which this drawing is based.
© Wotton Tree Consultancy Ltd 2025.
This drawing is copyright and cannot be used or altered without the express permission of WTC Ltd.
This drawing is designed to reflect only the principles of layout and/or design insofar as these relate to the protection of trees to be retained and should NOT be read as a definitive engineering or construction method statement. Reference should be made to the architect or engineer as appropriate over any matters of construction detail or specification or any engineering standards or regulatory requirements relating to proposed structures, hard surfaces or underground structures.

Key

T1

Tree/group canopy

Root Protection Area

Retention Categories

A High quality

B Moderate quality

C Low quality

U Unsuitable for retention

Project

Windrush
High Road
Ashton Keynes



Title

Tree Constraints
Plan

		Rev	Rev date
Drg No	WTC_1596.02		
Scale @A2	1:250	Drn by	PD
Date	Nov 2025	App	

APPENDIX 3: Tree retention/removal plan

WTC_1596.03

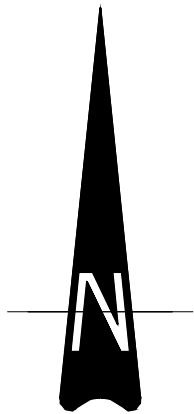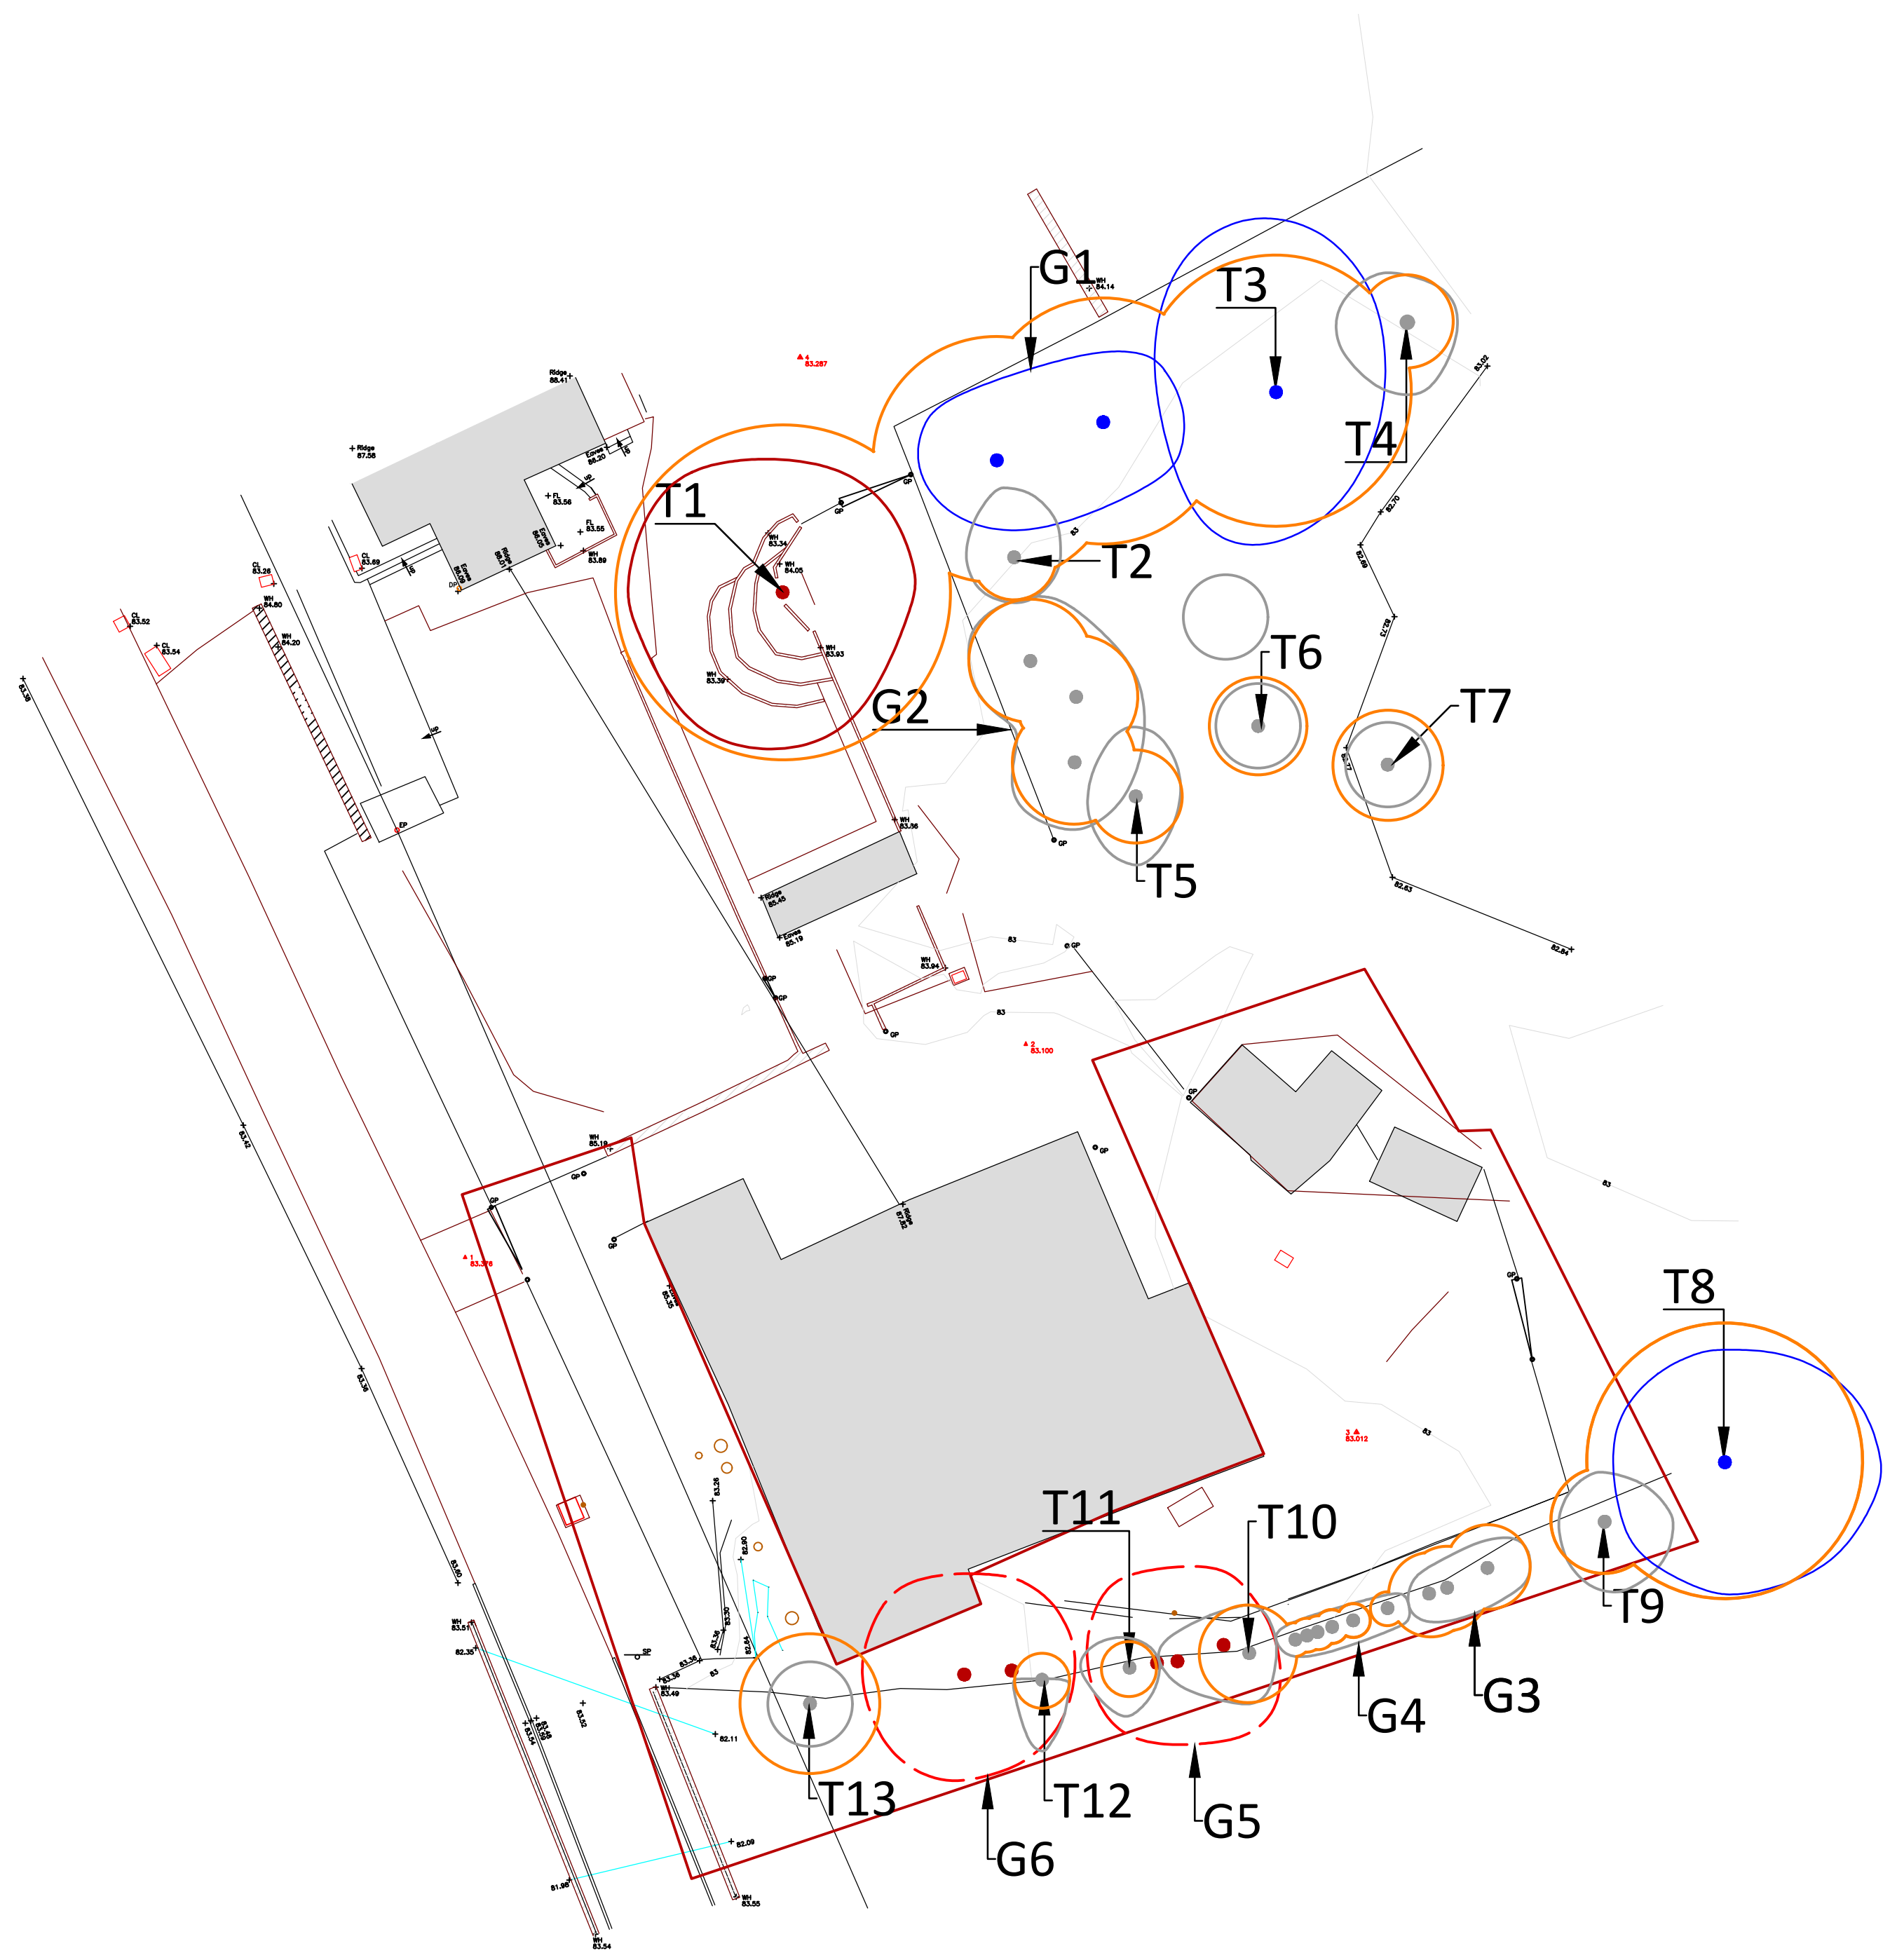

This drawing is solely for planning purposes. Do not scale from this drawing. Please check all dimensions on site and notify us of any discrepancies. Wotton Tree Consultancy Ltd (WTC) cannot be held responsible for any discrepancies or inaccuracies in the topographical plan upon which this drawing is based. © Wotton Tree Consultancy Ltd 2025. This drawing is copyright and cannot be used or altered without the express permission of WTC Ltd. This drawing is designed to reflect only the principles of layout and/or design insofar as these relate to the protection of trees to be retained and should NOT be read as a definitive engineering or construction method statement. Reference should be made to the architect or engineer as appropriate over any matters of construction detail or specification or any engineering standards or regulatory requirements relating to proposed structures, hard surfaces or underground structures.

Key

Tree for removal

Retained tree

Root Protection Area

Retention Categories

A High quality

B Moderate quality

C Low quality

U Unsuitable for retention

Project

Windrush
High Road
Ashton Keynes




Title

Tree retention/
removal Plan

		Rev	Rev date
Drg No	WTC_1596.04		
Scale @A2	1:250	Drn by	PD
Date	Nov 2025	App	

APPENDIX 4: Tree protection plan

WTC_1596.04

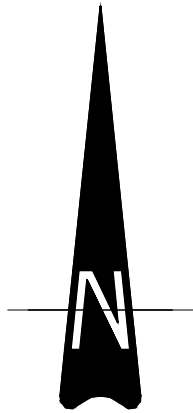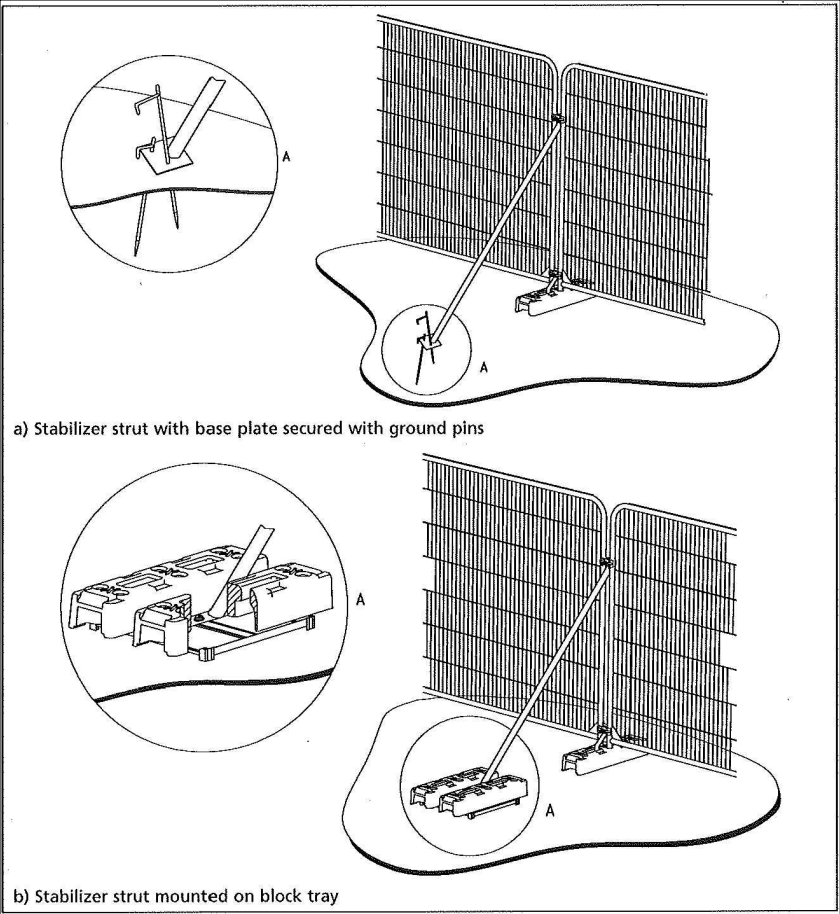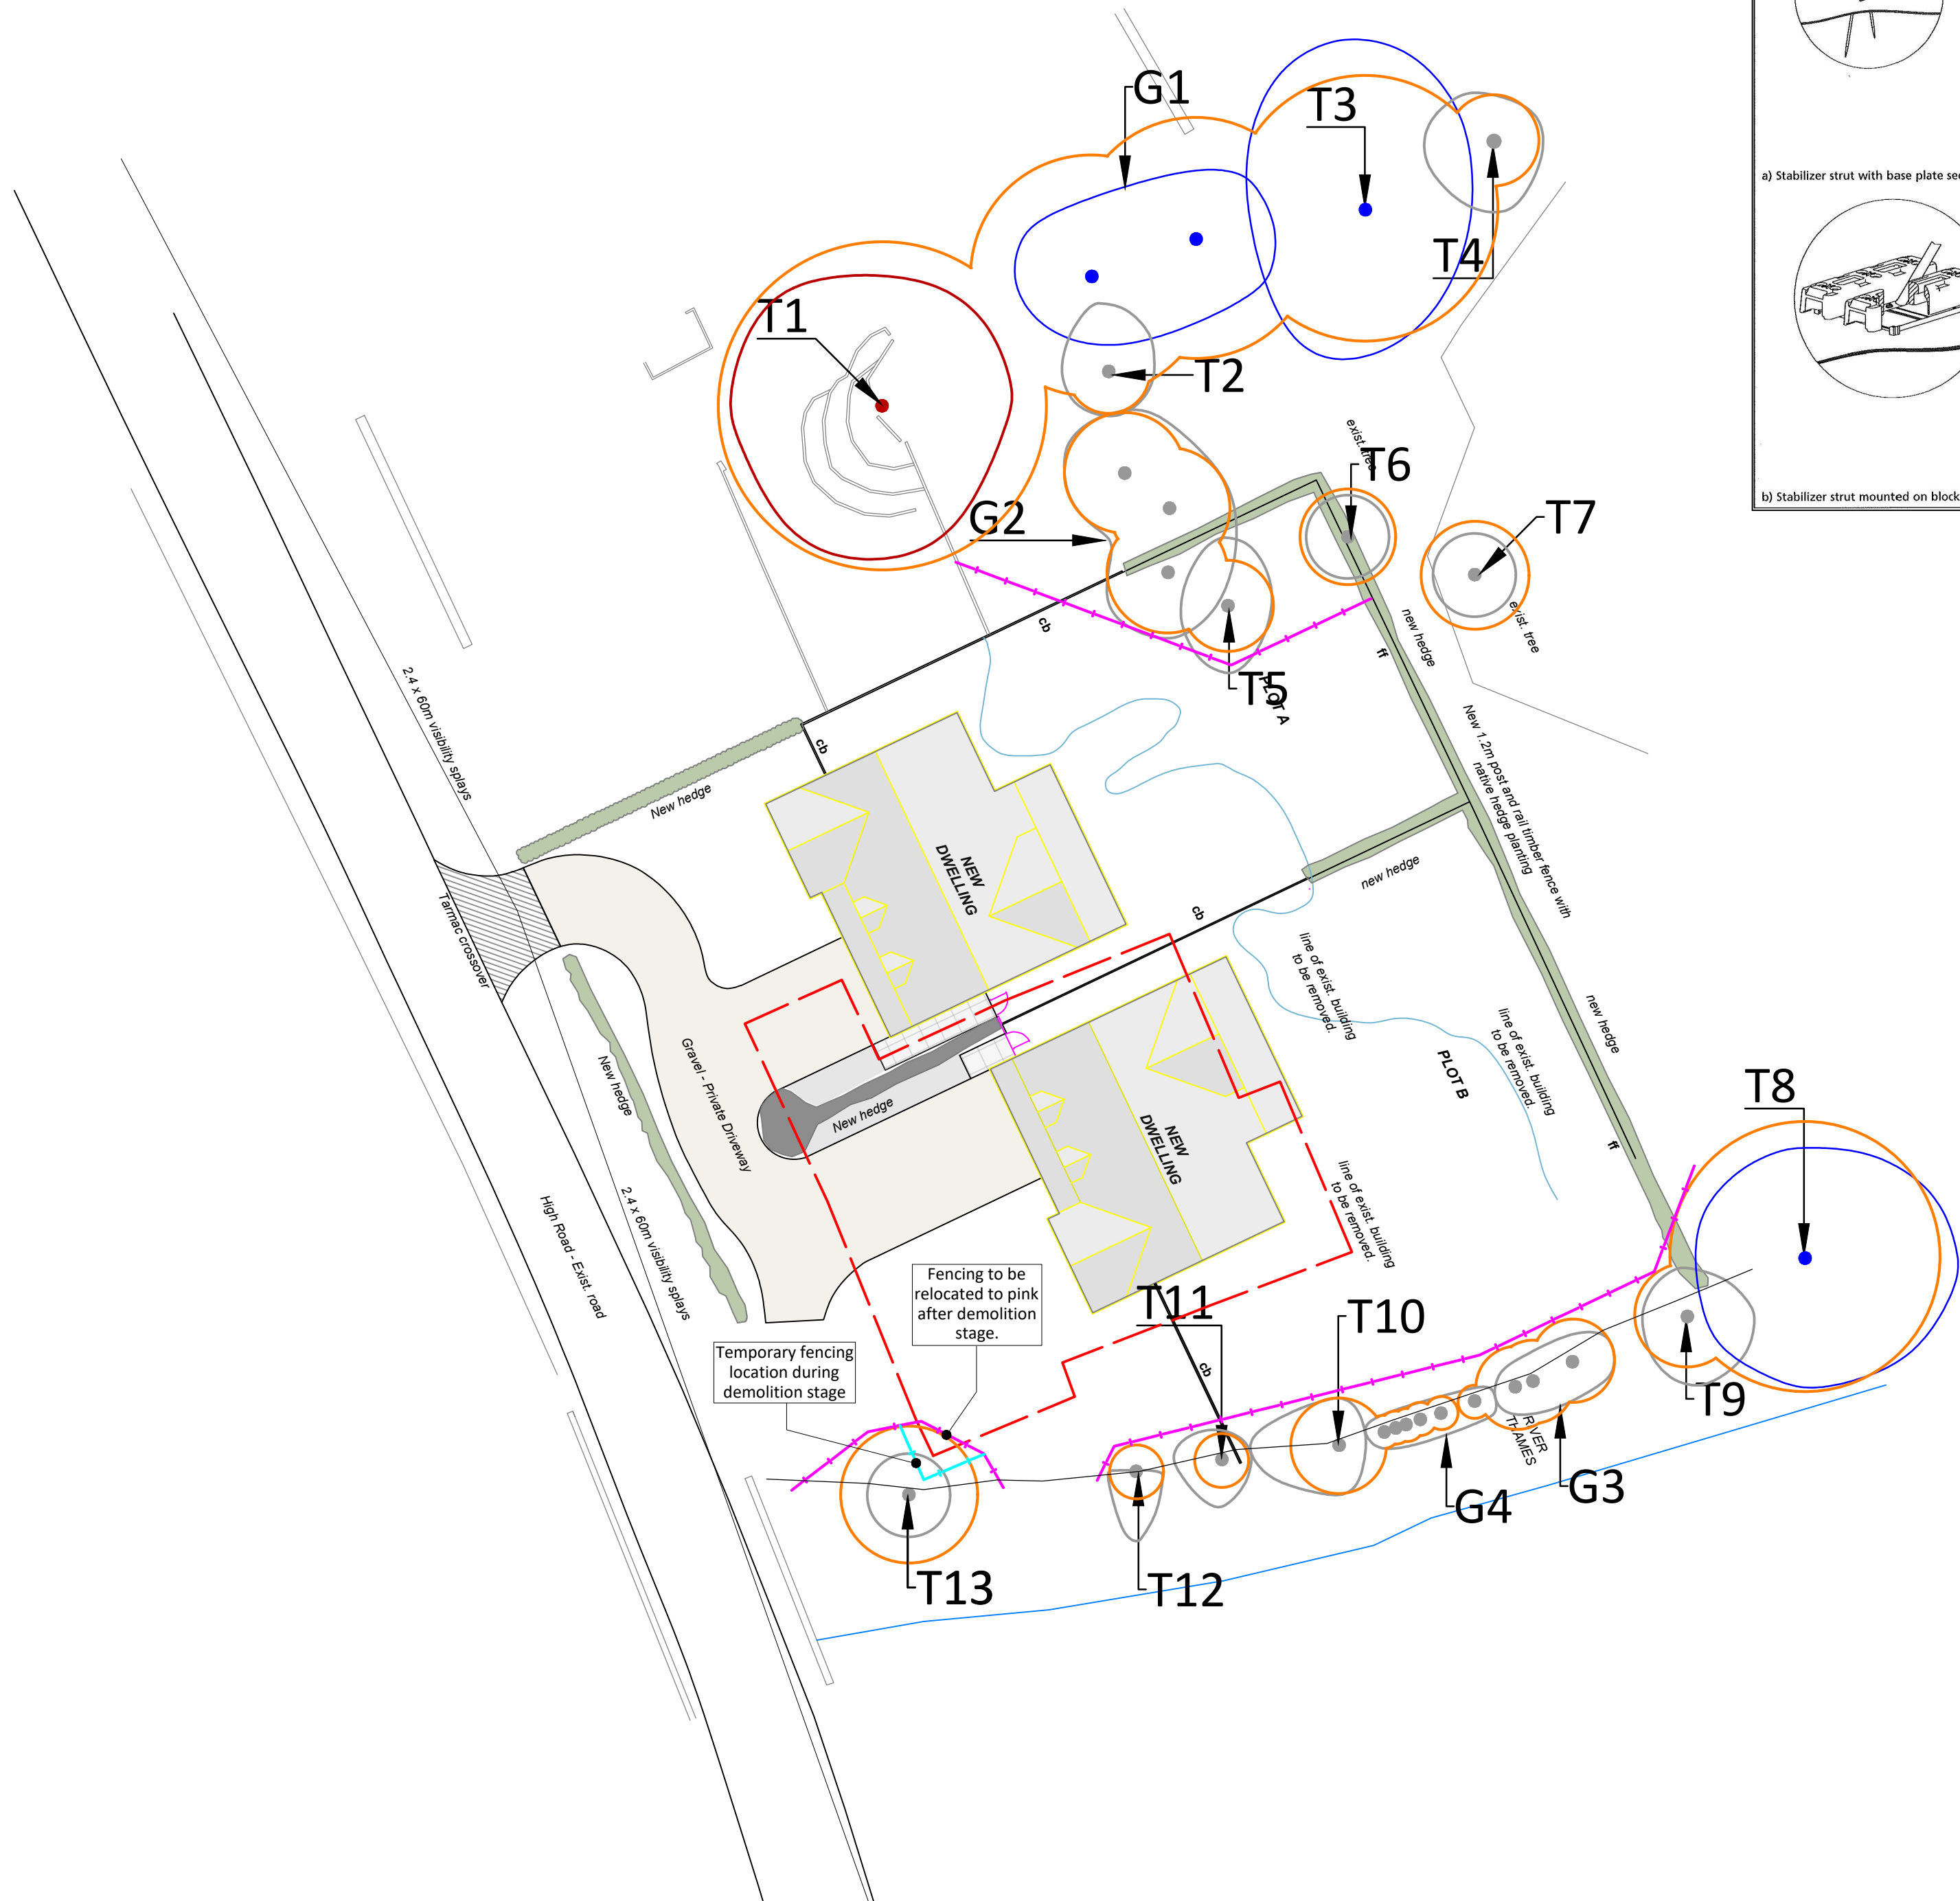

This drawing is solely for planning purposes. Do not scale from this drawing. Please check all dimensions on site and notify us of any discrepancies. Wotton Tree Consultancy Ltd (WTC) cannot be held responsible for any discrepancies or inaccuracies in the topographical plan upon which this drawing is based.
© Wotton Tree Consultancy Ltd 2025.
This drawing is copyright and cannot be used or altered without the express permission of WTC Ltd. This drawing is designed to reflect only the principles of layout and/or design insofar as these relate to the protection of trees to be retained and should NOT be read as a definitive engineering or construction method statement. Reference should be made to the architect or engineer as appropriate over any matters of construction detail or specification or any engineering standards or regulatory requirements relating to proposed structures, hard surfaces or underground structures.

Key

- Tree/group canopy
- Root Protection Area
- Protective fencing
- Protective fencing during demolition stage

Retention Categories

- A High quality
- B Moderate quality
- C Low quality
- U Unsuitable for retention

Project


Windrush
High Road
Ashton Keynes

Title

Tree Protection
Plan

		Rev	Rev date
Drg No	WTC_1596.04		
Scale @A2	1:250	Drn by	PD
Date	Nov 2025	App	

APPENDIX 5: Tree protection fencing (source: BS5837:2012)

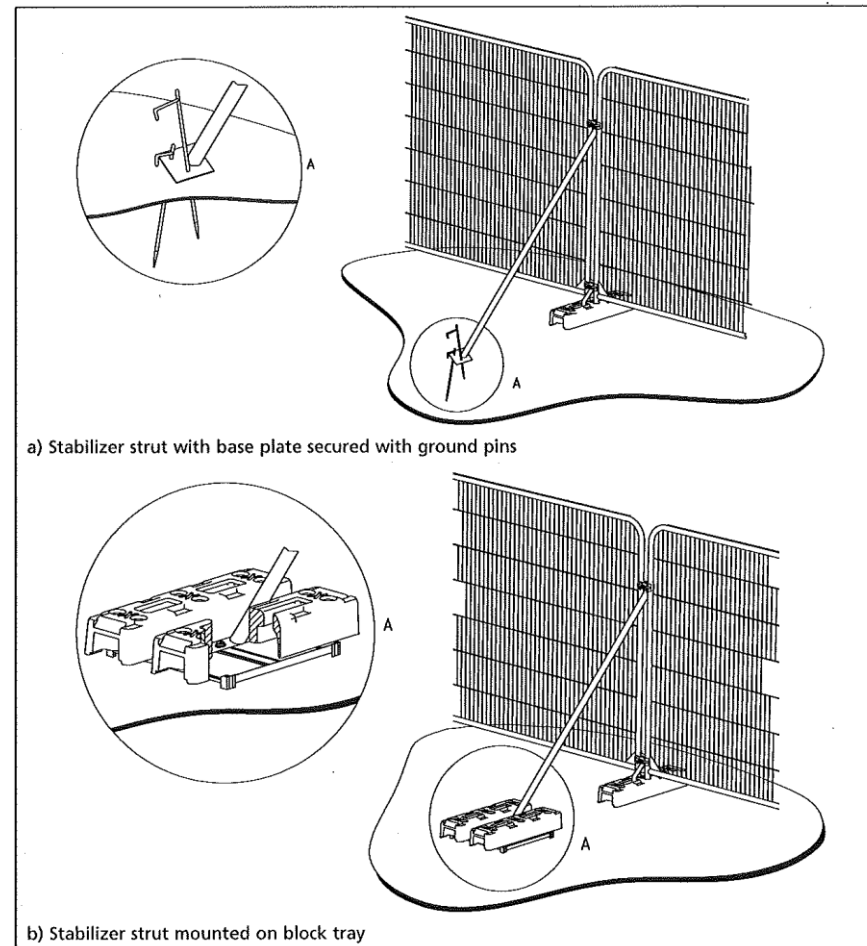

APPENDIX 6: Tree protection fencing signs



References

BSI Standards Publication (2012) BS5837 *Trees in relation to design, demolition and construction – Recommendations* BSI: London

BSI Standards Publication (2010) BS3998 *Tree Works – Recommendations* BSI: London

Lonsdale, D (1999) *Principles of Tree Hazard Assessment and Management*, TSO: London

Matheny, N.P & Clark, J.R (1994) *Evaluation of Hazard Trees in Urban Areas* 2nd Ed
ISA Illinois

Mattheck, C & Breloer, H (2003) *The Body language of Trees*, TSO: London

Read, H (2000) *Veteran Trees: A guide to good management*, English Nature: London

Strouts, R.G & Winter, T.G (2004) *Diagnosis of Ill-Health in Trees*, TSO: London

Wotton Tree Consultancy

24 Haw Street
Wotton-under-Edge
Gloucestershire

07835 444 675
info@wtreec.co.uk

