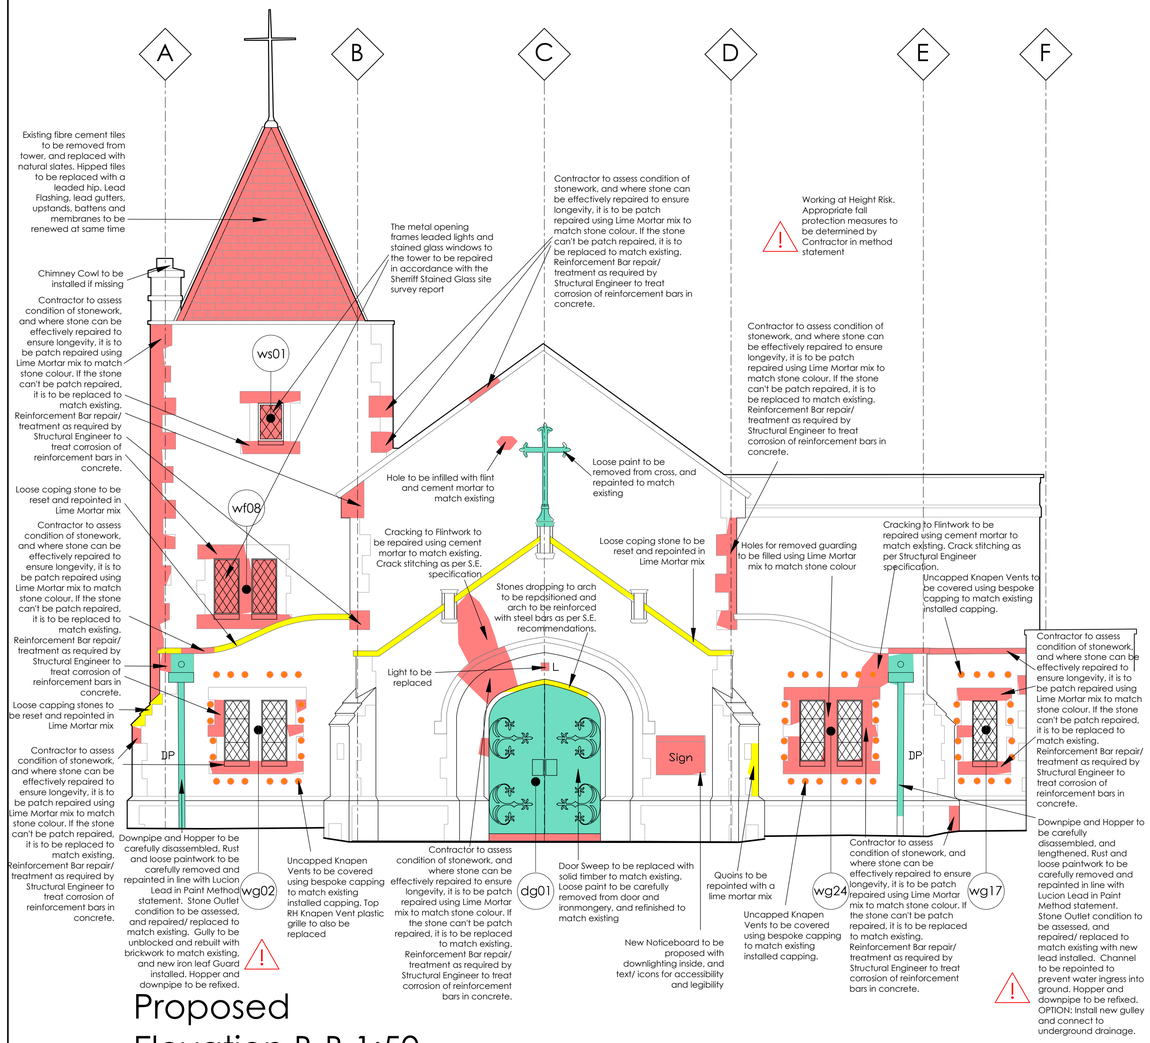

Proposed Elevation B-B 1:50

0 Metres 1 2 3

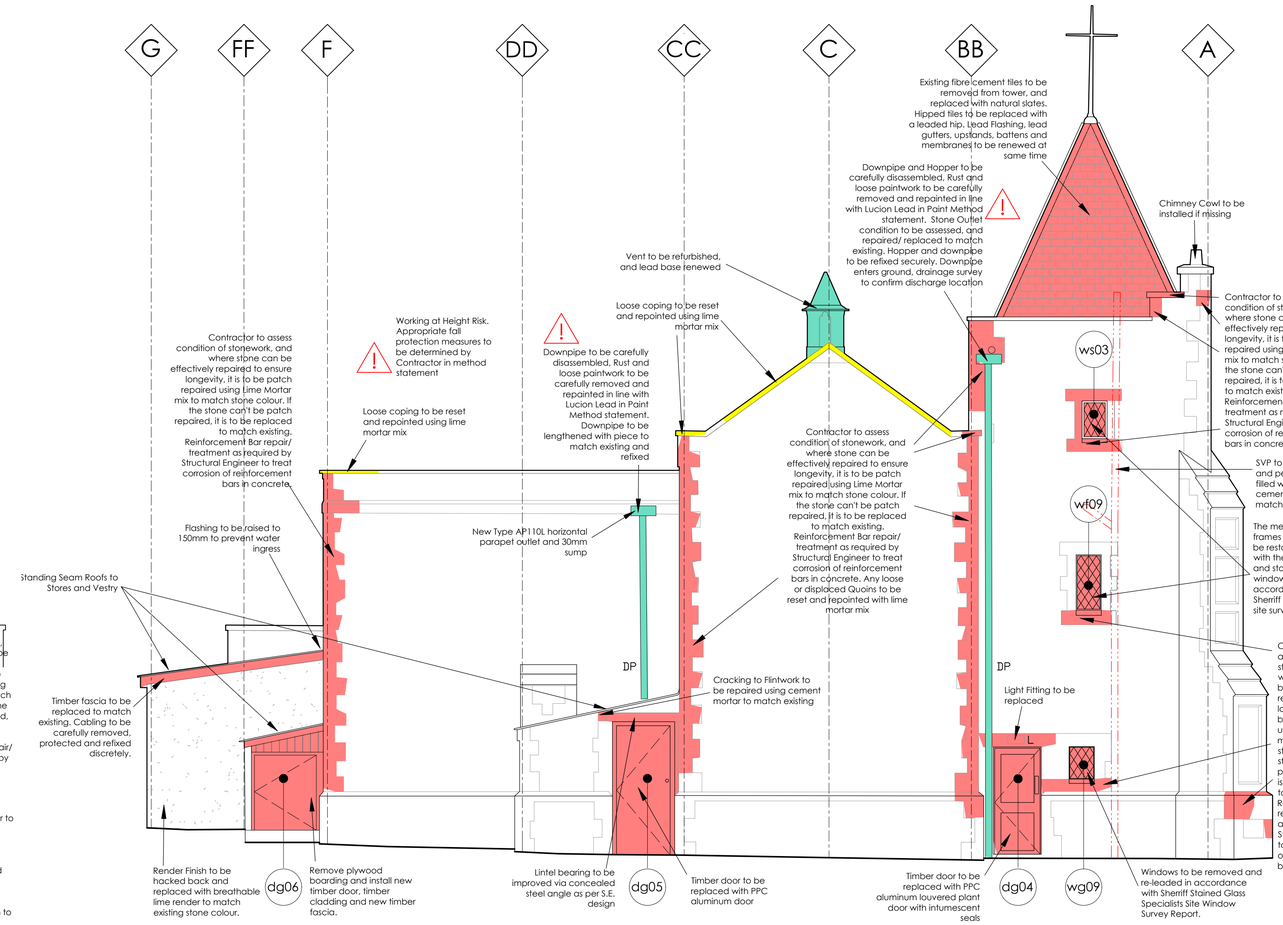

Proposed Elevation D-D 1:50

0 Metres 1 2 3

Elevation Works Key

- Degraded Finishes to be refurbished
- Building Fabric to be repaired/ patched, or replaced to match existing if repair is not possible
- Loose Stonework to be reset and repointed
- Asbestos (Refer to Lucion Asbestos Remedial Specification)
- Proposed New Fabric
- Knapen Vent to be capped

NOTES

1. Responsibility is not accepted for errors made by others in scaling from this drawing. All construction information should be taken from figured dimensions only and checked on site. Drawings based on topographical survey undertaken by Stanbury's. Surrounding roads shown indicatively only and are outside of the extents of the measured survey.

2. Any discrepancies and/or changes in design that affect Planning and Building Regulation approvals are to be reported to the Architect.

3. Copyright. All designs and information conveyed are the intellectual property of Della Valle Architects Ltd. The unauthorised copying, usage or distribution of this drawing or contents, in part or whole is forbidden without express permission.

4. All drawings should be read in conjunction with Structural Engineer designs, MEPH designs, Fire Engineer drawings, and any other relevant information.

5. The drawings indicate the extent of defects identified in the Quinquennial Inspection and other specialist reports. Visual inspection of building undertaken from ground level only, with the assistance of drone survey photographs from 05.05.2023 - 25.04.2024. The information provided is based on the available data and access, and is subject to a review on site by the contractor.

6. Refer to Lucion Asbestos reports and Lead Testing reports for any information in relation to the prescence of asbestos and lead.

General Works

- All damaged dressed stonework to be assessed by the contractor/ stone mason to determine if it can be patch repaired using lime mortar, or if it requires replacement. The Lime Mortar mix for repairs to dressed stonework is to be determined by the Contractor through consultation with The Lime Centre. The mix is to be agreed with ADSL, Wiltshire Council and the SHHC. The Compatibility of the Lime Mortar mix with the existing flint and cement mortar is to be assessed and confirmed by a specialist. Replacement stonework is to be matched to the existing (Quarry and stone to be agreed with ADSL).

- Mismatched colour cement pointing to be carefully removed to dressed stonework throughout. The Lime Mortar mix for repointing to dressed stonework is to be determined by the Contractor through consultation with The Lime techniques. The mix is to be agreed with ADSL, Wiltshire Council and the SHHC. The Compatibility of the Lime Mortar mix with the existing flint and cement mortar is to be assessed and confirmed by a specialist.

- Dark Staining to dressed sloping stone sills on windows, and under parapets to be removed using laser abrasion

- Moss build-up to buttress capping stones to be carefully removed

- Asbestos Sealant to all upper windows and two of the lower windows to be removed in accordance with Lucion Remedial Works Specification.

- Knapen Vents to be capped using fabricated lead caps to match existing

- Lead present in the paint to grey cast iron rainwater goods. The concentration of lead in the rainwater goods is higher than that permitted in domestic materials and for the general public as noted in Lucion's Lead in Paint Testing Report. A risk assessment and other precautions as detailed in the Lucion report should be carried out.

- Battens, membranes and Lead Flashings to be renewed throughout when roofs are replaced. Roof structure to be assessed, treated and only replaced where essential, with traditional jointing tehcniques.

- Stained glass windows will be repaired following asbestos removal works in line with the site window survey report 2023 by Sherriff stained glass specialist, by a suitably qualified professional

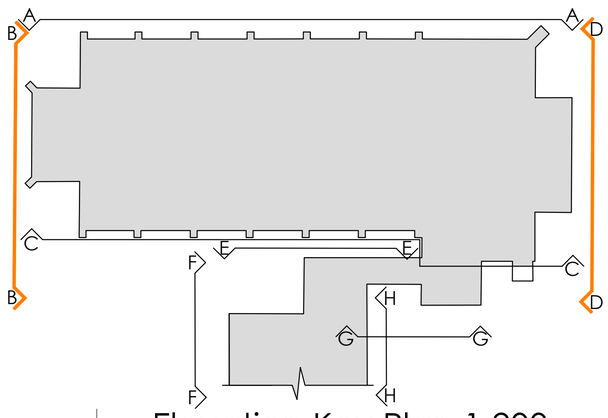

Elevation Key Plan 1:200

0 Metres 2 4 6 8 10

PROPOSED

Revisions.
B - Stage 3 drawing update
C- Coordination and Amendments
D - Coordination
E - Stained Glass Survey Update

Della Valle architects
Lake View • Charlton Estate • Shepton Mallet • BA4 5QE
T 01749 330672 • E mail@dellavallearchitects.co.uk
Chartered Architect • Designer • Project Manager

Client	Aspire Defence Services Ltd
Job	Proposed Works to the Garrison Church of St Patricks & St George, Tidworth.
Ref	AT 0 083
Job	F1870
Title	Proposed Elevations B-B, D-D
Scale	1:50 @A1
Date	August 2025
Drawn	WT
Drg No	F1870/107/E