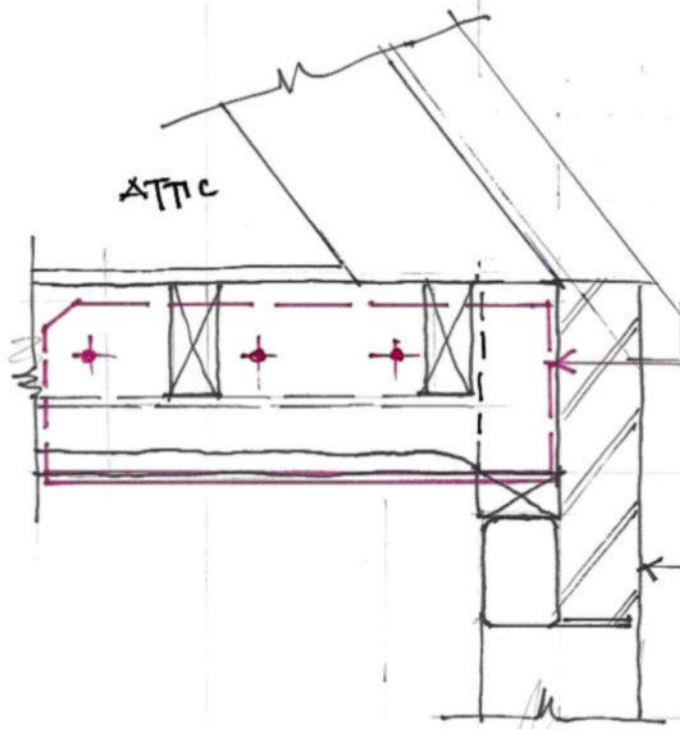


JOB TITLE


47, BLUE BOAR ROW
SALISBURY

DRG. TITLE

REPAIR DETAIL.
REAR WALL SECTION

EXT^g TRUSS CHORD
STRENGTHENED WITH
STEEL FLITCH IF BEARING
DELAYED.
10 PLT - FABRICATION.

WALL REBUILT - NEW
LINTELS TO SUIT. ORIG
ARCHES RE-FORMED.

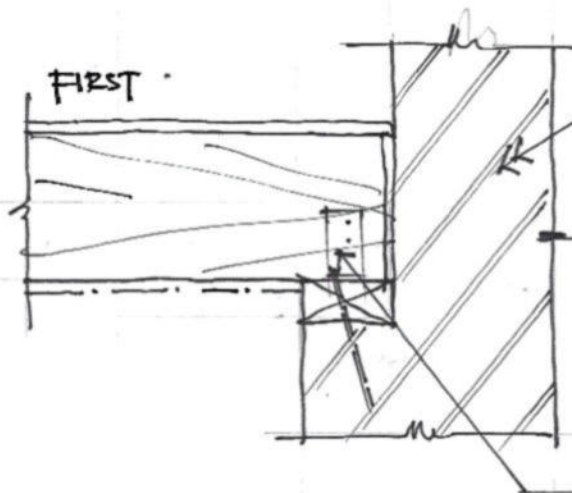

FLOOR TIED IN TO
RESTRAIN WALL. FIX
JOISTS TO PLT + BRICK

EXT^g WALL LOCALLY
RE-BUILT & REPAIRED.
LIME MORTAR THR'OUT.

FLOOR JOISTS REPLACED
LIKE FOR LIKE IN LAST
BAY, OR AUGMENT WITH
NEW. REPLACE PLT.

SECTION - NORTH WALL
1:10

NB - EXACT BRICK DIMS ETC
SITE DETERMINED WHEN
EXPOSED.

SCALE
1:10

DATE
APR' 25

BY
AW

DRG. NO

14084.D03

REV.

REV

DATE

REVISIONS

CHK