


Typical Masonry Crack Stitching Repair Detail

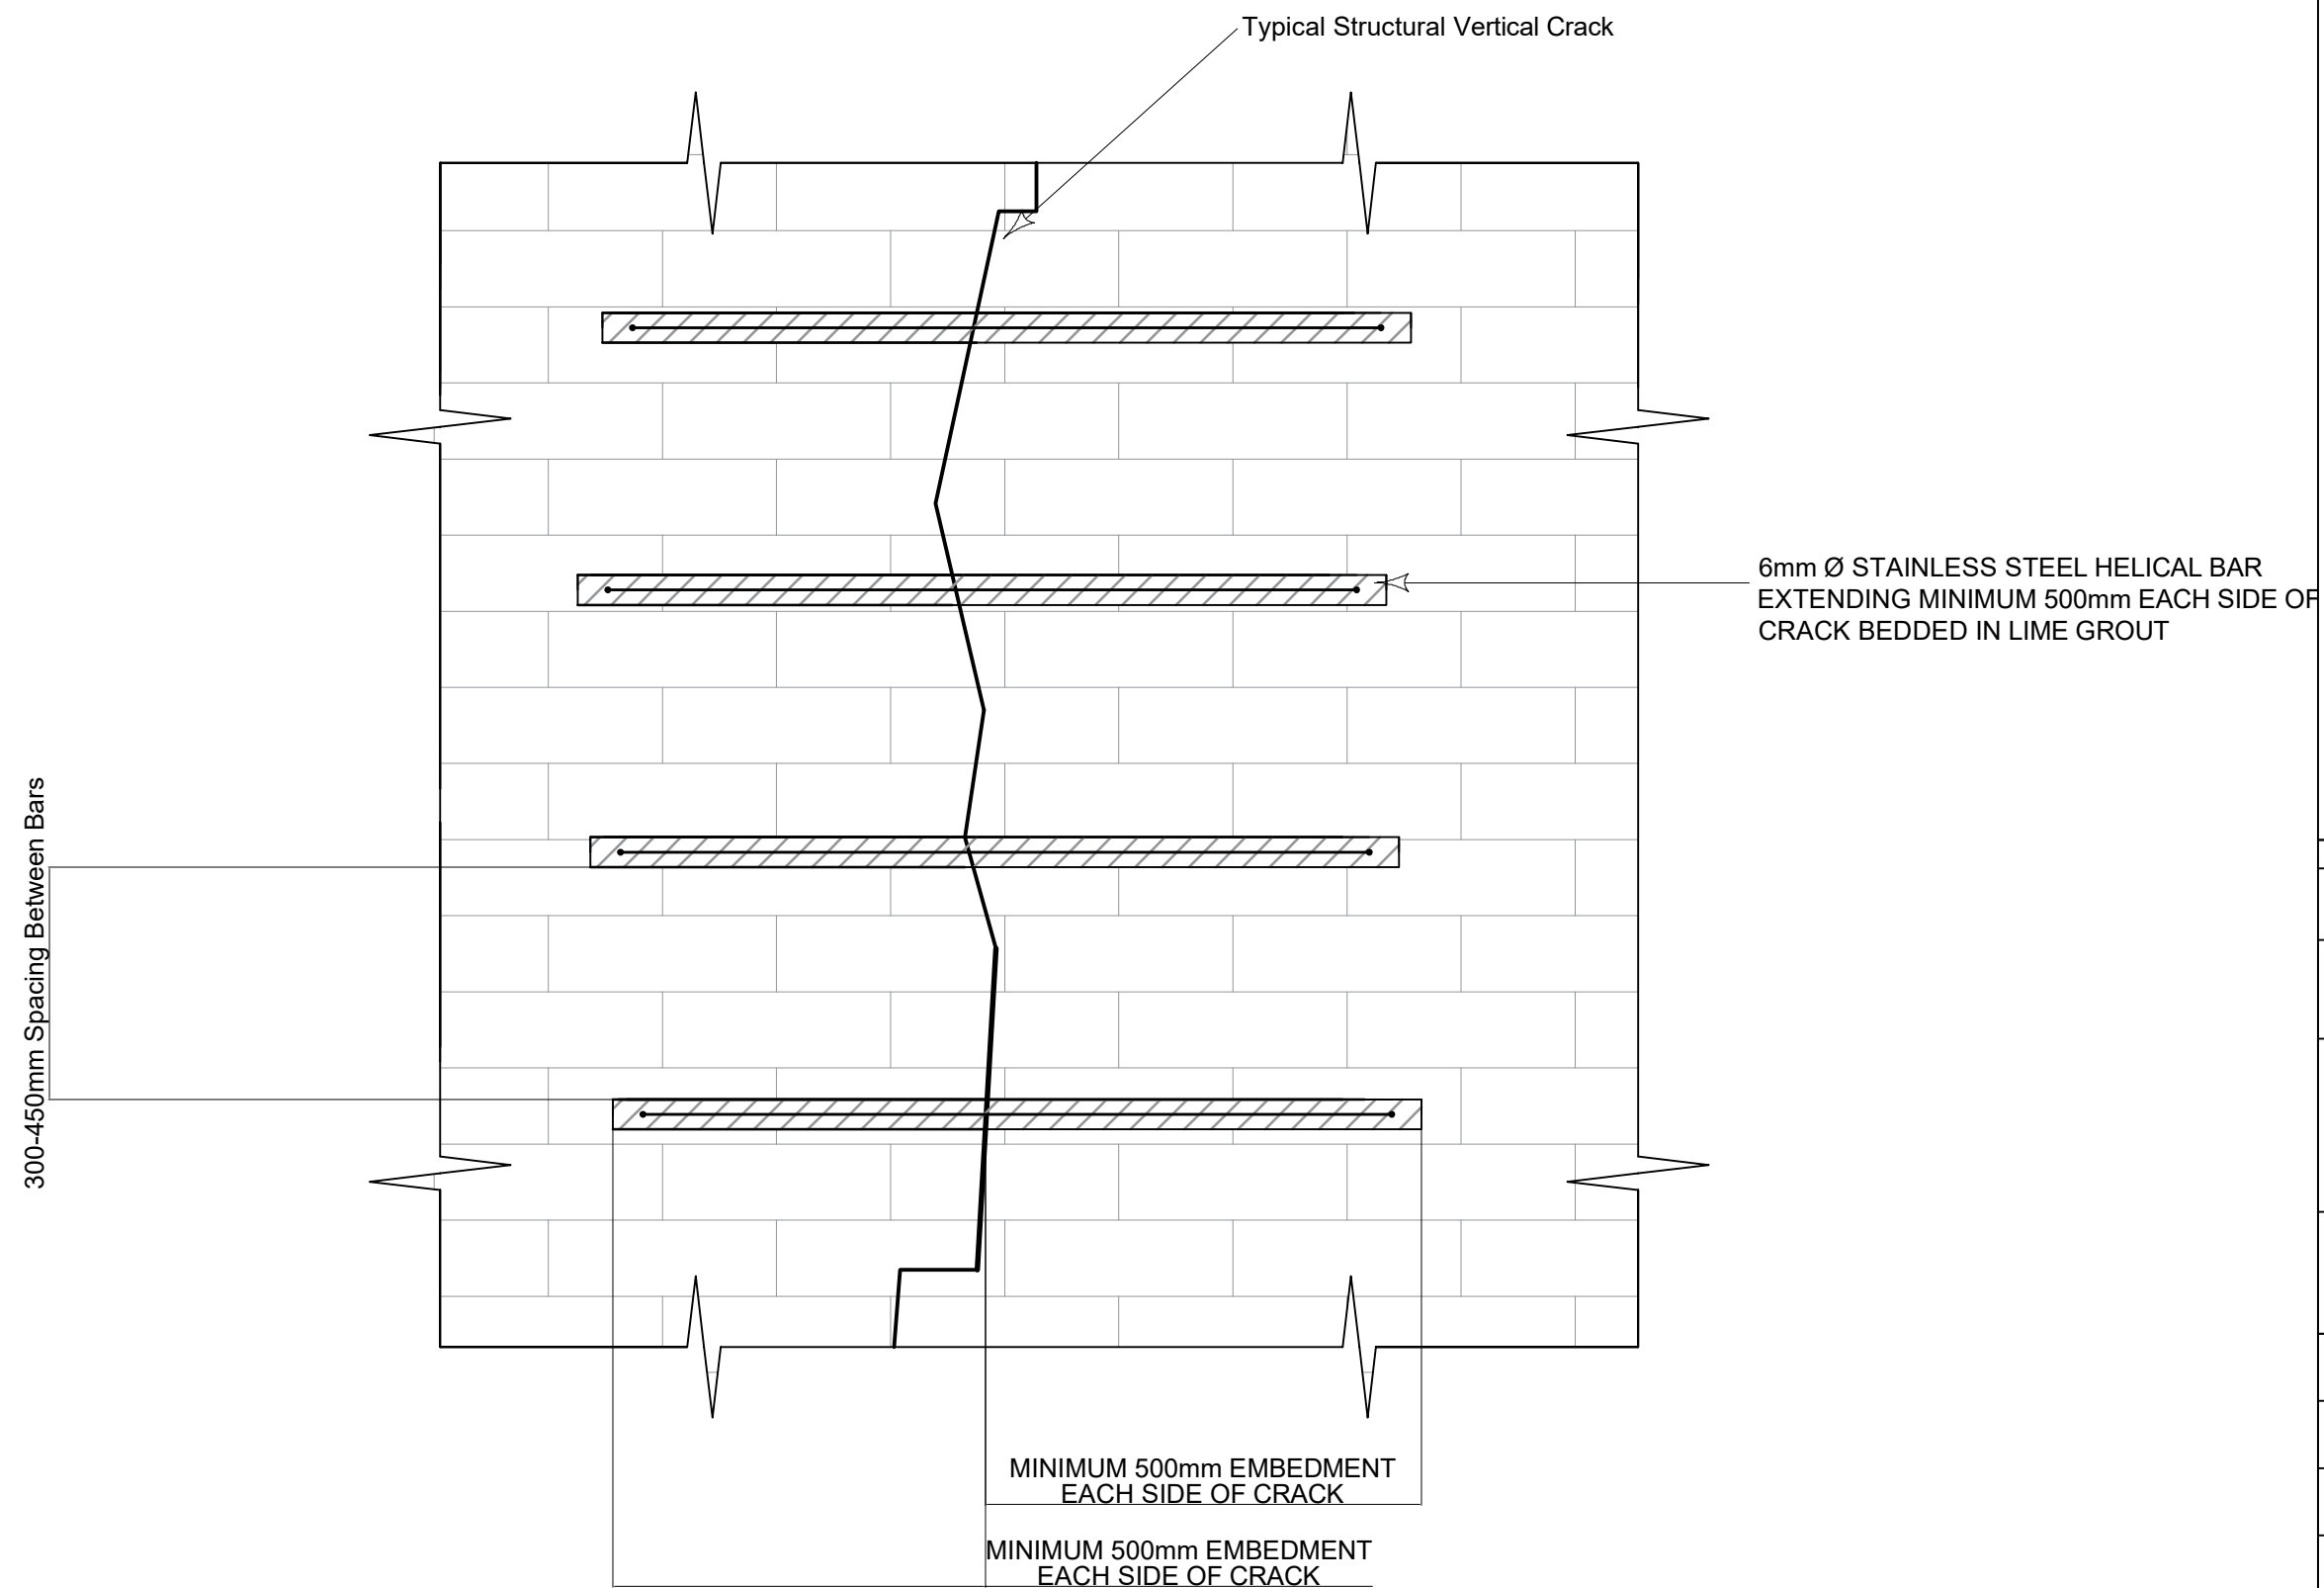

GENERAL NOTES

- All works to be carried out by a competent contractor experienced in historic building repair.
- Existing structural cracks to be stitched using 6mm Ø stainless steel helical bars installed within existing mortar bed joints.
- Helical bars to extend a minimum of 500mm each side of the crack unless otherwise specified.
- Bars to be installed at approximately 300–450mm vertical centres.
- Mortar joints to be raked out to approximately 30–40mm depth to receive stitching bars.
- Helical bars to be bedded in lime-based grout.
- All disturbed joints to be repointed in lime mortar to match the existing.
- Installation to be within existing mortar joints where possible to avoid cutting historic brickwork.

Rev	Date	Amendments
1	13/03/26	

Client: Salisbury City Council

Project: Salisbury Guildhall Conservation Works

Drawing Title: Typical Crack Stitching Detail

Date: 16/03/2026	
Drawing No.: 1	
Scale: N/A	
Drawn by: LM	

Jellicoe House, Tel: +44 23 8021 3500
Grange Drive,
Southampton, SO30 2AF
United Kingdom www.curriebrown.com