

Tree Survey & Arboricultural Impact Assessment

Tisbury Motors, High Street, Tisbury SP3 6HF

August 2026 V2.0



Report Name: Tree Survey and Arboricultural Impact Assessment

Reference: 26/07/178/NH

Author: Nicholas Hellis, Arboricultural Consultant

Prepared for: Tisbury Motors

On the instructions of: Andrea Seres
Architectural Designer
Historic Building Advisory Service
Ladysmith House
High Street
Tisbury SP3 6LD

Office telephone no.: 01747 870 772

Email: a.seres@historicbuilding.co.uk

HELLIS Solutions Ltd
Office: 01823 807 766
Email: hello@hellis.biz
Website: www.hellis.biz



Summary

This is a tree survey and arboricultural impact assessment.

The report has been written following the recommendations and guidance given within British Standard 5837:2012 Trees in relation to design, demolition and construction.

The proposed development is the demolition of the garage, flat and workshop with the erection of seven houses and associated gardens over the plot.

I have inspected all the trees of material consideration within and immediately adjacent to the proposed development site. These trees are listed at Appendix 1 as T1 and annotated on the Tree Constraints Plan at Appendix 4.

The site lies within the Tisbury Conservation Area.

Care must be taken to avoid misplaced tree retention; attempts to retain too many or unsuitable trees on a site can result in excessive pressure on the trees during demolition or construction work, or post-completion demands for their removal.

T1 is growing on a raised border and immediately adjacent to a retaining stone wall.

Leyland cypress are fast growing conifers often increasing in height by 60cm to 90cm a year, with the potential to reach 40.0m in height.

In the absence of development it is reasonably likely and foreseeable that T1 will cause structural damage to the immediately adjacent retaining stone walls.

In brief, T1 is the wrong tree in the wrong place and unsuitable for retention regardless of development.

Nicholas Hellis MArborA

Contents

1.0	Instructions.....	3
2.0	Report Limitations	3
3.0	Introduction	3
4.0	Report Rationale	4
5.0	Site Survey	4
6.0	Tree Survey	5
7.0	Tree Constraints and Considerations.....	5
8.0	Arboricultural Impact Assessment.....	8
9.0	Tree Management	10
10.0	Useful Contact Details.....	10
	Appendix 1 - Tree Survey and Tree Quality Assessment.....	i
	Appendix 2 - Cascade Chart for Tree Quality Assessment	iv
	Appendix 3 - Site Photographs	vi
	Appendix 4 - Tree Constraints Plan	viii

1.0 Instructions

- 1.1 I have been instructed in writing by Andrea Seres of Historic Building Advisory Service to prepare a tree report on behalf of Tisbury Motors Ltd to assess the influence that the trees on and adjacent to the site may have on any proposed development and vice versa.
- 1.2 The proposed development is the demolition of the garage, flat and workshop with the erection of seven houses and associated gardens over the plot.

2.0 Report Limitations

- 2.1 Trees are living organisms whose health and overall condition can change rapidly. The conclusions and recommendations contained within this report are valid for a period of three years from the date of the tree survey. The period of validity may be reduced if significant changes occur to either the trees or to the landscape within the immediate proximity of the trees.
- 2.2 This report is neither intended nor suitable for any purpose other than the stated rationale at section 4.0.

3.0 Introduction

- 3.1 The report has been written following the recommendations and guidance given within British Standard 5837:2012 Trees in relation to design, demolition and construction - Recommendations (hereinafter BS:5837).
- 3.2 BS:5837 provides 'recommendations and guidance for arboriculturists, architects, builders, engineers, landscape architects and all others interested in harmony between trees and development in its broadest sense.'
- 3.3 BS:5837 also provides 'recommendations and guidance on the relationship between trees and design, demolition and construction processes', and 'it sets out the principles and procedures to be applied to achieve a harmonious and sustainable relationship between trees and structures.'
- 3.4 The report is intentionally concise with minimal background explanations. Where appropriate, further guidance and information is included as appendices.

3.5 The report contains the following appendices:

- a) a tree survey and a tree quality assessment at Appendix 1.
- b) a cascade chart for tree quality assessment at Appendix 2.
- c) site photographs at Appendix 3; and
- d) a scale drawing showing existing site features and the proposed development. This drawing has been amended to show tree quality assessment, root protection areas and shadow patterns, as appropriate and should be read in conjunction with this report at Appendix 4.

4.0 Report Rationale

4.1 The following rationale underlies this report:

- a) to identify the quality and value (in a non-fiscal sense) of the existing tree stock within the context of proposed development, allowing informed decisions to be made concerning which trees should be removed or retained in the event of development occurring.
- b) to identify the constraints and considerations, both above and below ground, associated with retained trees in the context of proposed development. However, care should be taken to avoid misplaced tree retention; attempts to retain too many or unsuitable trees on a site can result in excessive pressure on the trees during demolition or construction work, or post-completion demands for their removal; and
- c) to prepare an arboricultural impact assessment that evaluates the direct and indirect effects of the proposed design and where necessary recommends mitigation.

5.0 Site Survey

5.1 The site survey included within the Tree Plan at Appendix 4 contains:

- a) the location of all trees, shrub masses, hedges etc. of material consideration.
- b) other relevant features, such as buildings, other structures, and boundary features.
- c) the approximate location of trees on land adjacent to the development site that might influence the site or might be important as part of the local landscape character.

6.0 Tree Survey

- 6.1 The tree survey and tree quality assessment were carried out on the morning of Wednesday 5th August 2026.
- 6.2 The tree survey includes the trees or hedges on the proposed development site and the trees or hedges immediately adjacent to the proposed development site that could influence the development or might be important as part of the local landscape character with a stem diameter of 150mm or greater.
- 6.3 The trees and hedges surveyed are identified on the Tree Plan by an alphabetical letter and a sequential reference number. Individual trees surveyed are identified by the letter T, cohesive groups of trees are identified by the letter G, woodlands are identified by the letter W and hedges/hedgerows are identified by the letter H.
- 6.4 The quality and value of existing trees and hedges are allocated to one of four categories, namely A, B, C or U (Unsuitable for retention). The category allocated to each tree depends in part upon the information gathered in the tree survey at Appendix 1 and in part upon the 'cascade chart for tree quality assessment' at Appendix 2. It is also in part, subjective.

The trees have been differentiated on the Tree Plan by the colour and shape of the symbol allocated to each category, please see Appendix 2.

Categories A, B and C are further qualified by one or more of the three subcategories namely 1, 2 and 3. Subcategories 1, 2 and 3 reflect the arboricultural quality, the landscape quality, and cultural value of each tree or hedge, respectively.

7.0 Tree Constraints and Considerations

The purpose of this section is to identify the constraints and considerations, both above and below ground, associated with retained trees in the context of proposed development.

7.1 to 7.9 inclusive set out the **general principles** of tree constraints and considerations associated with a proposed development site.

7.10 to 7.17 inclusive set out the tree constraints and considerations associated with **this specific site**.

General Principles

- 7.1 In order to avoid damage to the roots or rooting environment of retained trees, the Root Protection Area (RPA) is plotted around category A and B trees as necessary to illustrate potential constraints to the proposed development. This area should be left undisturbed. However, where construction is proposed within the root protection area, technical solutions may be available to enable the successful retention of trees.
- 7.2 To maximize the probability of successful tree retention a realistic assessment of the probable impact of any proposed development on the trees and vice versa should take into account the characteristics and condition of retained trees, with due allowance and space permitted for their future growth and maintenance requirements.
- 7.3 The relationship of buildings to large trees can cause apprehension to occupiers or users of nearby buildings or spaces. Buildings and other structures should be sited allowing adequate room for retained trees, and with due allowance and space permitted for their future growth.
- 7.4 Buildings and open spaces should be designed with due consideration to the proximity of retained trees, especially in terms of the foliage, flowers, fruit, and other debris associated with the normal functions of a healthy tree.
- 7.5 Tree preservation orders, conservation areas, heritage trees, heritage landscapes, or other regulatory tree protection.
- 7.6 The access and working area required to enable the construction of the proposed development, including the effects of pruning on the amenity value of retained trees.
- 7.7 The protection of overhanging tree canopies where they could be damaged by construction.
- 7.8 The requirements of infrastructure including above and below ground services, visibility splays, refuse stores, lighting, signage, solar collectors, satellite dishes and CCTV sightlines.
- 7.9 The potential for new planting to mitigate proposed tree loss.

This Specific Site

- 7.10 The radius of the root protection areas of all trees, shrub masses, hedges etc. identified within the tree survey are given in the right-hand column of the survey at Appendix 1.

- 7.11 The site lies within the designated Tisbury Conservation Area; there are no Tree Preservation Orders in effect either on, or immediately adjacent to the site.

Reference: <https://www.wiltshire.gov.uk/planning-trees>

There are no ancient or veteran trees on, or immediately adjacent to the site.

Reference: <https://ati.woodlandtrust.org.uk/>

The site is not an ancient woodland or a distinct form of ancient woodland such as a wood pasture or historic parkland.

Reference: <https://magic.defra.gov.uk/>

The site is not a priority habitat and there are no priority habitats immediately adjacent to the site.

Reference: <https://magic.defra.gov.uk/>

The site is not included on the National Heritage List for England (NHLE) for registered parks and gardens, and battlefields

Reference: <https://historicengland.org.uk/>

The above websites were referenced on Friday 31st July 2026.

8.0 Arboricultural Impact Assessment

The purpose of this arboricultural impact assessment is to consider the direct and indirect effects of the proposed design.

Summary of Impact

- 8.1 I have assessed the impact of the proposed development on the trees, shrubs, and woody vegetation (trees) of material consideration, present on and immediately adjacent to the site. All the trees that may be directly affected by the development are listed in Table 1 below.

Table 1 - Summary of trees that will or may be affected by the proposed development

	Category A Trees	Category B Trees	Category C Trees	Category U Trees
Trees to be retained	-	-	-	-
Trees to be removed	-	-	T1	-
Retained trees that will or may need to be pruned to enable construction	-	-	-	-
Retained trees that will be affected by construction (e.g. foundations, services, hard surfacing) within the root protection area	-	-	-	-
Retained trees that may be affected by construction activity (e.g. access, storage of materials, landscaping) within the root protection area	-	-	-	-

Detail of Impact

- 8.2 Trees to be retained:
- None.

8.3 Trees to be removed:

T1 is growing on a raised border and immediately adjacent to a retaining stone wall.

Leyland cypress are fast growing conifers often increasing in height by 60cm to 90cm a year, with the potential to reach 40.0m in height.

In the absence of development it is reasonably likely and foreseeable that T1 will cause structural damage to the immediately adjacent retaining stone walls.

In brief, T1 is the wrong tree in the wrong place and unsuitable for retention regardless of development.

8.4 Retained trees that will or may need to be pruned to enable construction:

None.

8.5 Retained trees that will or may be adversely affected by development within the root protection area:

None.

9.0 Tree Management

Pre-development tree work

- 9.1 A schedule of tree works, including root pruning, is included within the Tree Survey and Tree Quality Assessment at Appendix 1. Tree works required to enable or facilitate the proposed development are noted within Appendix 1 in **orange** text. Additionally, recommended tree works to manage the existing tree stock are noted in ***blue*** italic text.
- 9.2 All pre-development tree works must be carried out in accordance with British Standard 3998:2010 Tree Works. Recommendations.
- 9.3 Specific wildlife species and their habitats are protected by law. Intentionally or recklessly damaging or destroying them, their nests, roosts, or their habitats is a criminal offence. If works are proposed to a tree where protected species reside, or the tree forms a habitat for protected species, the appropriate advisory body should be consulted e.g. Natural England, Bat Conservation Trust etc.

Post-development management for existing trees

- 9.4 None.

10.0 Useful Contact Details

- 10.1 Useful contact details:

Nick Hellis	Arboricultural Consultant	01823 807 766 nick.hellis@hellis.biz
Tree Team	Planning Wiltshire Council	0300 456 0114 planningtrees@wiltshire.gov.uk
Andrea Seres	Architectural Designer Historic Building Advisory Service	01747 870 772 a.seres@historicbuilding.co.uk

Signed: *Nicholas Hellis*

Dated: *10th August 2026*

Nicholas Hellis MArborA

Appendix 1 - Tree Survey and Tree Quality Assessment

Tree Survey and Tree Quality Assessment

Tree No.	Species	Height (m)	Stem Diameter (mm)	Average Crown Spread NESW (m)	Height of Canopy (m)	Life Stage	Observations Recommendations Management	Contribution in years	Category	RPA radius (m)
T1	Leyland cypress	16.0	1100	6.0	1.8	Young	T1 is growing on a raised border. Leyland cypress are fast growing conifers often increasing in height by 60cm to 90cm a year, with the potential to reach 40.0m in height. In the absence of development it is reasonably likely and foreseeable that T1 will cause structural damage to the immediately adjacent stone walls which form part of the Conservation Area. In brief T1 is the wrong tree in the wrong place and unsuitable for retention regardless of development.	10+	C	13.2

agl: above ground level

#: estimated dimension

tree works required by proposed development are noted in **bold orange** type

recommended tree works to manage the existing tree stock are noted in *bold blue* italic text

T: Individual tree

H: Hedgerow or garden hedge

G: Cohesive group of trees

W: Woodland

Tree survey schedule:

- a) the trees and hedges surveyed are identified on the Tree Plan by an alphabetical letter and a sequential reference number. Individual trees surveyed are identified by the letter T, cohesive groups of trees are identified by the letter G, woodlands are identified by the letter W and hedges/hedgerows are identified by the letter H.
- b) species (common names only).
- c) estimated height in metres.
- d) estimated stem diameter measured in millimetres typically at 1.50 metres above ground level.
- e) estimated branch spread in metres taken at the four cardinal points, as appropriate; (also recorded on the Tree Plan, as appropriate).
- f) height of canopy above an adjacent access, toward the site or ground level as appropriate.
- g) life stage as follows,
 - i. young - a tree in the first third of average life expectancy for species.
 - ii. middle - a tree in the middle third of average life expectancy for species.
 - iii. mature - a tree in the last third of average life expectancy for species.
 - iv. over mature - a mature tree, which by reason of its physical or structural condition, has an estimated remaining contribution of less than 20 years
 - v. ancient and veteran - 'a tree which because of their age, size *and* condition, are of exceptional biodiversity, cultural or heritage value' National Planning Policy Framework.
- h) observations, particularly of structural and/or physiological condition, as appropriate and pertinent to the matter being considered.
- i) management recommendations, as appropriate.
- j) estimated remaining contribution in years e.g. less than 10, 10+, 20+, 40+.
- k) a category is allocated to each tree or group of trees depending in part upon the information gathered in the tree survey, it depends in part upon the 'cascade chart for tree quality assessment' at Appendix 2 and it is in part, subjective; and
- l) root protection area is based on the guidance given within BS: 5837. The radius of the nominal circle as always rounded up to the nearest single stem diameter.

Appendix 2 - Cascade Chart for Tree Quality Assessment

Cascade Chart for Tree Quality Assessment (April 2012)

Category and definition	Criteria (including subcategories where appropriate)			Identification on Plan
Trees unsuitable for retention				
Category U Trees in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years	- Trees that have a serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other category U trees (e.g. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning) - Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline - Trees infected with pathogens of significance to the health and/or safety of other trees nearby, or very low-quality trees suppressing adjacent trees of better quality <i>NOTE: Category U trees can have existing or potential conservation value which it might be desirable to preserve</i>			 DARK RED
Trees to be considered for retention				
	1. Mainly arboricultural qualities	2. Mainly landscape qualities	3. Mainly cultural values, including conservation	Identification on plan
Category A Trees of high quality with an estimated remaining life expectancy of at least 40 years	Trees that are particularly good examples of their species, especially if rare or unusual; or those that are essential components of groups or formal or semi-formal arboricultural features (e.g. the dominant and/or principal trees within an avenue)	Trees, groups or woodlands of particular visual importance as arboricultural and/or landscape features	Trees, groups or woodlands of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood-pasture)	 LIGHT GREEN
Category B Trees of moderate quality with an estimated remaining life expectancy of at least 20 years	Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remediable defects, including unsympathetic past management and storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation	Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider locality	Trees with material conservation or other cultural value	 MID BLUE
Category C Trees of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150 mm	Unremarkable trees of very limited merit or such impaired condition that they do not qualify in higher categories	Trees present in groups or woodlands, but without this conferring on them significantly greater collective landscape value; and/or trees offering low or only temporary/transient landscape benefits	Trees with no material conservation or other cultural value	 GREY

Appendix 3 - Site Photographs

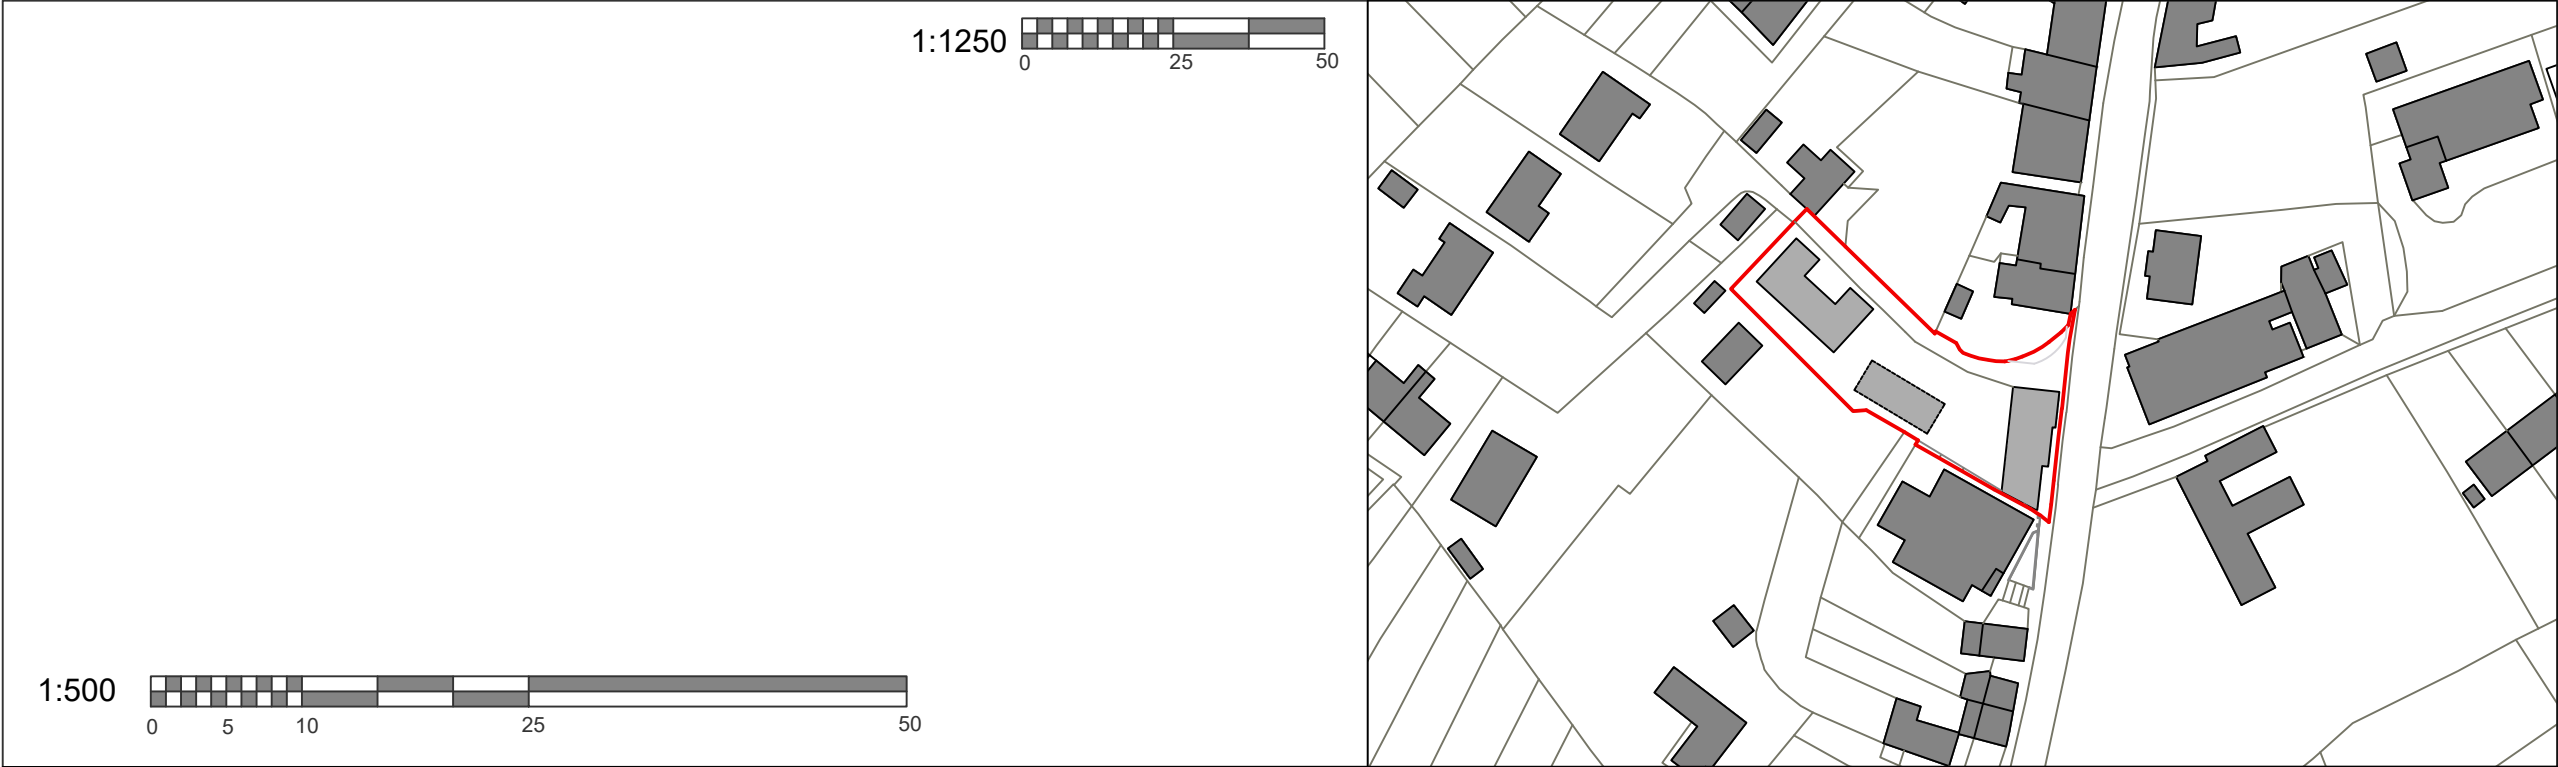


Photo 1 (above): Leyland cypress T1 growing on a raised border



Photo 2 (above): Leyland cypress T1 growing on a raised border

Appendix 4 - Tree Constraints Plan



NOTES
DO NOT SCALE
Drawing for planning purposes only
All dimensions to be checked on site.

	Category A
	Category B
	Category C
	Category U
	Standard root protection area described as a circle
	Modified root protection area described as a digon
A: Avenue G: Group of trees H: Hedge or hedgerow O: Orchard T: Individual tree W: Woodland	

Office: 01823 80 77 66
Email: hello@hellis.biz
Website: www.hellis.biz

Project: Tisbury Motors, High Street, Tisbury SP3 6HF

Title: Tree Constraints Plan ref: TCPTM

Date: August 2026 V2.0

Based on a drawing provided by Historic Building Advisory Service

The purpose of this plan is to illustrate issues associated with the trees present on and immediately adjacent to the site.

The original of this drawing was produced in colour – a monochrome copy should not be relied upon.



HELLIS



SOLUTIONS LIMITED

Arboriculture & Landscape Design



Email: hello@hellis.biz

Tel: 01823 807766

