


LEGEND


- Category 'A' - Good - Structurally sound; weathertight; no significant repairs needed.
- Category 'B' - Fair - Structurally sound; in need of minor repair; showing signs of a lack of general maintenance.
- Category 'C' - Poor - Deteriorating masonry; leaking roof; defective rainwater goods, usually accompanied by rot outbreaks; general deterioration of most elements of the building fabric, including external joinery; or where there has been a fire or other disaster which has affected part of the building.
- Category 'D' - Very Bad - Structural failure or clear signs of structural instability; loss of significant areas of the roof covering, leading to major deterioration of the interior; or where there has been a major fire or other disaster affecting most of the building.

COLOUR KEY


- Category 'A'
- Category 'B'
- Category 'C'
- Category 'D'
- Loose stone
- Exfoliation of stone
- Major loss of mortar
- Existing cement based repair
- Corroded metal
- Vegetation

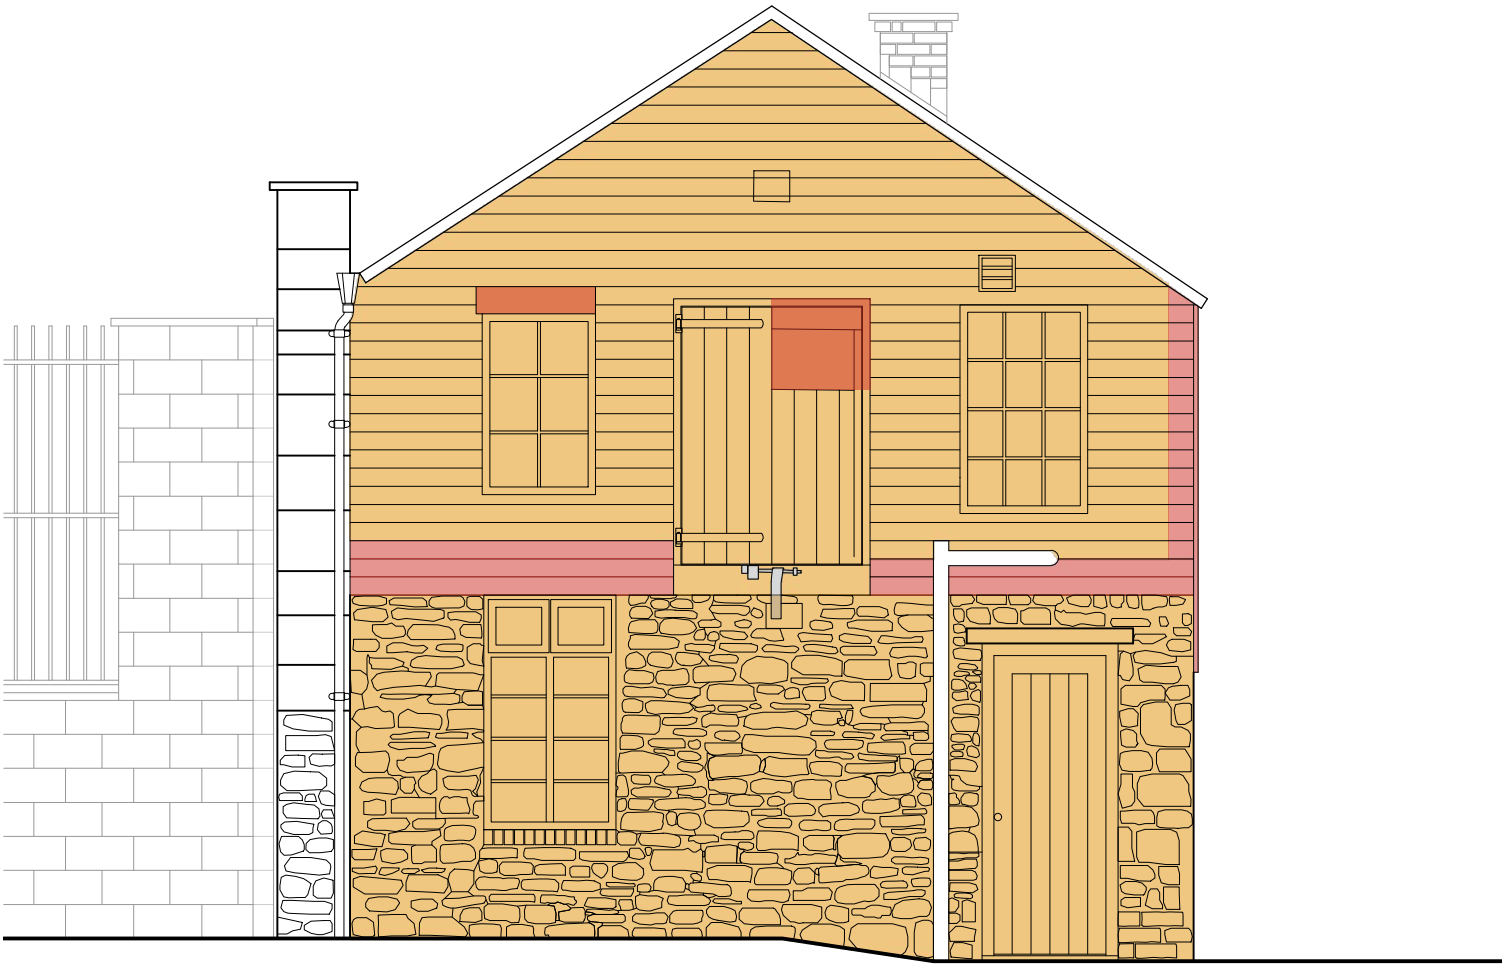


SOUTH WEST ELEVATION (SIDE)

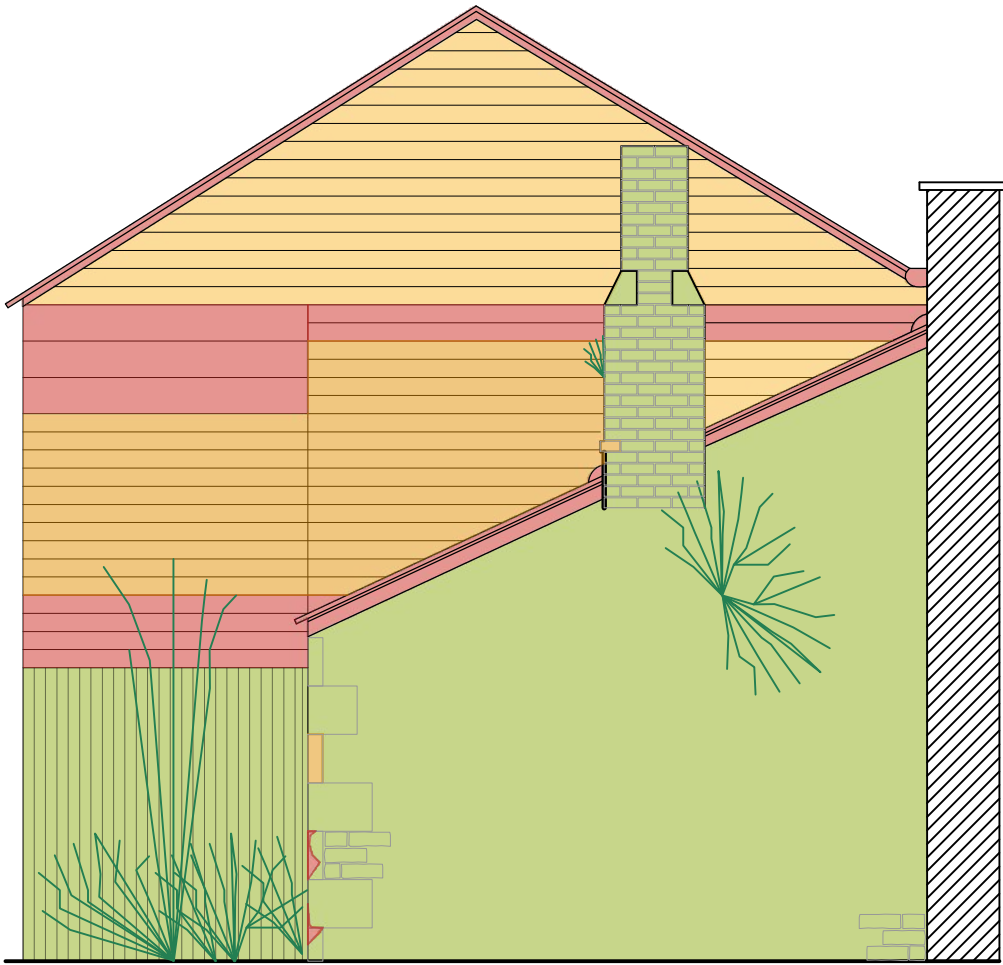

NORTH EAST ELEVATION (SIDE)

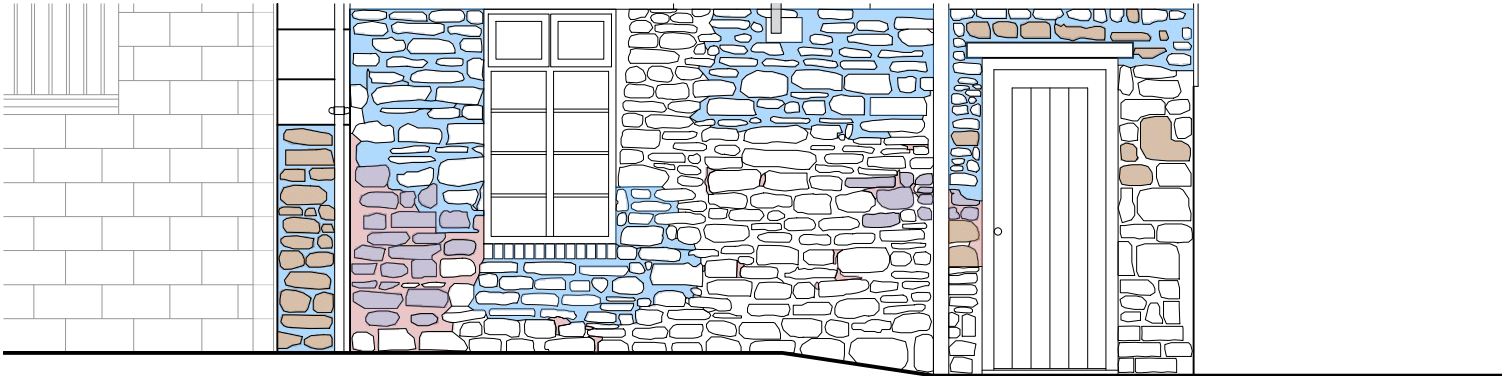

SOUTH WEST ELEVATION (SIDE) STONE

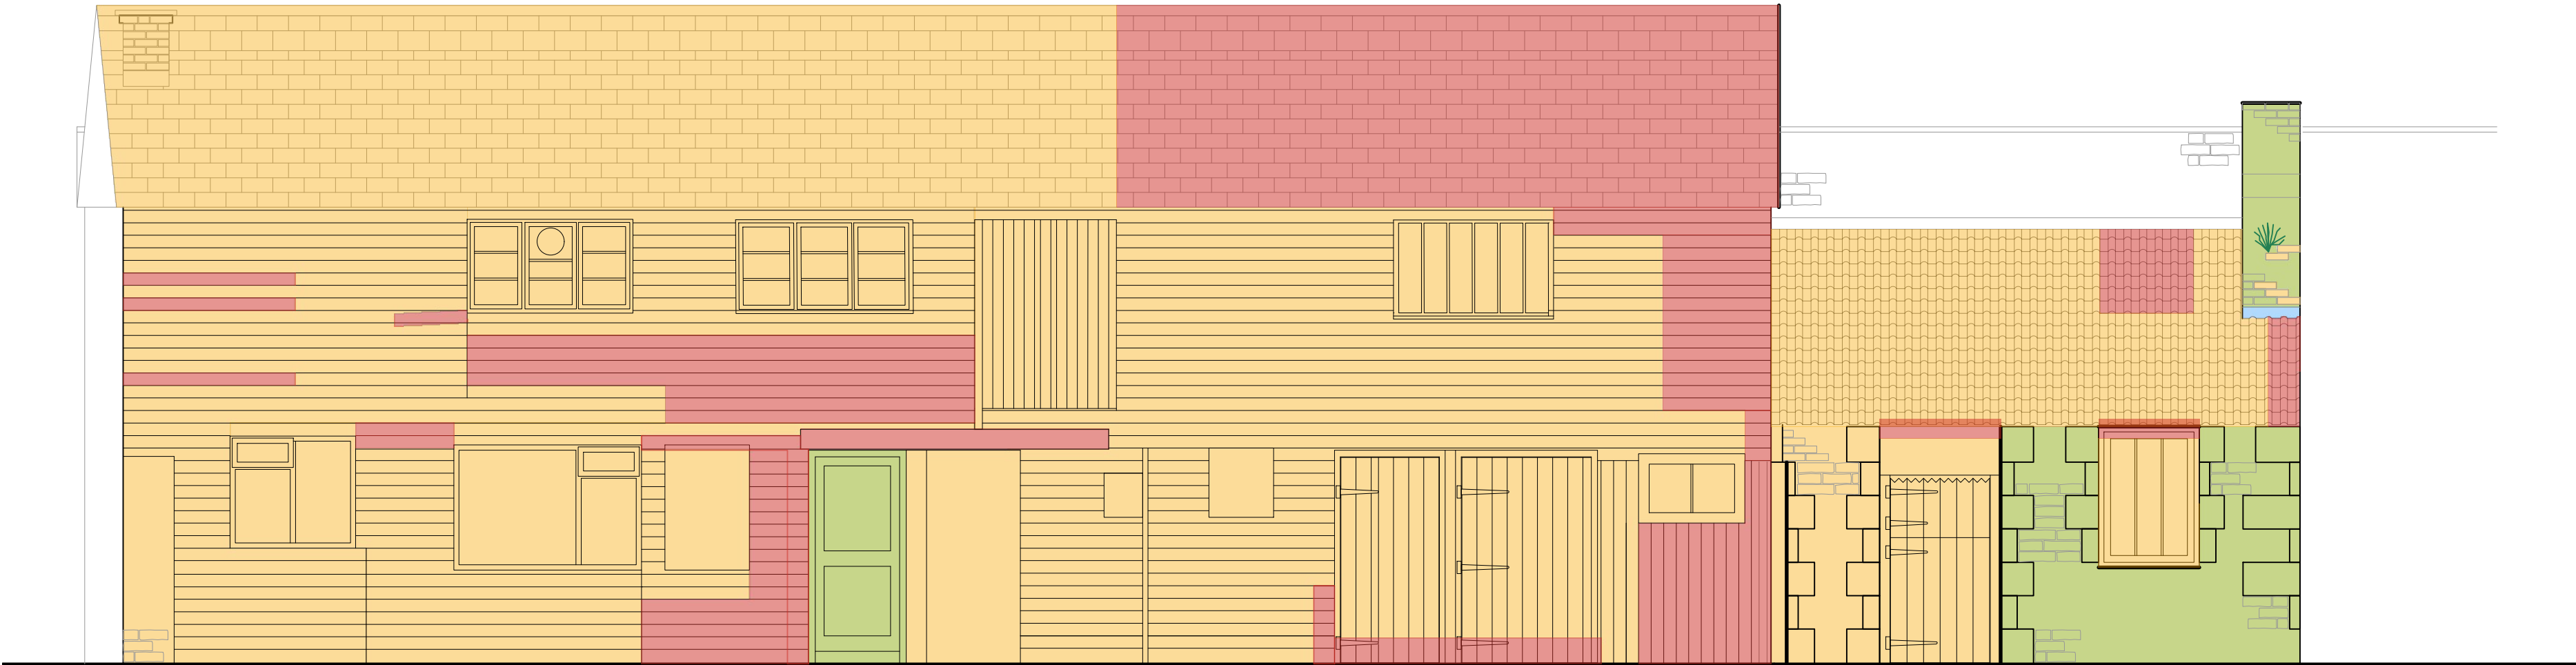

SOUTH EAST ELEVATION (FRONT)

Rev	Date	Details	Rev	Status
Project	Stage	Drawing	Rev	Status
4580	3	0002	-	PLANNING
Scale	Size	Drawn	Check	Creation
1:50	A2 L	BBA	NV	2025.10.15
Project				
The Weighbridge				
Old Road, Chippenham SN15 1HW				
Detail				
External Condition Survey				



THIS DRAWING IS COPYRIGHT ©
Responsibility is not accepted for errors made by others in scaling from this drawing
All construction information should be taken from figured dimensions only
Discrepancies must be reported to the Architect before proceeding