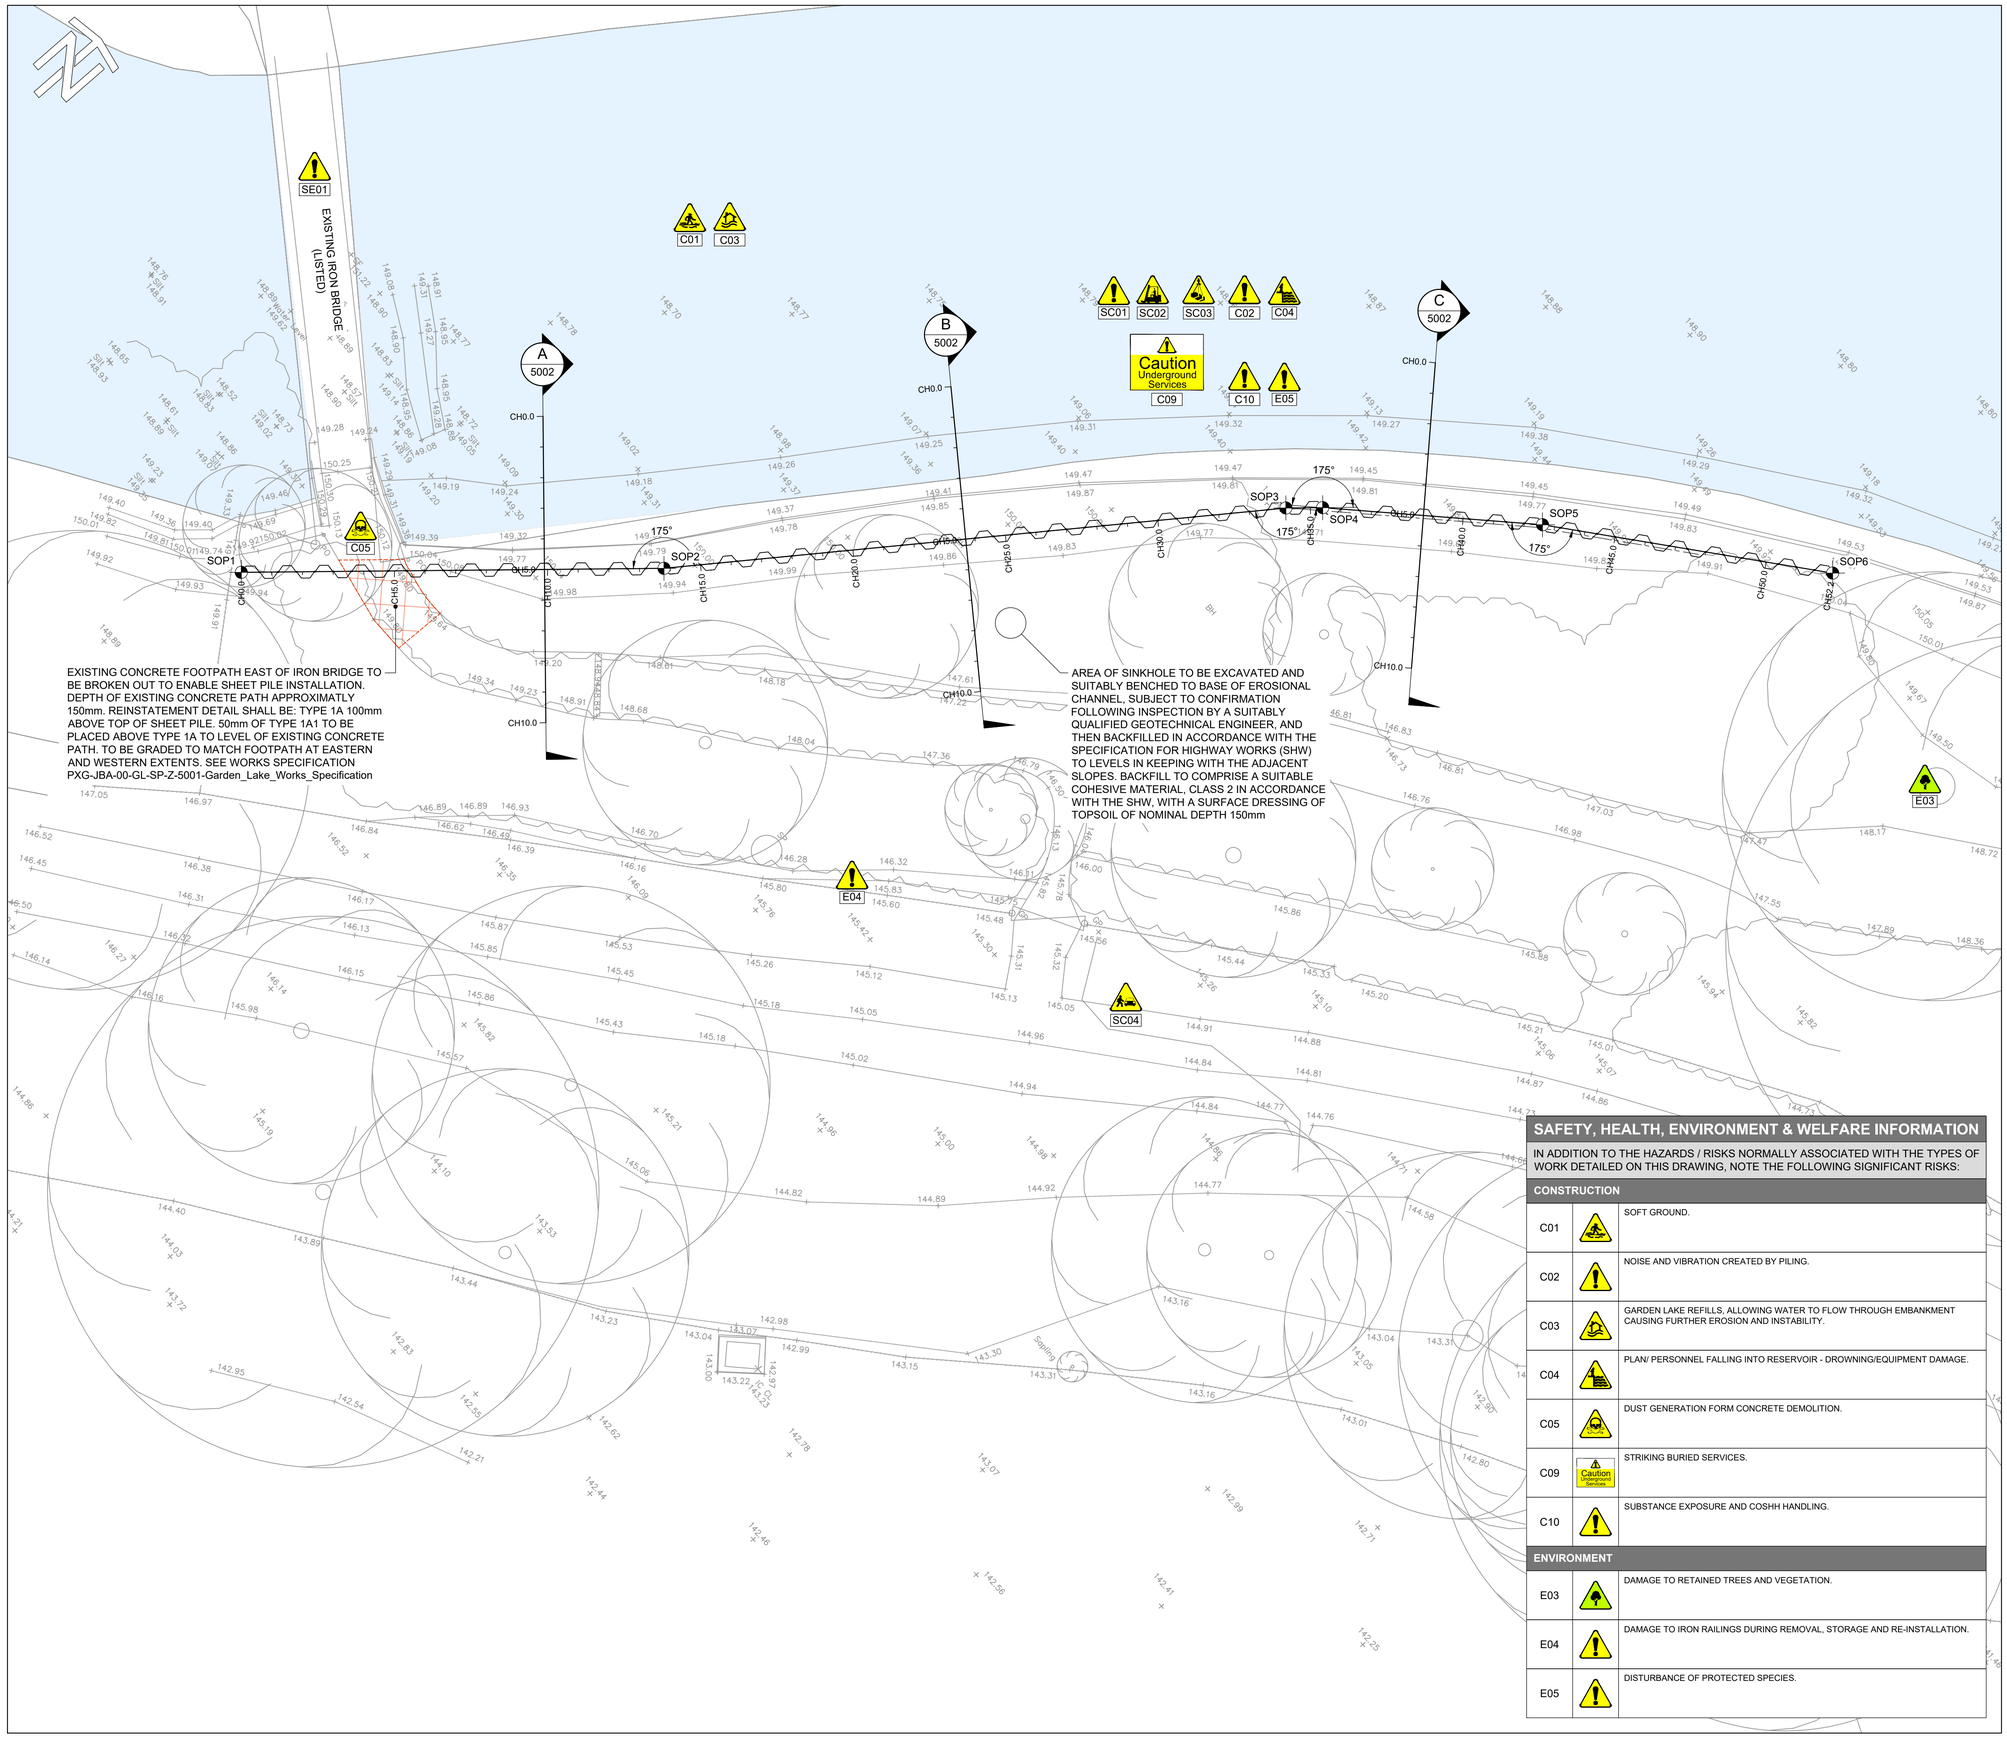


GENERAL NOTES

1. ALL DIMENSIONS ARE IN MILLIMETRES UNLESS NOTED OTHERWISE.
2. ALL LEVELS ARE IN METRES RELATIVE TO ORDNANCE DATUM NEWLYN (mAOD) UNLESS NOTED OTHERWISE.
3. ALL COORDINATES ARE IN METRES RELATIVE TO ORDNANCE SURVEY NATIONAL GRID.
4. DO NOT SCALE FROM THIS DRAWING. ALL DIMENSIONS MUST BE CHECKED / VERIFIED ON SITE.
5. TOP WATER LEVEL IS 149.34 AS DEFINED IN 2023 S10 REPORT.
6. PILING SHALL BE UNDERTAKEN ACCORDING TO THE WORKS SPECIFICATION REF. PXG-JBA-00-GL-SP-Z-5001.
7. IRON RAILINGS TO BE REMOVED TO FACILITATE ACCESS, CONTRACTOR TO DETERMINE EXTENTS AND LIAISE WITH NATIONAL TRUST. TO BE UNDERTAKEN AS PER THE WORKS SPECIFICATION REF. PXG-JBA-00-GL-SP-Z-5001.

SETTING OUT INFORMTION

REFERENCE	EASTING (mE)	NORTHING (mN)
SOP1	377069.729	133853.305
SOP2	377078.687	133863.803
SOP3	377090.525	133880.416
SOP4	377091.304	133881.329
SOP5	377096.437	133886.378
SOP6	377103.842	133892.488

SAFETY, HEALTH, ENVIRONMENT & WELFARE INFORMATION

IN ADDITION TO THE HAZARDS / RISKS NORMALLY ASSOCIATED WITH THE TYPES OF WORK DETAILED ON THIS DRAWING, NOTE THE FOLLOWING SIGNIFICANT RISKS:

CONSTRUCTION (MOST SIGNIFICANT RISKS)

SC01	⚠	SITE CONSTRAINTS, SMALL WORKING AREA.
SC02	⚠	EMBANKMENT FAILURE THROUGH LOADING DURING CONSTRUCTION.
SC03	⚠	LIFTING OPERATIONS.
SC04	⚠	PLANT/PUBLIC INTERFACE RESULTING IN COLLISION/DEATH/INJURY/DAMAGE TO PUBLIC/SITE VEHICLES/PLANT.

ENVIRONMENT (MOST SIGNIFICANT RISKS)

SE01	⚠	DAMAGE TO IRON BRIDGE (GRADE II LISTED)

UTILITY SERVICES INVESTIGATION GAUGE TO PAS 128

TYPE D: DESK STUDY
TYPE C: DESK STUDY WITH SITE RECONNAISSANCE
TYPE B: DESK STUDY, SITE RECONNAISSANCE AND DETECTION SURVEY
TYPE A: DESK STUDY, SITE RECON, DETECTION SURVEY AND TRIAL HOLES

TYPE D	TYPE C	TYPE B	TYPE A
14/10/25	-	-	-

THE POSITION OF ANY EXISTING PUBLIC OR PRIVATE SEWERS, UTILITY SERVICES, PLANT OR APPARATUS SHOWN ON THIS DRAWING HAS BEEN OBTAINED FROM STATUTORY RECORDS. THE INFORMATION SHOWN IS BELIEVED TO BE CORRECT BUT NO WARRANTY TO THIS IS EXPRESSED OR IMPLIED. OTHER SUCH PLANT OR APPARATUS MAY ALSO BE PRESENT BUT NOT SHOWN. INVESTIGATIONS MUST BE UNDERTAKEN ON SITE CONFIRMING LOCATIONS BEFORE BREAKING GROUND.

5 4 3 2 1 0 2 4 6
SCALE 1:100 (m)

Rev.	Description	Date	Author	Designer	Checker	Approver
C02	PUBLISHED DESIGN - UPDATED FOR PATH REINSTATEMENT DETAIL & PILE SECTION	27/11/25	OK	SW	PM	JB
C01	PUBLISHED DESIGN	28/10/25	OK	SW	PM	JB
P01	FOR REVIEW AND COMMENT	26/09/25	OK	SW	PM	MC

Document Control

Supplier
West Point
Peterborough Business Park
Lynch Wood
PETERBOROUGH
PE2 6GG
T +44 (0)1733 715960
E info@jbaconsulting.com
www.jbaconsulting.com
Twitter @JBAConsulting

Project Title
STOURHEAD MIOS DETAILED DESIGN

Drawing Title
GARDEN LAKE GENERAL ARRANGEMENT

© copyright reserved

National Trust

Parent Model
NOT FROM MODEL

Security Classification	Scale
OFFICIAL	1:100

Author	Designer	Checker	Approver
O. KNOTT	S. WATKINS	P. MASON	M. CROSS

Suitability	Status	Revision
PUBLISHED DESIGN	A3	C02

Information Container — A1 Sheet Size
PXG-JBA-00-GL-DR-Z-5001.dwg

SAFETY, HEALTH, ENVIRONMENT & WELFARE INFORMATION

IN ADDITION TO THE HAZARDS / RISKS NORMALLY ASSOCIATED WITH THE TYPES OF WORK DETAILED ON THIS DRAWING, NOTE THE FOLLOWING SIGNIFICANT RISKS:

CONSTRUCTION

C01	⚠	SOFT GROUND.
C02	⚠	NOISE AND VIBRATION CREATED BY PILING.
C03	⚠	GARDEN LAKE REFILLS, ALLOWING WATER TO FLOW THROUGH EMBANKMENT CAUSING FURTHER EROSION AND INSTABILITY.
C04	⚠	PLAN/ PERSONNEL FALLING INTO RESERVOIR - DROWNING/EQUIPMENT DAMAGE.
C05	⚠	DUST GENERATION FORM CONCRETE DEMOLITION.
C09	Caution Underground Services	STRIKING BURIED SERVICES.
C10	⚠	SUBSTANCE EXPOSURE AND COSHH HANDLING.

ENVIRONMENT

E03	⚠	DAMAGE TO RETAINED TREES AND VEGETATION.
E04	⚠	DAMAGE TO IRON RAILINGS DURING REMOVAL, STORAGE AND RE-INSTALLATION.
E05	⚠	DISTURBANCE OF PROTECTED SPECIES.

JBA Project Reference: 2025s0768