


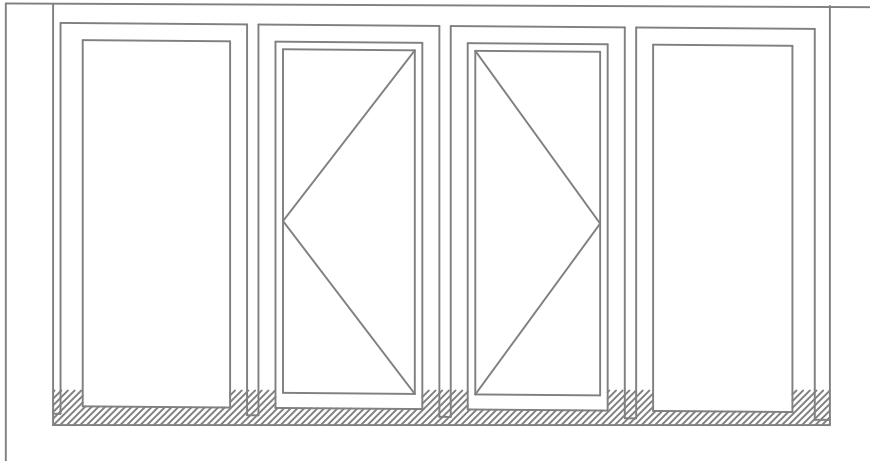

Drawing from exterior



Photo from interior

Description:

Chilmark stone mullioned window with matching, moulded transom.

Mouldings are ovolo with fillets. The sills and transome have weathered resulting in a loss of profiles.

Glazing is hand-blown cylinder glass. Glass quarries are fixed using a mixture of linseed oil putty and/or a soft lime mortar.

There are 2 metal, side-hung casements with wrought iron, spring casement stays.

Joinery:

There is a panelled shutter below the sill, hidden in the panelling, which could be drawn up to cover the inside of the window.

Schedule of works

Remove the casements, sprung stays and frames. Replace missing catches and stays, to match existing.

De-rust the metal components. Paint with an epoxy-based primer and give 2 coats of Zinser oil-based paint in off-white. Replace the casements in a soft lime mortar.